

[EXTERNAL] City of Terrace - Unit 85 | Update

From Chelsea Perkins-Lamb <cperkins-lamb@vvgtruck.ca>

Date Mon 5/5/2025 12:10 PM

To Jake Kirby <jkirby@terrace.ca>

Cc Terrace Service <terraceservice@vvgtruck.ca>

*Emailed Wayne - Apr 6/2025  
to review Inspection Results.*

 17 attachments (3 MB)

IMG\_3585.jpg; IMG\_3584.jpg; IMG\_3583.jpg; IMG\_3582.jpg; IMG\_3581.jpg; IMG\_3580.jpg; IMG\_3579.jpg; IMG\_3578.jpg; IMG\_3577.jpg; IMG\_3576.jpg; IMG\_3575.jpg; IMG\_3574.jpg; IMG\_3573.jpg; IMG\_3572.jpg; IMG\_3571.jpg; IMG\_3569.jpg; IMG\_3568.jpg;

Good afternoon Jake,

We have completed the inspection on this unit and it does fail. We have the below noted and required repairs. I have also attached photos of the faults as well.

**Required:**

- Exhaust clamp leaking and pipe loose on inlet at aftertreatment. Support clamp broken and suspect bellows is broken too
- #3 axle torque rod bushings worn
- 1R brake shoes rust jacking
- 2R brake shoes rust jacked and broken
- Air leak under hood w/ brakes released
- Frame rust jacked well beyond allowable on both sides - lots of material gone; will need new rails
- Deck crossmembers rotted out
- Jockey box/dry box brackets rust jacking
- 3 rear tie downs seized on driver's side

**Recommended:**

- Front engine leaking oil (possibly front main)
- Air build time very slow (50-90psi takes 2m40s; max is 3m)
- Should replace wipers

Please let us know where you would like us to proceed from here.

Thank you,

**Chelsea Perkins-Lamb**

Service Advisor

 250.635.4938 |  [velocitytruckcentres.ca](http://velocitytruckcentres.ca)  
5408 Hwy 16 W, Terrace, BC, V8G 0C6, Canada



**When replying to this email, please reply all due to shift work.**

**Access Our Online Payment Portal**