\$0.000

W300d - WorkOrderDetailsByDate

5/23/2025 9:58:44 AM

WORK ORDER: 128808
ASSET NUMBER: 30547

Work Order Status: C - C - Closed Date In: 06/27/2016

Work Order Shop: 1 - TTM-VehicleRepair Date Out: 06/27/2016

ASSET NUMBER INFORMATION

YEAR: 2016 ORG: Active Fleet TIRE SIZE: P225/65R17

MAKE: Dodge DEPT: CC12164 - FAES | Information ENGINE SIZE: 3.6L

Technology

MODEL: Journey BILL CODE: YYYYYYNNNY1NYY TRANS: 6S Auto

LICENSE: 30-547 SITE: Columbus, Ohio FUEL TYPE: U, NFT

OPERATOR: SERIAL NUMBER: 3C4PDCBG6GT199681 ASSET AVAIL CODE: 0000 to 2359 On Call

24/5

CLASS: Truck, Sport Utility, ¼ Ton, 4 Door, HILM METERS: Mileage - 87

MISCELLANEOUS COSTS

CODE DESCRIPTION POSTED DATE MISC COST

Title Work, Administrative Title Work, Administrative 06/27/2016 \$50.000

WORK ORDER TOTALS

TOTAL PARTS: \$0.000 PARTS TAX: \$0.000 MANUAL ADJUSTMENTS:

TOTAL SUBLET: \$0.000 SUBLET TAX: \$0.000

TOTAL LABOR: \$0.000 TOTAL MISC: \$50.000 **TOTAL COST:** \$50.000

NOTES

Title Work - Billed \$50 for title work.

5/23/2025 9:58:44 AM

WORK ORDER: 128809 ASSET NUMBER: 30547

\$0.000

SUBLET TAX:

Work Order Status: C - C - Closed Date In: 06/27/2016

Work Order Shop: 1 - TTM-VehicleRepair Date Out: 07/14/2016

ASSET NUMBER INFORMATION

YEAR: 2016 ORG: Active Fleet TIRE SIZE: P225/65R17

MAKE: Dodge DEPT: CC12164 - FAES | Information ENGINE SIZE: 3.6L

Technology

MODEL: Journey BILL CODE: YYYYYYNNNY1NYY TRANS: 6S Auto

LICENSE: 30-547 SITE: Columbus, Ohio FUEL TYPE: U, NFT

OPERATOR: SERIAL NUMBER: 3C4PDCBG6GT199681 ASSET AVAIL CODE: 0000 to 2359 On Call

24/5

CLASS: Truck, Sport Utility, ¼ Ton, 4 Door, HILM METERS: Mileage - 87

TECHNICIAN RE	PAIRS PERFORME	D		
TECH	END DATE	REPAIR DESCRIPTION	HOURS	LABOR COST
GILLESPIE.233	06/28/2016	Preventive Maintenance Service / Preventative Maintenance / Safety Inspection / Perform	0.52	\$50.000

PARTS ISSUED							
PART NUMBER	S/NS	ISS QTY	PART PRICE	ISSUE DATE	TOTAL PART COST		
1149-0140	NS	1.000	\$23.996	06/27/2016	\$23.996		
PART NAME: First Aid Kit; 25 Person REPAIR: Preventive Maintenance Service / Preventative Maintenance / Safety Inspection / Perform							
0590-0100	S	1.000	\$40.281	06/27/2016	\$40.281		

PART NAME: Extinguisher, Fire, ABC, 2.5 Lb REPAIR: Preventive Maintenance Service / Preventative Maintenance /

Safety Inspection / Perform

\$0.000

MISCELLANEOUS COSTS CODE DESCRIPTION POSTED DATE MISC COST **Environmental Charge Environmental Charge** 06/28/2016 \$5.000 **WORK ORDER TOTALS** TOTAL PARTS: \$64.277 PARTS TAX: \$0.000 MANUAL ADJUSTMENTS: \$0.000

TOTAL LABOR: \$50.000 TOTAL MISC: \$5.000 **TOTAL COST:** \$119.277

NOTES

TOTAL SUBLET:

Safety Inspection & New Vehicle Check-In - New Vehicle Check-In Required Safety Inspection Needs OSU Decals Installed by Tim Smith Temp Tag - C911961; Vehicle ready call - Matthew DeVore.38(330) 202-3577 Ext devore.38@osu.edu Spoke with Matt, vehicle is ready for pick up.; VEhicle pick up - Tim Barkley picked up the vehicle.

The Ohio State University - Fleet WORK ORDER DETAILS REPORT Management

W300d - WorkOrderDetailsByDate

			WORK O	RDER:	15310	5			
			ASSET N	UMBER	k: 3054	7			
Work Order Status	s: C - C - Closed							Date In:	03/11/2020
Work Order Shop:	1 - TTM-VehicleRepai	ir						Date Out:	03/23/2020
ASSET NUMBER	INFORMATION								
YEAR: 2016		ORG:	Active Fleet				TIRE SIZE: P2	225/65R17	
MAKE: Dodge		DEPT:	CC10011 -	OCIO Cı	ıstomer Solı	ıtions	ENGINE SIZE	: 3.6L	
MODEL: Journey		BILL C	ODE: YYYYY	YNNNY1N	IYY		TRANS: 6S Au	uto	
LICENSE: 30-547		SITE:	Columbus, (Ohio			FUEL TYPE: U	, NFT	
OPERATOR:		SERIA	L NUMBER:	3C4PDCB	G6GT19968:	1	ASSET AVAIL 24/5	CODE: 0000 t	o 2359 On Call
CLASS: Truck, Spo	ort Utility, ¼ Ton, 4 Do	or, HILM					METERS: Mile	age - 47396	
TECHNICIAN RE	PAIRS PERFORMED								
TECH	END DATE	REPAIR D	ESCRIPTION	ı			HOU	JRS	LABOR COST
SNOW-WARD	03/12/2020		e Maintenan nce / Safety		,	ive	0).42	\$0.000
SNOW-WARD	03/12/2020		e Maintenan nce / PM A S			tive	0	0.40	\$17.000
SNOW-WARD	03/23/2020	General R	tepair / Tires	/Wheels	Tire / Repla	ace	2	1.23	\$189.338
PARTS ISSUED									
PART NUMBER	S	S/NS	ISS QTY	PA	RT PRICE	ISSUE	DATE	TO	TAL PART COST
2022-645	S	3	1.000		\$5.584	03/12/	2020		\$5.584
PART NAME: Filte	<u>, </u>			A Service	Preventive e / Perform		ince Service / Pi	reventative Ma	
045-020	S	3	6.000		\$3.683	03/12/	2020		\$22.098
PART NAME: Oil,	0W20, Synthetic, Bulk;	1-Qt.			Preventive e / Perform	Maintena	ince Service / Pi	reventative Ma	
007-0100	S		1.000		\$1.816	03/12/			\$1.816
	d, Washer, Windshield,	, 		A Service	e / Perform		nce Service / Pr	reventative Ma	
017-9201454	N	IS	1.000		\$8.768	03/13/	2020		\$8.768
PART NAME: Valv	ves, Tire, TPMS; 4-Pc.			REPAIR:	General Re	epair / Tir	es/Wheels / Tire	e / Replace	
017-F003019		IS	4.000		\$83.018	03/20/			\$332.072
	, Firestone All Season;	225/65R17		REPAIR:	General Re	epair / Tir	es/Wheels / Tire	e / Replace	
MISCELLANEOUS									
CODE	DESCRIF					STED DA			MISC COST
Environmental Ch		nental Charge			03	/12/2020			\$1.700
MANUAL ADJUS	TMENTS								
REASON						EATED DA	ATE		AMOUNT
Exceeded estimate	e				04	/07/2020			(\$86.540)

The Ohio State University - Fleet Management

WORK ORDER DETAILS REPORT

p.4

W300d - WorkOrderDetailsByDate

5/23/2025 9:58:44 AM

TOTAL PARTS: \$370.338 PARTS TAX: \$0.000 MANUAL ADJUSTMENTS: (\$86.540)

TOTAL SUBLET: \$0.000 SUBLET TAX: \$0.000

TOTAL LABOR: \$206.338 TOTAL MISC: \$1.700 **TOTAL COST: \$491.836**

NOTES

Tire Check, Fueling Concern, PMA, Safety Inspection - Greg McGoon.2 614-965-0705 Walk-in 3/11/2020 Tire Check, Fueling Concern, PMA, Safety Inspection Customer states that the keep putting air in the front passenger tire. When fueling the pump always stops as if it was full but the gauge says its still about 1/8 short of being full. Customer is new to the university and has had the vehicle for a week and doesn't think the vehicle is getting good fuel mileage. Keys Yes; Fuel economy concern - The vehicle is rated at 19 mpg combined driving. Average since November 1st 2019 is 21mpg.; safety - gas issue- we can price out evap canister for rear gas tank,nothing lounged in filler neck/also bring vehicle back with gas at least at half of tank so we can confirm gas pumping issues fuel milage- see JOHN MARLO TIRES- REC 4 TIRES FOR NEXT PM 225/65/17 NOTE- NO NAILS FOUND NO TIRE LIGHT ON ARRIVAL NOR DEPARTURE NO OTHER ISSUES AT THIS TIME; Tire Light - Customer picked the vehicle up and stated that the tire light came back on. He wants the vehicles tire inspected again.; Estimate - Estimate sent to customer.; Estimate approval - Estimate approved via erequest.; ER - ER PR Number PR5695401; tires - 3/23/2020 8:13:28 AM all 4 replaced; Vehicle ready email - Emailed Greg vehicle is ready for pick up.; Vehicle pick up - Greg picked up vehicle.; Parts - Tires need added.

5/23/2025 9:58:44 AM

WORK ORDER: 157934
ASSET NUMBER: 30547

Work Order Status: C - C - Closed Date In: 09/28/2020

Work Order Shop: 1 - TTM-VehicleRepair Date Out: 10/16/2020

ASSET NUMBER INFORMATION

YEAR: 2016 ORG: Active Fleet TIRE SIZE: P225/65R17

MAKE: Dodge DEPT: CC10011 - OCIO | Customer Solutions ENGINE SIZE: 3.6L

MODEL: Journey BILL CODE: YYYYYYNNNY1NYY TRANS: 6S Auto

LICENSE: 30-547 SITE: Columbus, Ohio FUEL TYPE: U, NFT

OPERATOR: SERIAL NUMBER: 3C4PDCBG6GT199681 ASSET AVAIL CODE: 0000 to 2359 On Call

24/5

CLASS: Truck, Sport Utility, ¼ Ton, 4 Door, HILM METERS: Mileage - 47396

TECHNICIAN REPAIRS PERFORMED

TECH END DATE REPAIR DESCRIPTION HOURS LABOR COST
MADDEN 10/16/2020 Accident / Glass Component / Mirror / Replace 1.46 \$124.288

PARTS ISSUED

PART NUMBER S/NS ISS QTY PART PRICE ISSUE DATE TOTAL PART COST

007-0066 NS 1.000 \$114.036 10/13/2020 \$114.036

PART NAME: Mirror, Exterior, LH REPAIR: Accident / Glass Component / Mirror / Replace

MISCELLANEOUS COSTS

CODE DESCRIPTION POSTED DATE MISC COST

Environmental Charge Environmental Charge 10/16/2020 \$12.420

MANUAL ADJUSTMENTS

REASON CREATED DATE AMOUNT

Labor overage 10/16/2020 (\$52.000)

WORK ORDER TOTALS

TOTAL PARTS: \$114.036 PARTS TAX: \$0.000 MANUAL ADJUSTMENTS: (\$52.000)

TOTAL SUBLET: \$0.000 SUBLET TAX: \$0.000

TOTAL LABOR: \$124.288 TOTAL MISC: \$12.420 **TOTAL COST:** \$198.744

NOTES

Driver side mirror replacement - Greg McGoon.2 614-965-0705 Walk-in 9/28/2020 Driver side mirror replacement.; Estimate Approval - Estimate approved via erequest.; ER - ER PR5901163; Driver side mirror - 10/16/2020 Removed door panel and window arch trim for access. Replaced exterior mirror. Checked operation. Complete.; Vehicle pick up - Vehicle picked up by customer.

The Ohio State University - Fleet WORK ORDER DETAILS REPORT Management

W300d - WorkOrderDetailsByDate

			WORK C	RDER:	16159	9		
			ASSET N	IUMBER	: 3054	17		
Work Order Stat	us: C - C - Clos	ed					Date In:	12/07/2020
Work Order Shop	o: 1 - TTM-Vel	nicleRepair					Date Out	: 12/10/202
ASSET NUMBER	RINFORMATIO	ON						
YEAR: 2016			ORG: Active Fleet				TIRE SIZE: P225/65R17	
MAKE: Dodge			DEPT: CC10011 -	OCIO Cu	ıstomer Sol	utions	ENGINE SIZE: 3.6L	
MODEL: Journey			BILL CODE: YYYY	YYNNNY1N	YY		TRANS: 6S Auto	
LICENSE: 30-54	7		SITE: Columbus,	Ohio			FUEL TYPE: U, NFT	
OPERATOR:			SERIAL NUMBER:	3C4PDCB0	G6GT19968	31	ASSET AVAIL CODE: 000 24/5	0 to 2359 On Call
CLASS: Truck, S	port Utility, ¼ T	on, 4 Door, HIL	М				METERS: Mileage - 4739	6
TECHNICIAN R	EPAIRS PERFO	ORMED						
TECH	END DATE	RE	PAIR DESCRIPTIO	N			HOURS	LABOR COST
SNOW-WARD	12/10/2020	0 Ge	neral Repair / Eng	ne / Seal (Oil Front / F	Replace	0.92	\$78.106
SNOW-WARD	12/10/2020	0 Ge	neral Repair / Brak	ces / Brake	eJobFront /	Replace	2.87	\$243.974
SNOW-WARD	12/10/2020	0 Ge	neral Repair / Engi	ne / Seal	Oil Front / [Diagnosis	0.25	\$21.085
PARTS ISSUED								
PART NUMBER		S/NS	ISS QTY	' PAI	RT PRICE	ISSUE [DATE	TOTAL PART COST
2022-645		S	1.000)	\$5.584	12/08/2	2020	\$5.584
PART NAME: Filt	ter, Oil				Preventive Perform	e Maintena	nce Service / Preventative	Maintenance / PM
045-75540		NS	6.000)	\$3.972	12/08/2	2020	\$23.832
PART NAME: Oil	, 0w20, Synthe	tic; 1-Qt.			Preventive Perform	e Maintena	nce Service / Preventative	Maintenance / PM
013-48880964		NS	2.000)	\$66.794	12/09/2	2020	\$133.588
PART NAME: Ro	tor, Brake, Fron	nt		REPAIR:	General R	lepair / Bra	kes / BrakeJobFront / Rep	
013-SS8800X		NS	1.000		\$38.961	12/09/2		\$38.961
PART NAME: Pa	ds, Brake, Front			REPAIR:	General R	lepair / Bra	kes / BrakeJobFront / Rep	lace
045-OS30833		NS	1.000		\$21.775	12/09/2		\$21.775
PART NAME: Ga		et ————		REPAIR:	General R	tepair / Eng	gine / Seal Oil Front / Repla	ace
MISCELLANEOU	JS COSTS							
CODE		DESCRIPTION				OSTED DAT	ΓE	MISC COST
Environmental C	-	Environmental (_narge		1.	2/16/2020		\$25.000
MANUAL ADJUS	STMENTS							
REASON						REATED DA	TE	AMOUNT
Labor Overage						2/16/2020		(\$24.000)
WORK ORDER	TOTALS							
TOTAL PARTS:		\$223.740	PARTS TAX:			\$0.000	MANUAL ADJUSTMENTS:	(\$24.000

The Ohio State University - Fleet Management

WORK ORDER DETAILS REPORT

p.7

W300d - WorkOrderDetailsByDate

5/23/2025 9:58:44 AM

TOTAL SUBLET: \$0.000 SUBLET TAX: \$0.000

TOTAL LABOR: \$343.165 TOTAL MISC: \$25.000 **TOTAL COST: \$567.905**

NOTES

Oil leak, Transmission Leak, Brake check - Greg McGoon 614-965-0705 Appointment Time: Mon 12/7/2020 8:30 AM Oil leak, Transmission Leak, Brake check Customer stated they went to get an oil change and the vendor said that they see an oil leak, and transmission fluid leak. Customer stated that the front driver side is clicking whenever he goes to apply the brakes. Keys Yes; Sublet PMA - PMA completed by Vavoline.; cvi - oil secondary oil pan gasket leaking brakes front pads and rotors rust lip all most grinding clicking noise trans leak not an issue; Estimate - Estimate sent to customer.; Estimate Approval - PR6015925 submitted for approval in amount of \$567.46; ER - ER PR6015925; oil pan gasket - 12/10/2020 7:27:39 AM replaced no leaks at this time; brakes front - 12/10/2020 10:21:30 AM replaced front pads and rotors; Vehicle ready email - Emailed customer vehicle is ready for pick up.; Vehicle pick up - Vehicle picked up by customer.

\$142.120

W300d - WorkOrderDetailsByDate

5/23/2025 9:58:44 AM

WORK ORDER: 162029 **ASSET NUMBER:** 30547 Work Order Status: C - C - Closed Date In: 01/27/2021 Work Order Shop: 1 - TTM-VehicleRepair Date Out: 02/01/2021 **ASSET NUMBER INFORMATION** YEAR: 2016 ORG: Active Fleet TIRE SIZE: P225/65R17 DEPT: CC10011 - OCIO | Customer Solutions **ENGINE SIZE: 3.6L** MAKE: Dodge MODEL: Journey BILL CODE: YYYYYNNNY1NYY TRANS: 6S Auto LICENSE: 30-547 SITE: Columbus, Ohio FUEL TYPE: U, NFT OPERATOR: SERIAL NUMBER: 3C4PDCBG6GT199681 ASSET AVAIL CODE: 0000 to 2359 On Call 24/5 CLASS: Truck, Sport Utility, ¼ Ton, 4 Door, HILM METERS: Mileage - 101547 **TECHNICIAN REPAIRS PERFORMED TECH END DATE** REPAIR DESCRIPTION **HOURS** LABOR COST Preventive Maintenance Service / Preventative **MADDEN** 01/28/2021 0.81 \$0.000 Maintenance / Safety Inspection / Perform SNOW-WARD 02/01/2021 Accident / Steering / System / Inspect 1.13 \$96.192 SUBLET REPAIRS **VENDOR PARTS** LABOR **OTHER** OPID DATE BACK REPAIR DESCRIPTION SUBLET COST Repaired From PM Service / Campus Auto \$0.00 \$69.99 \$5.60 320 02/01/2021 \$86,928 Service Tires/Wheels / Wheel / Alignment Front **MISCELLANEOUS COSTS** MISC COST CODE **DESCRIPTION** POSTED DATE **Environmental Charge Environmental Charge** 02/03/2021 \$5.000 **MANUAL ADJUSTMENTS** REASON CREATED DATE **AMOUNT** Labor Overage 02/03/2021 (\$46.000)**WORK ORDER TOTALS** TOTAL PARTS: \$0.000 PARTS TAX: \$0.000 MANUAL ADJUSTMENTS: (\$46.000)

NOTES

TOTAL SUBLET:

TOTAL LABOR:

Suspension and Steering System Check, Safety Inspection - Greg McGoon 614-965-0705 Appointment Time: 1/27/2021 Suspension and Steering System Check, Safety Inspection Customer states that they were driving and slid on some ice and hit a curb. They said the alignment is now completely off. Keys yes; Safety inspection - 1/28/2021 Performed safety inspection. See other note for steering/suspension issues. Wipers ok. Lubed door locks and latches. Belt ok. Brakes ok. Complete.; suspension - 1/28/2021 12:41:13 PM no bent parts rec alignment; Alignment - Campus Auto - Harry & Phil took vehicle to campus auto for alignment Phillipa called with payment for Alignment \$75.59; Vehicle ready email -

\$0.000

\$5.000

TOTAL COST:

Emailed customer vehicle is ready for pick up.

; Invoice - Invoice Received ; Vehicle pick up - Vehicle picked up customer.

\$86.928

\$96.192

SUBLET TAX:

TOTAL MISC:

5/23/2025 9:58:44 AM

WORK ORDER: 168514
ASSET NUMBER: 30547

Work Order Status: C - C - Closed Date In: 07/01/2021

Work Order Shop: 1 - TTM-VehicleRepair Date Out: 07/12/2021

ASSET NUMBER INFORMATION

YEAR: 2016 ORG: Active Fleet TIRE SIZE: P225/65R17

MAKE: Dodge DEPT: CC10011 - OCIO | Customer Solutions ENGINE SIZE: 3.6L

SITE: Columbus, Ohio

MODEL: Journey BILL CODE: YYYYYYNNNY1NYY TRANS: 6S Auto

OPERATOR: SERIAL NUMBER: 3C4PDCBG6GT199681 ASSET AVAIL CODE: 0000 to 2359 On Call

24/5

FUEL TYPE: U, NFT

CLASS: Truck, Sport Utility, ¼ Ton, 4 Door, HILM METERS: Mileage - 101866

TECHNICIAN R	EPAIRS PERFORMED			
TECH	END DATE	REPAIR DESCRIPTION	HOURS	LABOR COST
BRYDIE.2	07/02/2021	General Repair / Glass Component / Window Side / Diagnosis	2.59	\$220.150
KITTS.12	07/12/2021	General Repair / Glass Component / RegulatorWindow / Replace	2.87	\$244.021
GREENWOOD	07/12/2021	General Repair / Glass Component / RegulatorWindow / Replace	0.04	\$3.258
BRYDIE.2	07/12/2021	General Repair / Glass Component / RegulatorWindow / Replace	0.08	\$7.060

PARTS ISSUED

LICENSE: 30-547

 PART NUMBER
 S/NS
 ISS QTY
 PART PRICE
 ISSUE DATE
 TOTAL PART COST

 007-73001191
 NS
 1.000
 \$110.578
 07/09/2021
 \$110.578

PART NAME: Switch, Window, Master REPAIR: General Repair / Glass Component / RegulatorWindow / Replace

MISCELLANEOUS COSTS

CODE DESCRIPTION POSTED DATE MISC COST

Environmental Charge Environmental Charge 07/12/2021 \$12.700

MANUAL ADJUSTMENTS

REASON CREATED DATE AMOUNT

Labor Overage 07/12/2021 (\$337.000)

WORK ORDER TOTALS

TOTAL PARTS: \$110.578 PARTS TAX: \$0.000 MANUAL ADJUSTMENTS: (\$337.000)

TOTAL SUBLET: \$0.000 SUBLET TAX: \$0.000

TOTAL LABOR: \$474.489 TOTAL MISC: \$12.700 **TOTAL COST:** \$260.767

NOTES

Driver Window - Greg McGoon 614-965-0705 Driver Window - Needs fixed, doesn't roll down 99%; Window - Installed a new power window switch's 7:05:59 AM 7/12/2021; Vehicle ready email - Emailed customer vehicle is ready for pick up.; Vehicle pick up - Vehicle picked up customer.

5/23/2025 9:58:44 AM

WORK ORDER: 170278
ASSET NUMBER: 30547

Work Order Status: C - C - Closed Date In: 09/01/2021

Work Order Shop: 1 - TTM-VehicleRepair Date Out: 09/22/2021

ASSET NUMBER INFORMATION

YEAR: 2016 ORG: Active Fleet TIRE SIZE: P225/65R17

MAKE: Dodge DEPT: CC10011 - OCIO | Customer Solutions ENGINE SIZE: 3.6L

SITE: Columbus, Ohio

MODEL: Journey BILL CODE: YYYYYYNNNY1NYY TRANS: 6S Auto

OPERATOR: SERIAL NUMBER: 3C4PDCBG6GT199681 ASSET AVAIL CODE: 0000 to 2359 On Call

24/5

FUEL TYPE: U, NFT

CLASS: Truck, Sport Utility, ¼ Ton, 4 Door, HILM METERS: Mileage - 101866

WORK ORDER TOTALS

LICENSE: 30-547

TOTAL PARTS: \$0.000 PARTS TAX: \$0.000 MANUAL ADJUSTMENTS: \$0.000

TOTAL SUBLET: \$0.000 SUBLET TAX: \$0.000

TOTAL LABOR: \$0.000 TOTAL MISC: \$0.000 **TOTAL COST:** \$0.000

NOTES

Sublet PMA - Sublet PMA completed by Valvoline

${\bf W300d - WorkOrder Details By Date}$

5/23/2025 9:58:44 AM

NOTES

			W	ORK (ORDER: 17	0279		
			AS	SSET N	NUMBER: 3	0547		
Work Order Statu	ıs: C - C - Clos	sed					Date In:	09/22/2021
Work Order Shop	: 1 - TTM-Ve	hicleRepair					Date Out:	10/18/2021
ASSET NUMBER	INFORMATION	ON						
YEAR: 2016			ORG: Act	ive Fleet	:		TIRE SIZE: P225/65R17	
MAKE: Dodge			DEPT: CC	10011 -	OCIO Custome	r Solutions	ENGINE SIZE: 3.6L	
MODEL: Journey			BILL COD	E: YYYY	YYNNNY1NYY		TRANS: 6S Auto	
LICENSE: 30-547	,		SITE: Col	umbus,	Ohio		FUEL TYPE: U, NFT	
OPERATOR:			SERIAL N	UMBER:	3C4PDCBG6GT1	99681	ASSET AVAIL CODE: 0000 24/5	to 2359 On Call
CLASS: Truck, Sp	oort Utility, ¼ ⁻	Ton, 4 Door, H	IILM				METERS: Mileage - 101866	,
TECHNICIAN RI	EPAIRS PERF	ORMED						
TECH	END DATE		REPAIR DESC	CRIPTIO	N		HOURS	LABOR COST
BRATTON	10/08/202	1	General Repa Diagnosis	air / Cra	nking System / S	ystem /	3.35	\$285.151
SUBLET REPAIR	RS							
VENDOR	PARTS	LABOR	OTHER	OPID	DATE BACK	REPAIR DES	SCRIPTION	SUBLET COST
Capital Towing	\$0.00	\$120.80	\$0.00	320	09/24/2021	Road Call / Towing	Unit Services / Vehicle /	\$138.920
Byers Chrysler Plymouth	\$1,533.89	\$1,175.00	\$25.00	320	10/18/2021	General Rep Bushing / R	pair / Trans Automatic / epair	\$2,933.901
Byers Chrysler Plymouth	\$0.00	\$0.00	\$0.00	320	10/18/2021		Recall Repair / Ignition ontrol Module / Repair	\$0.000
MISCELLANEOU	IS COSTS							
CODE		DESCRIPTIO	N			POSTED DA	TE	MISC COST
Environmental Ch	narge	Environment	al Charge			10/25/2021		\$8.500
MANUAL ADJUS	STMENTS							
REASON						CREATED DA	ATE	AMOUNT
Labor Overage						10/18/2021		(\$200.000)
WORK ORDER T	OTALS							
TOTAL PARTS:		\$0.000	PARTS TA	XX:		\$0.000	MANUAL ADJUSTMENTS:	(\$200.000)
TOTAL SUBLET:		\$3,072.821	SUBLET T	AX:		\$0.000		
TOTAL LABOR:		\$285.151	. TOTAL M	ISC:		\$8.500	TOTAL COST:	\$3,166.472

The Ohio State University - Fleet Management

WORK ORDER DETAILS REPORT

p.12

W300d - WorkOrderDetailsByDate

5/23/2025 9:58:44 AM

Check Engine Light, Need Estimate - Greg McGoon 614-965-0705 Walk-in 9/22/2021 Check Engine Light, Need Estimate Customer states that there were no driving issues. The check engine came on while driving. Keys Yes; check engine light - after inspection found code p0740 tcc out of range or open. vehicle will need new torque converter solenoid and transmission wiring to start for this issue could need a transmission. 9/23/2021 7:09:36 AM; Customer call -

I spoke with customer and gave update on repairs.

; Byers - I spoke with Byers Dodge and gave them vehicle concerns.; Capital Tow - Capital tow dispatched for tow.; Capital - Capital picked up vehicle.; Tow invoice received.? - Tow invoice received.; Estimate - Estimate sent to customer.; Estimate Approved - Hey Nick, RQ-1000378310 placed in for repair of the vehicle. Greg; Vendor Call - I spoke with Jase at Byers and he said they expect to have the vehicle completed by Friday of next week.; Customer email - Emailed customer update on repairs.; Vendor call - I spoke with Byers and they said vehicle will be completed on Monday.; Vendor call - I spoke with Byers, vehicle is ready for pick up.; Invoice - Invoice received from Byers.; Vehicle Return - Vehicle returned from vendor.; Vehicle ready email - Emailed customer vehicle is ready for pick up.

5/23/2025 9:58:44 AM

WORK ORDER: 172998
ASSET NUMBER: 30547

Work Order Status: C - C - Closed Date In: 04/01/2022

Work Order Shop: 1 - TTM-VehicleRepair Date Out: 04/19/2022

ASSET NUMBER INFORMATION

LICENSE: 30-547

YEAR: 2016 ORG: Active Fleet TIRE SIZE: P225/65R17

MAKE: Dodge DEPT: CC10011 - OCIO | Customer Solutions ENGINE SIZE: 3.6L

SITE: Columbus, Ohio

MODEL: Journey BILL CODE: YYYYYYNNNY1NYY TRANS: 6S Auto

OPERATOR: SERIAL NUMBER: 3C4PDCBG6GT199681 ASSET AVAIL CODE: 0000 to 2359 On Call

24/5

FUEL TYPE: U, NFT

CLASS: Truck, Sport Utility, ¼ Ton, 4 Door, HILM METERS: Mileage - 129675

TECHNICIAN REF	PAIRS PERFORMED			
TECH	END DATE	REPAIR DESCRIPTION	HOURS	LABOR COST
MADDEN	04/01/2022	Preventive Maintenance Service / Preventative Maintenance / Safety Inspection / Perform	1.15	\$0.000
MADDEN	04/01/2022	General Repair / Brakes / System / Diagnosis	1.18	\$100.158
BRATTON	04/14/2022	General Repair / Bearing Hub Wheel / Hub Wheel Assy / Replace	6.08	\$516.848
BRATTON	04/14/2022	General Repair / Brakes / Sensor ABS / Replace	1.15	\$97.774
BRATTON	04/14/2022	General Repair / Brakes / BrakeJobFront / Replace	1.35	\$114.821
GREENWOOD	04/19/2022	General Repair / Tires/Wheels / TPMS / Replace	0.00	\$0.048
GREENWOOD	04/19/2022	General Repair / Tires/Wheels / Tire / Replace	0.22	\$18.772
BRATTON	04/19/2022	General Repair / Tires/Wheels / TPMS / Replace	0.08	\$7.131
BRATTON	04/19/2022	General Repair / Tires/Wheels / Tire / Replace	0.03	\$2.479
GREENWOOD	04/19/2022	General Repair / Tires/Wheels / Tire / Install	1.51	\$128.161
BRATTON	04/19/2022	General Repair / Tires/Wheels / Tire / Install	2.13	\$181.357

5/23/2025 9:58:44 AM

PARTS ISSUED							
PART NUMBER	S/NS	ISS QTY	PART P	RICE ISS	SUE DATE	TOTA	PART COST
013-532862	NS	1.000	\$41	275 04/	/08/2022		\$41.275
PART NAME: Sensor, Spee	d, ABS		REPAIR: Ge	neral Repair ,	/ Brakes / Senso	or ABS / Replace	
013-532864	NS	1.000	\$46	5.540 04/	/08/2022		\$46.540
PART NAME: Sensor, Spee	d, ABS, Front, RH		REPAIR: Ge	neral Repair ,	/ Brakes / Senso	or ABS / Replace	
2018-9	NS	3.000	\$62	2.575 04/	/08/2022		\$187.725
PART NAME: Sensor, TPMS	5		REPAIR: Ge	neral Repair ,	/ Tires/Wheels /	TPMS / Replace	
019-2755976501	NS	2.000	\$212	2.638 04/	/08/2022		\$425.276
PART NAME: Hub Assy			REPAIR: Ge	neral Repair ,	/ Bearing Hub W	heel / Hub Wheel As	sy / Replace
013-SS8800X	NS	1.000	\$38	3.961 04/	/14/2022		\$38.961
PART NAME: Pads, Brake,	Front		REPAIR: Ge	neral Repair ,	/ Brakes / Brake	JobFront / Replace	
013-48880964	NS	2.000	\$73	3.983 04/	/14/2022		\$147.966
PART NAME: Rotor, Brake,	Front		REPAIR: Ge	neral Repair ,	/ Brakes / Brake	JobFront / Replace	
2018-9	NS	1.000	\$63	3.605 04/	/19/2022		\$63.605
PART NAME: Sensor, TPMS	5		REPAIR: Ge	neral Repair ,	/ Tires/Wheels /	TPMS / Replace	
MISCELLANEOUS COSTS							
CODE	DESCRIPTION			POSTED	DATE		MISC COST
Environmental Charge	Environmental	Charge		04/26/2	2022		\$25.000
WORK ORDER TOTALS							
TOTAL PARTS:	\$951.348	PARTS TAX:		\$0.0	00 MANUAL A	ADJUSTMENTS:	\$0.000
TOTAL SUBLET:	\$0.000	SUBLET TAX:		\$0.0	000		
TOTAL LABOR:	\$1,167.549	TOTAL MISC:		\$25.0	000 TOTAL CO	OST:	\$2,143.897

NOTES

Safety Inspection, ABS Light, Brake system check, Tire Rota - Greg McGoon 614-965-0705 Walk-in 4/1/2022 Safety Inspection, ABS Light, Brake system check, Tire Rotation Customer emailed "Today when I was driving back from one of my counties on 70W, the ABS light came on on my SUV." Keys Yes; ABS light - 4/1/2022 Vehicle had ABS and TCS lights on when pulling in. Retrieved codes from all modules, ABS module had 3 codes for left front wheel speed sensor performance. No codes for electrical problems. Raised vehicle and rotated wheels while monitoring wheel speed sensor inputs. Left front sensor signal extremely erratic and drops to 0 below ~5 mph. Right front sensor very erratic without any drop out. Suspect bad exciter rings in both front wheel bearings. Sensors will likely be damaged by removal. Needs 2 front wheel bearings and 2 wheel speed sensors.; Tires - 4/1/2022 Did not rotate tires. All tires worn out, front ones much worse than rear. Front tires show signs of toe wear. Needs 4 tires and an alignment.; Safety inspection - 4/1/2022 Performed safety inspection. Steering is loose and vehicle pulls to the right slightly. Wipers ok. Lubed door locks and latches. Belt ok. Air filter should be replaced based on mileage. Right inner tie rod end loose, needs replaced. All 4 tires worn out. Front brake pads 6mm rotors rusty. Rear brake pads 5mm rotors ok. No abnormal noise from brakes, tires are vibrating enough to prevent feeling brake pulsation, unsure of rotor warpage. Complete.; Note on brakes - 4/1/2022 If replacing front wheel bearings, recommend replacing front pads and rotors due to rust and overlapping labor.; Verbal Approval - Customer verbally approved repairs but still requested estimate.; Estimate Sent - Estimate sent to customer.; New Tires/TPMS - One new TPMS sensor was unable to read at the right front tire. TPMS on order.; Vehicle Ready Email - Emailed customer to pick up vehicle.

5/23/2025 9:58:44 AM

WORK ORDER: 174667 ASSET NUMBER: 30547

Work Order Status: C - C - Closed Date In: 10/04/2022

Work Order Shop: 1 - TTM-VehicleRepair Date Out: 05/02/2023

ASSET NUMBER INFORMATION

LICENSE: 30-547

YEAR: 2016 ORG: Active Fleet TIRE SIZE: P225/65R17

MAKE: Dodge DEPT: CC10011 - OCIO | Customer Solutions ENGINE SIZE: 3.6L

SITE: Columbus, Ohio

MODEL: Journey BILL CODE: YYYYYYNNNY1NYY TRANS: 6S Auto

OPERATOR: Steven Lichtensteiger.3 SERIAL NUMBER: 3C4PDCBG6GT199681 ASSET AVAIL CODE: 0000 to 2359 On Call

24/5

FUEL TYPE: U, NFT

CLASS: Truck, Sport Utility, ¼ Ton, 4 Door, HILM METERS: Mileage - 150954

TECHNICIAN RE	PAIRS PERFORMED			
TECH	END DATE	REPAIR DESCRIPTION	HOURS	LABOR COST
BOROKHOVICH	04/27/2023	General Repair / Engine / Misc Parts / Diagnosis	1.56	\$132.175
BOROKHOVICH	04/27/2023	General Repair / Tires/Wheels / Tire / Diagnosis	0.63	\$53.267
BOROKHOVICH	04/27/2023	Preventive Maintenance Service / Preventative Maintenance / Safety Inspection / Perform	1.56	\$0.000
BOROKHOVICH	04/27/2023	Repaired From PM Service / Glass Component / Wiper W/S / Replace Front	0.59	\$50.198
BOROKHOVICH	04/27/2023	Repaired From PM Service / Light System / Light Exterior / Replace	0.01	\$1.157
BOROKHOVICH	04/27/2023	Preventive Maintenance Service / Preventative Maintenance / PM A Service / Perform	0.01	\$17.000
BOROKHOVICH	04/28/2023	General Repair / Tires/Wheels / TPMS / Replace	2.04	\$173.731
BOROKHOVICH	04/28/2023	General Repair / Emission System / Misc Parts / Replace	2.14	\$181.498
BOROKHOVICH	05/02/2023	Repaired From PM Service / Brakes / BrakeJob Rear / Replace	3.27	\$277.667

The Ohio State University - Fleet WORK ORDER DETAILS REPORT Management

W300d - WorkOrderDetailsByDate

5/23/2025 9:58:44 AM

PART NUMBER 2023-654 PART NAME:	2	S/NS						
2023-654		3/193	ISS QTY	PA	RT PRICE	ISSUE I	DATE	TOTAL PART COST
PART NAME:		NS	1.000		\$53.391	04/24/2	2023	\$53.391
	Pump, EVAP, Leak Det	tection		REPAIR:	General R	epair / Em	ission System / Misc Par	ts / Replace
2018-9		NS	1.000		\$45.279	04/24/2	2023	\$45.279
PART NAME:	Sensor, TPMS			REPAIR:	General R	epair / Tire	es/Wheels / TPMS / Repla	ace
2018-9		NS	2.000		\$45.279	04/24/2	2023	\$90.558
PART NAME:	Sensor, TPMS			REPAIR:	General R	epair / Tire	es/Wheels / TPMS / Repla	ace
2022-645		S	1.000		\$7.952	04/27/2	2023	\$7.952
PART NAME:	Filter, Oil				Preventivenspection / I		nce Service / Preventativ	/e Maintenance /
007-0100		S	1.000		\$3.016	04/27/2	2023	\$3.016
PART NAME:	Fluid, Washer, Windsh	nield, Bulk; 1	-Gal.		Preventivenspection / I		nce Service / Preventativ	/e Maintenance /
042-0001		S	0.500		\$2.851	04/27/2	2023	\$1.426
PART NAME:	Coolant, Gold, Univers	sal; 50/50; 1	L-Qt.		Preventivenspection / I		nce Service / Preventativ	/e Maintenance /
1617-0224		S	1.000		\$14.571	04/27/2	2023	\$14.571
PART NAME:	Blade, Wiper, 24"			REPAIR: Replace	•	From PM S	ervice / Glass Componer	nt / Wiper W/S /
1617-0119		S	1.000		\$10.912	04/27/2	2023	\$10.912
PART NAME:	Blade, Wiper, 19"			REPAIR: Replace		From PM S	ervice / Glass Componer	nt / Wiper W/S /
045-020		S	6.500		\$5.358	04/27/2	2023	\$34.827
PART NAME:	Oil, 0W20, Synthetic,	Bulk; 1-Qt.			Preventivenspection / I		nce Service / Preventativ	/e Maintenance /
0741-0194		S	1.000		\$4.435	04/27/2	2023	\$4.435
PART NAME:	Bulb,Light			REPAIR: Replace	Repaired	From PM S	ervice / Light System / L	ight Exterior /
2022-789		NS	1.000		\$46.735	05/01/2	2023	\$46.735
PART NAME:	Pads, Brake			REPAIR:	Repaired	From PM S	ervice / Brakes / BrakeJo	ob Rear / Replace
2022-790		NS	2.000		\$76.934	05/01/2	2023	\$153.868
PART NAME:	Rotor, Brake			REPAIR:	Repaired	From PM S	ervice / Brakes / BrakeJo	ob Rear / Replace
WORK ORDE	R TOTALS							
TOTAL PARTS	:	\$466.970	PARTS TAX:			\$0.000	MANUAL ADJUSTMENT	S: \$0.000
TOTAL SUBLE	T:	\$0.000	SUBLET TAX:			\$0.000		
TOTAL LABOR	:	\$886.693	TOTAL MISC:			\$0.000	TOTAL COST:	\$1,353.663
NOTES								

5/23/2025 9:58:44 AM

CEL/OIL LIFE/TPMS - CUSTOMER STATES THAT THE CHECK ENGINE LIGHT IS ON, PLEASE CHECK AND ADVISE. CUSTOMER NEEDS ESTIMATE BEFORE PROCEEDING. ALSO THE OIL LIFE MONITOR NEEDS RESET AND THE TPMS LIGHT IS ON.; Tire Pressure Light - 10/5/2022 All tires around 31psi when vehicle was brought in. Aired up to 36psi per door placard. Right rear tire pressure sensor is not reading, need to replace right rear tire pressure sensor. Codes in TPMS module: c151D00 Active- Tire pressure sensor location undetermined. C158100 Active- Front/rear tire pressure sensor location undetermined. C158000 Active- Left/right side tire pressure sensor location undetermined. C150496 Stored- Tire pressure sensor 4 component internal failure. C150396 Active- Tire pressure sensor 3 component internal failure. One TPMS sensor has already been replaced, since another sensor has gone bad may want to replace remaining 3 TPMS.; Oil Life Reset - 10/5/2022 Reset oil life reminder. Complete; Engine Diagnostic - 10/5/2022 No running issues when driven. Pulled fault codes: P0456 Stored- Evaporative emission control system (EVAP) small leak detected. May want to start with leak detection pump since problem seems to be intermittent.; Washer Fluid Light -10/5/2022 Washer fluid light was also on when vehicle was brought in. Washer fluid was full.: PMA Service/ Safety Inspection - 4/27/2023 Driver side license plate light is out. 36psi front and rear tires. 4/32's remain on right front tire. 5/32's remain on left front tire. 7/32's remain on left rear tire. 6/32's remain on right rear tire. 10mm remain on front brakes. 2mm remain on rear brakes, needs rear brakes. Wiper blades are streaking. Complete; Needs estimate - 4/27/2023 Needs estimate for rear brake pads and brake rotors.; Wiper Blades - 4/27/2023 Replaced front wiper blades due to streaking noticed during PM Service. Complete; Driver Side License Plate Bulb - 4/27/2023 Replaced driver side license plate bulb due to not working. Complete; Leak Detection Pump - 4/28/2023 Replaced leak detection pump due to intermittent EVAP code causing check engine light. No fault codes returned after replacement. Complete; Tire Pressure Monitor Sensors - 4/28/2023 Replaced tire pressure monitor sensors on remaining 3 wheels since one sensor was recently replace. Balanced wheels after demounting tires in order to install sensors. Test drove vehicle in order to reset TPMS light. Light was cleared after driving for a few miles and is now reading correctly. Rotated tires while wheels were off so best tires are on the front. Torques wheels to 100ft/lbs. Complete; Rear Brakes - 5/2/2023 Installed rear brake pads and rotors due to having 2mm remain on brake pads. Initially received pads and rotors for the front of the vehicle. Gave those back to the parts department and had rear pads and rotors sent. Caliper slides and pistons functioning normally at this time. Complete; CONTACTED - Called and emailed Steve L. to inform that repairs to the vehicle were completed and it is ready to be picked up.

5/23/2025 9:58:44 AM

WORK ORDER: 175060
ASSET NUMBER: 30547

Work Order Status: C - C - Closed Date In: 08/31/2022

Work Order Shop: 1 - TTM-VehicleRepair Date Out: 08/31/2022

ASSET NUMBER INFORMATION

YEAR: 2016 ORG: Active Fleet TIRE SIZE: P225/65R17

MAKE: Dodge DEPT: CC10011 - OCIO | Customer Solutions ENGINE SIZE: 3.6L

MODEL: Journey BILL CODE: YYYYYYNNNY1NYY TRANS: 6S Auto

LICENSE: 30-547 SITE: Columbus, Ohio FUEL TYPE: U, NFT

OPERATOR: SERIAL NUMBER: 3C4PDCBG6GT199681 ASSET AVAIL CODE: 0000 to 2359 On Call

24/5

CLASS: Truck, Sport Utility, ¼ Ton, 4 Door, HILM METERS: Mileage - 140191

SUBLET REPAIRS

VENDOR PARTS LABOR OTHER OPID DATE BACK REPAIR DESCRIPTION SUBLET COST NonTTMSvc \$0.00 \$0.00 \$0.00 417 08/31/2022 Preventive Maintenance Service / \$64.940

Preventative Maintenance / PM A

Service / Perform

WORK ORDER TOTALS

TOTAL PARTS: \$0.000 PARTS TAX: \$0.000 MANUAL ADJUSTMENTS: \$0.000

TOTAL SUBLET: \$64.940 SUBLET TAX: \$0.000

TOTAL LABOR: \$0.000 TOTAL MISC: \$0.000 **TOTAL COST:** \$64.940

NOTES

SUBLET REPAIR - CUSTOMER HAD PMA SERVICE PERFORMED AT VALVOLINE ON 8/31/2022

The Ohio State University - Fleet WORK ORDER DETAILS REPORT Management

W300d - WorkOrderDetailsByDate

5/23/2025 9:58:44 AM

			W	ORK O	RDER: 177	675					
			AS	SSET N	UMBER: 30) 547					
Work Order Status	s: C - C - Closed	I						Date In	:	05/08/2023	
Work Order Shop:	1 - TTM-Vehic	cleRepair						Date O	ut:	05/12/2023	
ASSET NUMBER	INFORMATION	1									
YEAR: 2016			ORG: Act	ive Fleet				TIRE SIZE: P225/65R1	7		
MAKE: Dodge			DEPT: CO	210011 - 0	OCIO Customer	Solutions		ENGINE SIZE: 3.6L			
MODEL: Journey			BILL COD	E: YYYYY	YNNNY1NYY			TRANS: 6S Auto			
LICENSE: 30-547			SITE: Col	umbus, C	Ohio			FUEL TYPE: U, NFT			
OPERATOR: Greg McGoon.2			SERIAL N	UMBER: 3	3C4PDCBG6GT19	9681		ASSET AVAIL CODE: 00 24/5	000 to 23	59 On Call	
CLASS: Truck, Spe	ort Utility, ¼ To	n, 4 Door, H	ILM					METERS: Mileage - 143	667		
TECHNICIAN RE	PAIRS PERFOR	RMED									
TECH	END DATE	i	REPAIR DES	CRIPTION				HOURS	L	ABOR COST	
HOEPKER	05/09/2023		General Repa Diagnosis	air / Cran	king System / Ba	ttery /		1.33		\$113.262	
GODDARD	05/09/2023		General Repa Diagnosis	air / Cran	king System / Ba	ttery /		1.22		\$103.558	
KAHANA	05/10/2023		General Repa Replace	air / Cran	king System / Sta	arter /		0.19		\$16.244	
HOEPKER	05/10/2023		General Repa Replace	air / Cran	king System / Sta	arter /		1.41		\$119.968	
HOEPKER	05/11/2023		General Repa Replace	air / Cran	king System / Ba	ttery /		0.41		\$34.661	
SUBLET REPAIR	S										
VENDOR	PARTS	LABOR	OTHER	OPID	DATE BACK	REPAIR	DESC	CRIPTION	SL	JBLET COST	
Capital Towing	\$0.00	\$0.00	\$111.92	417	05/08/2023	Road Ca Towing	all / U	nit Services / Vehicle /		\$128.708	
PARTS ISSUED											
PART NUMBER		S/NS		ISS QTY	PART PRIC	E ISS	SUE D	ATE	TOTAL	PART COST	
2023-777		NS		1.000	\$184.96	3 05/	10/2	023		\$184.963	
PART NAME: Batt	ery				REPAIR: Gener	al Repair /	Crar	nking System / Starter /	Replace		
2023-756		NS		1.000	\$212.61	.3 05/	10/2	023		\$212.613	
PART NAME: Star	ter Assy, New				REPAIR: Gener	al Repair /	Crar	nking System / Starter /	Replace		
MISCELLANEOUS	S COSTS										
CODE	С	DESCRIPTION	N			POSTED	DAT	E		MISC COST	
Supply Fee	S	Supply Fee				05/08/2	.023			\$30.000	
WORK ORDER TO	OTALS										
TOTAL PARTS:		\$397.576	PARTS TA	AX:		\$0.0	00	MANUAL ADJUSTMENTS	6:	\$0.000	
TOTAL SUBLET:		\$128.708	SUBLET 1	AX:		\$0.0	00				
TOTAL LABOR:		\$387.693	TOTAL M	ISC:		\$30.0	00	TOTAL COST:		\$943.977	
NOTES											

The Ohio State University - Fleet Management

WORK ORDER DETAILS REPORT

p.20

W300d - WorkOrderDetailsByDate

5/23/2025 9:58:44 AM

ROAD CALL/DEAD BATTERY - Customer states that the vehicle would not start, have Capital Towing going after it and returning it to 2578 Kenny Rd.; APPROVED - Called Steven L. and spoke with him, told him the vehicle needs a starter, I received verbal approval to replace the starter.; Starter - Starter is and Ready to Install; Battery replacement - 5/11/2023 10:25:33 AM After replacing starter, battery was determined to be faulty. Battery has voltage but no amps. Have previously experienced with chrysler products with push button start, when attempting to start, and starter will not Engauge like current situation, starter stays engaged until key is switch to off. When this is done repeatedly it will cause more problems, i.e. the battery. Replaced battery.; CONTACTED - Called and spoke to Steve L. and informed that repairs to the vehicle have been completed.; Starter replacement - 5/11/2023 10:35:51 AM Starter was replaced, after replacement battery was determined to be faulty as well.

5/23/2025 9:58:44 AM

WORK ORDER: 179552
ASSET NUMBER: 30547

Work Order Status: C - C - Closed Date In: 11/14/2023

Work Order Shop: 1 - TTM-VehicleRepair Date Out: 11/20/2023

ASSET NUMBER INFORMATION

LICENSE: 30-547

YEAR: 2016 ORG: Active Fleet TIRE SIZE: P225/65R17

MAKE: Dodge DEPT: CC10011 - OCIO | Customer Solutions ENGINE SIZE: 3.6L

SITE: Columbus, Ohio

MODEL: Journey BILL CODE: YYYYYYNNNY1NYY TRANS: 6S Auto

OPERATOR: Steven Lichtensteiger.3 SERIAL NUMBER: 3C4PDCBG6GT199681 ASSET AVAIL CODE: 0000 to 2359 On Call

24/5

FUEL TYPE: U, NFT

CLASS: Truck, Sport Utility, ¼ Ton, 4 Door, HILM METERS: Mileage - 164391

TECHNICIAN	REPAIRS PERFORMED			
TECH	END DATE	REPAIR DESCRIPTION	HOURS	LABOR COST
HOEPKER	11/20/2023	Repaired From PM Service / Axle Front / Assembly / Replace	0.99	\$99.139
HOEPKER	11/20/2023	General Repair / Bearing Hub Wheel / Misc Parts / Diagnosis	1.41	\$140.833
HOEPKER	11/20/2023	Repaired From PM Service / Tires/Wheels / Tire / Replace	0.70	\$69.861
HOEPKER	11/20/2023	Preventive Maintenance Service / Preventative Maintenance / PM A Service / Perform	1.11	\$17.000
HOEPKER	11/20/2023	Repaired From PM Service / Bearing Hub Wheel / Hub Wheel Assy / Replace	2.67	\$267.028
HOEPKER	11/20/2023	Repaired From PM Service / Suspension / Ball Joint / Replace	0.58	\$58.028
HOEPKER	11/20/2023	Repaired From PM Service / Emission System / Filter Cabin / Replace	0.25	\$24.750
HOEPKER	11/20/2023	Repaired From PM Service / Glass Component / Wiper W/S / Replace	0.08	\$7.861
HOEPKER	11/20/2023	Repaired From PM Service / Expendable / ExtinguisherFir / Replace	0.04	\$3.944
HOEPKER	11/20/2023	General Repair / Glass Component / Nozzle Washer / Replace	0.57	\$57.194

The Ohio State University - Fleet WORK ORDER DETAILS REPORT Management

W300d - WorkOrderDetailsByDate

5/23/2025 9:58:44 AM

PARTS ISSUE	D					
PART NUMBER	Ç	S/NS	ISS QTY	PART PRICE	ISSUE DATE	TOTAL PART COST
2023-1836	٦	NS	1.000	\$19.487	11/16/2023	\$19.487
PART NAME: Fi	ilter, Cabin			REPAIR: Preventiv A Service / Perform	e Maintenance Service /	Preventative Maintenance / PM
2016-19	1	NS	1.000	\$10.647	11/16/2023	\$10.647
PART NAME: B	lade, Wiper, 12"			REPAIR: Preventiv A Service / Perform	e Maintenance Service /	Preventative Maintenance / PM
0590-0100	Ç	5	1.000	\$64.223	11/20/2023	\$64.223
PART NAME: E	xtinguisher, Fire, ABC, 2.5	5 Lb		REPAIR: Preventiv A Service / Perform	e Maintenance Service /	Preventative Maintenance / PM
2023-1831	1	NS	1.000	\$28.197	11/16/2023	\$28.197
PART NAME: N	ozzle, Washer, 2pk			REPAIR: General R	Repair / Glass Componen	t / Nozzle Washer / Replace
1617-0119	9	5	1.000	\$8.432	11/20/2023	\$8.432
PART NAME: B	lade, Wiper, 19"			REPAIR: General R	tepair / Glass Componen	t / Nozzle Washer / Replace
1617-0224	Ç	5	1.000	\$8.414	11/20/2023	\$8.414
PART NAME: B	lade,Wiper,24"			REPAIR: General R	tepair / Glass Componen	t / Nozzle Washer / Replace
2022-645	Ç	5	1.000	\$5.776	11/20/2023	\$5.776
PART NAME: Fi	ilter, Oil			REPAIR: Preventiv A Service / Perform	e Maintenance Service /	Preventative Maintenance / PM
045-020	S	5	6.000	\$5.599	11/20/2023	\$33.594
PART NAME: O	il, 0W20, Synthetic, Bulk;	; 1-Qt.		REPAIR: Preventiv A Service / Perform	e Maintenance Service /	Preventative Maintenance / PM
007-0100	Ş	5	0.500	\$2.998	11/20/2023	\$1.499
PART NAME: FI	luid, Washer, Windshield,	Bulk; 1-Gal.		REPAIR: Preventiv A Service / Perform	e Maintenance Service /	Preventative Maintenance / PM
2023-1835	1	NS	1.000	\$41.587	11/16/2023	\$41.587
PART NAME: Jo	oint, Ball, Lower			REPAIR: General R	Repair / Bearing Hub Wh	eel / Misc Parts / Diagnosis
2023-1833	٦	NS	1.000	\$102.687	11/16/2023	\$102.687
PART NAME: A	xle, CV, Right			REPAIR: General R	Repair / Bearing Hub Wh	eel / Misc Parts / Diagnosis
2023-1832	٦	NS	1.000	\$164.112	11/16/2023	\$164.112
PART NAME: H	ub, Bearing, Assembly			REPAIR: General R	tepair / Bearing Hub Wh	eel / Misc Parts / Diagnosis
2023-1832	١	NS	1.000	\$164.112	11/16/2023	\$164.112
PART NAME: H	ub, Bearing, Assembly			REPAIR: General R	Repair / Bearing Hub Wh	eel / Misc Parts / Diagnosis
2021-17	ſ	NS	4.000	\$154.726	11/16/2023	\$618.904
PART NAME: Ti	ire, Firestone Destination	LE 2		REPAIR: Repaired	From PM Service / Tires,	/Wheels / Tire / Replace
MISCELLANEC	OUS COSTS					
CODE	DESCRI	PTION		P	OSTED DATE	MISC COST
Supply Fee	Supply I	Fee		1	1/14/2023	\$30.000
WORK ORDER	TOTALS					
TOTAL PARTS:	\$1,271	L.671 PARTS	TAX:		\$0.000 MANUAL AD	DJUSTMENTS: \$0.000
TOTAL SUBLET:		0.000 SUBLE	T TAX:		\$0.000	
	40	3022				

The Ohio State University - Fleet Management

W300d - WorkOrderDetailsByDate

WORK ORDER DETAILS REPORT

p.23

5/23/2025 9:58:44 AM

TOTAL LABOR: TOTAL MISC: **TOTAL COST:** \$2,047.309 \$745.638 \$30.000

NOTES

Pma/washer nozzles inop/rubbing/grinding noise from right fr - Customer requests to have a Pma service performed. Customer also states that the washer nozzles are broken and there is a noise coming from the right front wheel, it gets louder when speeding up, please check and advise.; Contact - Greg McGoon 614-965-0705; PMA Service - 11/15/2023 8:50:41 AM Performed PMA service: Both washer nozzles found broken. Both front wheel bearings found faulty and noisy. While inspecting front wheel bearings, found right front axle shaft to have a substantial wobble in the joint. Left front lower ball joint found faulty. Tires measure F-3/32 R-4/32 (225/65R17) Brakes measure F-8mm R-10mm Fire extinguisher not found. Wipers (all) suggested to be replaced.; Front bearing noise - 11/15/2023 8:53:34 AM Test drove and confirmed front bearing noise. Found no change in noise when steering left to right. Raised vehicle on lift and placed vehicle in gear. Listened to both front bearings and confirmed both bearings to have humming and clicking noises suggesting bearings to be faulty. Recommend to replace both front bearings. Note: While inspecting bearings, noticed right front axle shaft to have substantial wobble at joint. Recommend to replace.; Preparing estimate -Getting the estimate repairs and prices together for review and approval.; Estimate sent for approval - Emailed a copy of the estimate over to Steve L. for review and approval.; Estimate approved - Received a response from Steve L. approving all work on the estimate, please proceed when parts arrive.; Parts ordered - Parts ordered. ETA 11/16/2023; Parts ~ 4-Each 225/65R17 Tires Delivered -; Front hub bearings -11/20/2023 10:05:29 AM Removed hub bearings, cleaned mating surface. Installed new front bearings and torqued hub nut to spec.; Axle assy - 11/20/2023 10:06:26 AM Removed right front axle assembly, inspected intermediate shaft. Shaft is good and does not need replaced. Installed new axle shaft, torqued axle nut to spec.; Tires - 11/20/2023 11:17:52 AM Removed, mounted and balanced 4 tires. Set tire psi to 36psi: Left front ball joint - 11/20/2023 1:02:52 PM Replaced left front ball joint.; Cabin filter - 11/20/2023 3:50:50 PM Removed glove box assembly and replaced cabin filter.; Wiper blades - 3:55:48 PM 11/20/2023 Removed and replaced all wiper blades.; Fire extinguisher -11/20/2023 3:56:22 PM Installed fire extinguisher in rear of vehicle.; Sprayer nozzles - 11/20/2023 4:32:38 PM Replaced front washer spray nozzles.; Contacted - Contacted Greg McGoon to inform that repairs have been completed.

5/23/2025 9:58:44 AM

WORK ORDER: 179989
ASSET NUMBER: 30547

Work Order Status: C - C - Closed Date In: 01/02/2024

Work Order Shop: 1 - TTM-VehicleRepair Date Out: 01/05/2024

ASSET NUMBER INFORMATION

YEAR: 2016 ORG: Active Fleet TIRE SIZE: P225/65R17

MAKE: Dodge DEPT: CC10011 - OCIO | Customer Solutions ENGINE SIZE: 3.6L

MODEL: Journey BILL CODE: YYYYYNNNY1NYY TRANS: 6S Auto

LICENSE: 30-547 SITE: Columbus, Ohio FUEL TYPE: U, NFT

OPERATOR: Greg McGoon.2 SERIAL NUMBER: 3C4PDCBG6GT199681 ASSET AVAIL CODE: 0000 to 2359 On Call

24/5

CLASS: Truck, Sport Utility, ¼ Ton, 4 Door, HILM METERS: Mileage - 166223

TECHNICIAN REPAIRS PERFORMED

TECH END DATE REPAIR DESCRIPTION **HOURS** LABOR COST **HOEPKER** Repaired From PM Service / Bearing Hub Wheel / 01/05/2024 1.12 \$112.223 Hub Wheel Assy / Replace **HOEPKER** 01/05/2024 General Repair / Tires/Wheels / Misc Parts / 0.72 \$72,389 Inspect

PARTS ISSUED

 PART NUMBER
 S/NS
 ISS QTY
 PART PRICE
 ISSUE DATE
 TOTAL PART COST

 2024-8
 NS
 1.000
 \$321.958
 01/04/2024
 \$321.958

PART NAME: Hub/Bearing Assy, Front, RH REPAIR: Repaired From PM Service / Bearing Hub Wheel / Hub Wheel

Assy / Replace

MISCELLANEOUS COSTS

CODE DESCRIPTION POSTED DATE MISC COST
Supply Fee 01/02/2024 \$18.461

WORK ORDER TOTALS

TOTAL PARTS: \$321.958 PARTS TAX: \$0.000 MANUAL ADJUSTMENTS: \$0.000

TOTAL SUBLET: \$0.000 SUBLET TAX: \$0.000

TOTAL LABOR: \$184.612 TOTAL MISC: \$18.461 **TOTAL COST:** \$525.031

NOTES

Roaring noise - Customer states that there is a roaring noise when driving, possibly in the front, please check and advise.; Front bearing noise - 1/2/2024 11:48:14 AM Test drove vehicle and confirmed noise. Isolated and confirmed noise to be coming from left front hub/wheel bearing. Part replaced 11/2023. Will submit for part warranty/replacement.; HUB BEARING ORDERED - 1/2/2024 11:49:41 AM Request sent for hub bearing; Parts ~ LH Front Hub Assy Delivered -; Contact - Greg McGoon 614-965-0705; Contacted - Contacted Greg McGoon to inform that repairs have been completed.; Wheel bearing replacement - 1/5/2024 1:45:34 PM Removed and replaced left front wheel bearing with dealer part. Torqued to spec @118ft lbs. Note: Right front wheel bearing is still aftermarket bearing.; Washer fluid level light on - 1/5/2024 1:46:54 PM Wash fluid level light noted to be on. Checked fluid level and found full. Sensor will need to be replaced to turn light off.

The Ohio State University - Fleet Management

W300d - WorkOrderDetailsByDate

5/23/2025 9:58:44 AM

WORK ORDER: 180690 ASSET NUMBER: 30547

WORK ORDER DETAILS REPORT

Work Order Status: C - C - Closed Date In: 03/01/2024

Work Order Shop: 1 - TTM-VehicleRepair Date Out: 03/08/2024

ASSET NUMBER INFORMATION

YEAR: 2016 ORG: Active Fleet TIRE SIZE: P225/65R17

MAKE: Dodge DEPT: CC10011 - OCIO | Customer Solutions ENGINE SIZE: 3.6L

MODEL: Journey BILL CODE: YYYYYYNNNY1NYY TRANS: 6S Auto

LICENSE: 30-547 SITE: Columbus, Ohio FUEL TYPE: U, NFT

OPERATOR: Steven Lichtensteiger.3 SERIAL NUMBER: 3C4PDCBG6GT199681 ASSET AVAIL CODE: 0000 to 2359 On Call

24/5

CLASS: Truck, Sport Utility, ¼ Ton, 4 Door, HILM

METERS: Mileage - 171423

							_	
TECHNICIAN RE	PAIRS PERFOR	MED						
TECH	END DATE		REPAIR DESC	CRIPTION	N		HOURS	LABOR COST
HOEPKER	03/01/2024		General Repa	air / Tires	s/Wheels / Tire /	Inspect	0.54	\$54.056
HOEPKER	03/01/2024		General Repa	air / Exte	erior / Misc Parts	/ Inspect	0.45	\$45.167
HOEPKER	03/06/2024				nce Service / Pre Inspection / Per		0.15	\$0.000
HOEPKER	03/06/2024		Repaired Fro Replace	m PM Se	ervice / Tires/Wh	eels / Tire /	0.89	\$88.917
HOEPKER	03/06/2024		Repaired From PM Service / Engine Exhaust / Misc Parts / Repair				0.72	\$72.223
HOEPKER	03/06/2024		General Repa	air / Stee	ering / Tie Rod E	nd / Replace	1.63	\$162.972
HOEPKER	03/06/2024				nce Service / Pre Service / Perform		1.10	\$20.000
HOEPKER	03/06/2024		Repaired Fro Blade Wiper	\$10.667				
SUBLET REPAIR	S							
VENDOR	PARTS	LABOR	OTHER	OPID	DATE BACK	REPAIR DESCRI	PTION	SUBLET COST
Firestone Complete Auto Care	\$0.00	\$0.00	\$109.99	417	03/08/2024	Repaired From I Tires/Wheels / \ Front	PM Service / Wheel / Alignment	\$131.988

\$0.000

\$1,022.069

The Ohio State University - Fleet WORK ORDER DETAILS REPORT Management

\$406.079

\$131.988

\$454.002

PARTS TAX:

SUBLET TAX:

TOTAL MISC:

W300d - WorkOrderDetailsByDate

5/23/2025 9:58:44 AM

PARTS ISSUED					
PART NUMBER	S/NS	ISS QTY	PART PRICE	ISSUE DATE	TOTAL PART COST
2022-645	S	1.000	\$6.461	03/01/2024	\$6.461
PART NAME: Filter, Oil			EPAIR: Preventive Service / Perform	e Maintenance Service / F	Preventative Maintenance / PM
2021-15	NS	2.000	\$135.486	03/05/2024	\$270.972
PART NAME: Tire, Firestone De	estination LE 3	R	EPAIR: Repaired F	From PM Service / Tires/\	Wheels / Tire / Replace
1617-0119	S	1.000	\$8.358	03/04/2024	\$8.358
PART NAME: Blade, Wiper, 19'	1		EPAIR: Repaired Feplace	From PM Service / Glass	Component / Blade Wiper /
1617-0024	S	1.000	\$16.938	03/04/2024	\$16.938
PART NAME: Blade,Wiper,Univ	ersal,24"		EPAIR: Repaired Feplace	From PM Service / Glass	Component / Blade Wiper /
2024-358	NS	1.000	\$93.262	03/05/2024	\$93.262
PART NAME: End, Rod, Tie		R	EPAIR: General Re	epair / Steering / Tie Roo	d End / Replace
2016-19	NS	1.000	\$10.088	03/06/2024	\$10.088
PART NAME: Blade, Wiper, 12'	1		EPAIR: Repaired Feplace	From PM Service / Glass	Component / Blade Wiper /
MISCELLANEOUS COSTS					
CODE	DESCRIPTION		PC	OSTED DATE	MISC COST
Supply Fee	Supply Fee		03	3/01/2024	\$30.000
WORK ORDER TOTALS					

NOTES

TOTAL PARTS:

TOTAL SUBLET:

TOTAL LABOR:

Contact - Greg McGoon 614-965-0705; Pma/Safety/possible shield dragging/RR tire possible leak - Customer requests to have a Pma service and a safety inspection performed, the customer states that there is a noise when backing up, sounds like a shield dragging and the right rear tire is losing air, please see if it has any debris in the tire.; Tire diagnosis - 3/1/2024 11:11:33 AM Performed tire inspection on right rear tire. Foreign object found in outer tread. Replace tire 255/65R17; Noise diagnosis - 3/1/2024 11:12:33 AM No noises heard on initial back-up or during test drive. Raised vehicle and inspected. No visual problems found and no audible noises heard while rotating tires by hand. Possible surface rust/cold material creating concern.; Estimate needed - Estimate is needed for asset, will get the estimate prepared.; Estimate prepared and sent - Prepared estimate for the asset, sent to Steve L. for review and approval.; Estimate approved - Customer reviewed the estimate and approved repairs, sending to tech so he may order the parts and make repairs, the asset has been placed in "H" status.; Customer update -Contacted Greg McGoon to inform that repairs were approved by Steve L. and parts have been ordered, the vehicle will also need to go to the alignment shop after part installation.; Parts ~ 2-Each 225/65R17 Tires Delivered -; Parts ~ Inner Tie Rod Ends Delivered -; Rear tires -3/6/2024 10:56:15 AM Removed, mounted and balanced 2 new rear tires. ; Exhaust repair - 3/6/2024 11:35:57 AM Removed rusted bolts with torch, to badly rusted away to use sockets. Installed grade 8 bolts, confirmed no leaks present.; Parts ~ Rear Wiper Blade Delivered -; Right front inner tie rod - 3/6/2024 2:09:16 PM Removed and replaced right front inner tie rod end. Needs alignment performed.; PMA Service -3/6/2024 2:38:23 PM Performed PMA service: Wipers streaking Right front inner tie rod faulty Exhaust pipe flange bolts rusted and about to break. Tires measure F-6-7/32 R-8/32 Brakes measure 10mm; Wipers - 3/6/2024 2:40:32 PM Replaced all wipers; Vendor Deliver - Vehicle repairs completed, needs to go to Firestone for an alignment, will have that ran over tomorrow to have completed.; Vendor deliver - Vehicle was taken to Firestone CAC for a front-end alignment.; Firestone - 614-441-8440; Vendor complete - Firestone has completed repairs and the vehicle is ready to be picked up.; Vehicle Returned/contacted - Vehicle was returned from Firestone, contacted Greg McGoon to inform that repairs have been completed.

\$0.000

\$0.000

\$30.000

MANUAL ADJUSTMENTS:

TOTAL COST:

5/23/2025 9:58:44 AM

WORK ORDER: 182809
ASSET NUMBER: 30547

Work Order Status: C - C - Closed Date In: 06/07/2024

Work Order Shop: 1 - TTM-VehicleRepair Date Out: 06/17/2024

ASSET NUMBER INFORMATION

YEAR: 2016 ORG: Active Fleet TIRE SIZE: P225/65R17

MAKE: Dodge DEPT: CC10011 - OCIO | Customer Solutions ENGINE SIZE: 3.6L

MODEL: Journey BILL CODE: YYYYYYNNNY1NYY TRANS: 6S Auto

LICENSE: 30-547 SITE: Columbus, Ohio FUEL TYPE: U, NFT

OPERATOR: SERIAL NUMBER: 3C4PDCBG6GT199681 ASSET AVAIL CODE: 0000 to 2359 On Call

24/5

CLASS: Truck, Sport Utility, ¼ Ton, 4 Door, HILM METERS: Mileage - 180282

TECHNICIAN REPAIRS PERFORMED								
TECH	END DATE	REPAIR DESCRIPTION	HOURS	LABOR COST				
BOROKHOVICH	06/10/2024	Preventive Maintenance Service / Preventative Maintenance / PM A Service / Perform	0.87	\$20.000				
BOROKHOVICH	06/10/2024	Preventive Maintenance Service / Preventative Maintenance / Safety Inspection / Perform	0.00	\$0.000				
BOROKHOVICH	06/11/2024	General Repair / Suspension / System / Diagnosis	1.01	\$101.055				
BOROKHOVICH	06/13/2024	Repaired From PM Service / Glass Component / Blade Wiper / Replace	0.12	\$12.111				
BOROKHOVICH	06/14/2024	Repaired From PM Service / Glass Component / Washer W/S / Diagnosis	0.94	\$94.000				
BOROKHOVICH	06/14/2024	Repaired From PM Service / Suspension / Strut / Replace	9.13	\$913.167				
BOROKHOVICH	06/14/2024	General Repair / Engine / System / Diagnosis	0.49	\$49.417				
BOROKHOVICH	06/14/2024	Repaired From PM Service / Glass Component / Washer W/S / Replace	0.37	\$36.805				
BOROKHOVICH	06/17/2024	Repaired From PM Service / Steering / Link Sway Bar / Replace	0.00	\$0.139				

The Ohio State University - Fleet Management

WORK ORDER DETAILS REPORT

${\bf W300d - WorkOrder Details By Date}$

5/23/2025 9:58:44 AM

PARTS ISSU	ED								
PART NUMBER	۲	S/NS	ISS (QTY	PAF	RT PRICE	ISSUE I	DATE	TOTAL PART COST
2022-645		S	1.0	000		\$6.209	06/10/2	2024	\$6.209
PART NAME:	Filter, Oil					Preventive 2 / Perform	e Maintena	nce Service / Preventative	Maintenance / PM
045-020		S	6.	500		\$5.603	06/10/2	2024	\$36.420
PART NAME:	Oil, 0W20, Synthe	tic, Bulk; 1-Qt.				Preventive e / Perform	e Maintena	nce Service / Preventative	Maintenance / PM
007-0100		S	1.0	000		\$2.965	06/10/2	2024	\$2.965
PART NAME:	Fluid, Washer, Wir	ndshield, Bulk; 1	L-Gal.			Preventive / Perform	Maintena	nce Service / Preventative	Maintenance / PM
042-0001		S	1.0	000		\$2.965	06/10/2	2024	\$2.965
PART NAME:	Coolant, Gold, Uni	versal; 50/50; :	1-Qt.			Preventive / Perform	e Maintena	nce Service / Preventative	Maintenance / PM
1617-0119		S	1.0	000		\$8.339	06/11/2	2024	\$8.339
PART NAME:	Blade, Wiper, 19"				REPAIR: Replace	Repaired F	From PM S	ervice / Glass Component	/ Blade Wiper /
1617-0224		S	1.0	000		\$9.090	06/11/2	2024	\$9.090
PART NAME:	Blade,Wiper,24"				REPAIR: Replace	Repaired F	rom PM S	ervice / Glass Component	/ Blade Wiper /
2024-878		NS	2.0	000	\$	173.888	06/12/2	2024	\$347.776
PART NAME:	Strut Assy, Quick,	Rear		R	REPAIR:	Repaired F	From PM S	ervice / Suspension / Stru	t / Replace
2024-879		NS	1.0	000	\$	216.125	06/12/2	2024	\$216.125
PART NAME:	Strut Assy, Quick,	Front, LH		R	REPAIR:	Repaired F	rom PM S	ervice / Suspension / Stru	t / Replace
2024-880		NS	1.0	000	\$	216.125	06/12/2	2024	\$216.125
PART NAME:	Strut Assy, Quick,	Front, RH		R	REPAIR:	Repaired F	From PM S	ervice / Suspension / Stru	t / Replace
2018-15		NS	1.0	000		\$8.736	06/13/2	2024	\$8.736
PART NAME:	Grommet, Sensor,	Level, Fluid, W	asher		REPAIR: Replace	Repaired F	From PM S	ervice / Glass Component	/ Washer W/S /
2024-894		NS	2.0	000		\$74.776	06/14/2	2024	\$149.552
PART NAME:	Link, Bar, Sway, F	ront		R	REPAIR:	Repaired F	rom PM S	ervice / Steering / Link Sw	ay Bar / Replace
MISCELLANE	OUS COSTS								
CODE		DESCRIPTION				PC	STED DAT	TE .	MISC COST
Supply Fee		Supply Fee				06	5/07/2024		\$30.000
WORK ORDE	R TOTALS								
TOTAL PARTS	:	\$1,004.302	PARTS TAX:				\$0.000	MANUAL ADJUSTMENTS:	\$0.000
TOTAL SUBLE	T:	\$0.000	SUBLET TAX:				\$0.000		
TOTAL LABOR	t:	\$1,226.694	TOTAL MISC:				\$30.000	TOTAL COST:	\$2,260.996
NOTES									

The Ohio State University - Fleet WORK ORDER DETAILS REPORT Management

W300d - WorkOrderDetailsBvDate

5/23/2025 9:58:44 AM

PM/Safety - 6/7/2024 11:16:01 AM Customer requests PM/safety; Suspension Noise - 6/7/2024 11:16:23 AM Customer states that when driving on the highway over 55MPH sometimes the vehicle will make a clunking noise. It is random and does not happen all the time. Also no specific things will cause this to happen like bumps or potholes. Please check and advise. ; Engine Noise - 6/7/2024 11:17:31 AM Customer states when accelerating and decelerating a noise can be heard. Please check and advise.; PMA Service/ Safety Inspection - 6/10/2024 Washer fluid level light is on, stayed on after filling. Wiper blades are streaking. 36psi front and rear tires. 6/32's remain on front tires. 9/32's remain on rear tires. Right front strut is leaking, suggest both front quick struts. 8mm remain on front brakes. 6mm remain on rear brakes. Slight vibration from tires, may want to balance front and rear tires. Rear struts also original and seem to be weak. May want to replace at same time as front struts. Complete; Estimate Needed - 6/10/2024 Estimate needed for front quick strut assemblies. Front wiper blades. May want to also replace rear struts or quick struts also. Balance and rotate tires. Diagnose washer fluid level.; Suspension noise - 6/10/2024 Right front strut is leaking causing a knocking sound from front end. Need to start with replacing struts then can recheck for other noises/problems.; Engine Noise Diagnosis - 6/10/2024 Unable to duplicate engine noise during test drives before and after oil change. There is a slight vibration in the dash at idle but no other noises noticed. Vehicle will need a couple more test drives if work is completed and can try to verify concern then. Service writer may want to try to get more information on noise to help further diagnose. Update: 6/14/2024 Finished suspension work and took vehicle for test drive. Still was unable to duplicate engine noise. Complete; Estimate awaiting parts pricing - 6/10/2024 12:48:37 PM Completed estimate and awaiting pricing for parts to be added.; Estimate Sent To Customer - 6/11/2024 10:49:34 AM Estimate was completed and sent to customer for approval. ; Customer Approved Repairs. - 6/11/2024 2:26:04 PM Customer approved all repairs on estimate. ; Parts ~ Quick Struts Delivered -: Front Wiper Blades - 6/13/2024 Replaced front wiper blades due to streaking. Complete : Parts~ Sensor Grommet Delivered - : Washer Fluid Level Light - 6/14/2024 Found that the washer fluid level light was staying on after filling due to faulty level sensor. Was able to jump the the connector and get the light to turn off. Will start with replacing the level sensor and grommet. Light is now out. Complete; Parts ~ Front Sway bar Links Delivered - ; Front and Rear Struts - 6/14/2024 Replaced rear strut assemblies with springs. Had to remove entire back section, including seats and plastic coverings on the sides to gain access to top strut bolts. Installed the new strut assemblies. Torqued wheels down to 100ft/lbs. Replaced front strut assemblies with springs. Had to replace the front sway bar end links while in there due to not being able to come off without damage. Replaced sway bar end links and the strut assemblies. Torqued wheels to 100ft/lbs. Complete; Customer Contact -6/14/2024 3:54:16 PM Contacted Greg McGoon to advise that repairs are complete and vehicle is ready for pick up. ; Customer Pick Up -6/17/2024 11:32:10 AM Greg McGoon came and picked up vehicle. ; DPO - PO-1234567

5/23/2025 9:58:44 AM

WORK ORDER: 183261
ASSET NUMBER: 30547

Work Order Status: C - C - Closed Date In: 07/25/2024

Work Order Shop: 1 - TTM-VehicleRepair Date Out: 07/25/2024

ASSET NUMBER INFORMATION

YEAR: 2016 ORG: Active Fleet TIRE SIZE: P225/65R17

MAKE: Dodge DEPT: CC10011 - OCIO | Customer Solutions ENGINE SIZE: 3.6L

MODEL: Journey BILL CODE: YYYYYYNNNY1NYY TRANS: 6S Auto

LICENSE: 30-547 SITE: Columbus, Ohio FUEL TYPE: U, NFT

OPERATOR: SERIAL NUMBER: 3C4PDCBG6GT199681 ASSET AVAIL CODE: 0000 to 2359 On Call

24/5

CLASS: Truck, Sport Utility, ¼ Ton, 4 Door, HILM METERS: Mileage - 181818

TECHNICIAN REPAIRS PERFORMED

TECH END DATE REPAIR DESCRIPTION HOURS LABOR COST

GODDARD 07/25/2024 General Repair / Electrical Accessory / FOB Battery 0.06 \$6.359

/ Replace

PARTS ISSUED

PART NUMBER S/NS ISS QTY PART PRICE ISSUE DATE TOTAL PART COST

053-0012 S 1.000 \$3.995 07/25/2024 \$3.995

PART NAME: Battery, CR2032, Button, Lithium, 3-VDC REPAIR: General Repair / Electrical Accessory / FOB Battery / Replace

MISCELLANEOUS COSTS

CODE DESCRIPTION POSTED DATE MISC COST

Supply For 17/25/2024 \$0.636

 Supply Fee
 Supply Fee
 07/25/2024
 \$0.636

WORK ORDER TOTALS

TOTAL PARTS: \$3.995 PARTS TAX: \$0.000 MANUAL ADJUSTMENTS: \$0.000

TOTAL SUBLET: \$0.000 SUBLET TAX: \$0.000

TOTAL LABOR: \$6.359 TOTAL MISC: \$0.636 **TOTAL COST:** \$10.990

NOTES

Key Fob Battery - 7/25/2024 1:23:32 PM Customer requests to have the key fob battery replaced.; Fob Battery - 7/25/2024 1:27:27 PM Removed and replaced Key Fob Battery for customer.; Customer Pick Up - 7/25/2024 1:27:54 PM Customer waited while fob battery was replaced.

5/23/2025 9:58:44 AM

WORK ORDER: 183767
ASSET NUMBER: 30547

Work Order Status: C - C - Closed Date In: 09/12/2024

Work Order Shop: 1 - TTM-VehicleRepair Date Out: 09/25/2024

ASSET NUMBER INFORMATION

YEAR: 2016 ORG: Active Fleet TIRE SIZE: P225/65R17

MAKE: Dodge DEPT: CC10011 - OCIO | Customer Solutions ENGINE SIZE: 3.6L

MODEL: Journey BILL CODE: YYYYYYNNNY1NYY TRANS: 6S Auto

LICENSE: 30-547 SITE: Columbus, Ohio FUEL TYPE: U, NFT

OPERATOR: SERIAL NUMBER: 3C4PDCBG6GT199681 ASSET AVAIL CODE: 0000 to 2359 On Call

24/5

CLASS: Truck, Sport Utility, ¼ Ton, 4 Door, HILM METERS: Mileage - 184329

TECHNICIAN REPAIRS PERFORMED								
TECH	END DATE	REPAIR DESCRIPTION	HOURS	LABOR COST				
BOROKHOVICH	09/12/2024	Preventive Maintenance Service / Preventative Maintenance / PM A Service / Perform	1.07	\$21.000				
BOROKHOVICH	09/13/2024	Repaired From PM Service / Glass Component / Blade Wiper / Replace	0.18	\$19.162				
BOROKHOVICH	09/13/2024	Repaired From PM Service / Expendable / Kit First Aid / Replace	0.01	\$1.371				
BOROKHOVICH	09/24/2024	General Repair / Trans Automatic / System / Diagnosis	1.14	\$119.963				
BOROKHOVICH	09/25/2024	General Repair / Trans Automatic / Misc Parts / Replace	5.70	\$598.149				
BOROKHOVICH	09/25/2024	General Repair / Tires/Wheels / Nut Wheel / Install	0.00	\$0.087				

The Ohio State University - Fleet WORK ORDER DETAILS REPORT Management

W300d - WorkOrderDetailsByDate

5/23/2025 9:58:44 AM

3/23/2023 9:30:4	,					
PARTS ISSUED						
PART NUMBER	S/NS	ISS QTY	PART PRICE	ISSUE D	ATE	TOTAL PART COST
2022-645	S	1.000	\$15.270	09/12/20)24	\$15.270
PART NAME: Filter, Oil			REPAIR: Preventiv A Service / Perform	e Maintenan	ce Service / Preventative	Maintenance / PM
045-020	S	6.500	\$5.345	09/12/20)24	\$34.743
PART NAME: Oil, 0W20,	Synthetic, Bulk; 1-Qt.		REPAIR: Preventiv A Service / Perform	e Maintenan	ce Service / Preventative	Maintenance / PM
007-0100	S	1.000	\$2.964	09/12/20)24	\$2.964
PART NAME: Fluid, Wash	ner, Windshield, Bulk; 1-0	Gal.	REPAIR: Preventiv A Service / Perform	e Maintenan	ce Service / Preventative	Maintenance / PM
1617-0119	S	1.000	\$8.339	09/12/20)24	\$8.339
PART NAME: Blade, Wipe	er, 19"		REPAIR: Repaired Replace	From PM Se	rvice / Glass Component ,	/ Blade Wiper /
1617-0224	S	1.000	\$8.333	09/12/20)24	\$8.333
PART NAME: Blade,Wipe	r,24"		REPAIR: Repaired Replace	From PM Se	rvice / Glass Component ,	/ Blade Wiper /
2023-2031	S	1.000	\$38.759	09/12/20)24	\$38.759
PART NAME: First Aid Kit	t; 25 Person		REPAIR: Repaired	From PM Se	rvice / Expendable / Kit F	irst Aid / Replace
2024-1255	NS	1.000	\$111.124	09/16/20)24	\$111.124
PART NAME: Driveshaft,	CV, Front, RH		REPAIR: General R	Repair / Tran	s Automatic / Misc Parts /	Replace
2024-8	NS	1.000	\$327.080	09/17/20)24	\$327.080
PART NAME: Hub/Bearin	g Assy, Front, RH		REPAIR: General R	lepair / Tran	s Automatic / Misc Parts /	Replace
2024-1284	NS	1.000	\$548.080	09/17/20)24	\$548.080
PART NAME: Bearing, Sh	naft, Intermediate		REPAIR: General R	tepair / Tran	s Automatic / Misc Parts /	Replace
0880-6412049	NS	1.000	\$3.263	09/25/20)24	\$3.263
PART NAME: Nut, Wheel	, Cap, Chrome		REPAIR: General R	Repair / Tires	/Wheels / Nut Wheel / In	stall
1177-15750	NS	1.000	\$9.191	09/25/20)24	\$9.191
PART NAME: Seal, Oil			REPAIR: General R	lepair / Tran	s Automatic / Misc Parts /	Replace
027-0010	S	1.500	\$4.915	09/25/20)24	\$7.373
PART NAME: ATF, Global	I, Full Synthetic, DuraMax	×	REPAIR: General R	Repair / Tran	s Automatic / Misc Parts /	' Replace
MISCELLANEOUS COST	rs					
CODE	DESCRIPTION		P	OSTED DATE		MISC COST
Supply Fee	Supply Fee			9/12/2024		\$30.000
WORK ORDER TOTALS						
TOTAL PARTS:	\$1,114.518 F	PARTS TAX:		\$0.000	MANUAL ADJUSTMENTS:	\$0.00
TOTAL SUBLET:		SUBLET TAX:		\$0.000		·
TOTAL LABOR:	\$759.732	TOTAL MISC:			TOTAL COST:	\$1,904.25
NOTES	,					. , = = ===

5/23/2025 9:58:44 AM

PM Service - 9/12/2024 11:37:24 AM Vehicle is due for PM A Service.; Transmission Diag - 9/12/2024 11:37:37 AM Customer states there is a noise coming from the transmission on acceleration and deceleration. Please check and advise. Also see Troy for further explanation. Was with customer and hear noise.; Noise on Acceleration Diagnosis - 9/12/2024 Took vehicle for test drive and heard noise coming from front of vehicle. With assistance was able to get vehicle up to speed in the shop and was able to find the right front hub bearing and the bearing on the intermediate shaft for the right axle were making noise. Need to start with new passenger side hub bearing, right side axle with bearing for intermediate shaft.; PMA Service - 9/12/2024 Reset oil service reminder. Needs front wiper blades, streaking. 8/32's remain on front tires. 6/32's remain on rear tires. 36psi front and rear tires. 8mm remain on front brakes. 6mm remain on rear brakes. Complete; Wiper Blades -9/13/2024 Replaced front wiper blades. Complete; First Aid Kit - 9/13/2024 Could not find first aid kit, replaced and placed in trunk. Complete; Estimate - 9/13/2024 10:12:52 AM Estimate has been sent to customer 9/13/2024 10:54:21 AM Customer approved estimate; Parts ~ Intermediate Shaft Bearing Ordered - I. ETA: 09/27/2024.; Parts~ CV Driveshaft Delivered - ; Customer pickup - 9/16/2024 10:53:31 AM Customer picked up vehicle, will bring back once parts arrive; Parts ~ RH front Hub Bearing Delivered -; Parts ~ Intermediate Shaft Bearing Delivered - ; Customer Update - 9/24/2024 11:22:01 AM Customer has dropped off vehicle for SOP installation ; Passenger Side Axle, Intermediate Shaft, and Hub Bearing - 9/25/2024 Replaced passenger side axle, intermediate shaft, and hub bearing due to making noise. Noise is now gone. Torqued wheels to 100ft/lbs and axle nuts to 120ft/lbs. Complete; Driver Side Axle Seal - 9/25/2024 While performing repair on passenger side, noticed that the driver side axle seal had started leaking. While performing other repairs, replaced axle seal. Topped of transmission fluid. No other leaks found at this time. Also had a bad lug nut on driver front wheel. Replaced lug nut torqued wheels to 100ft/lbs and torqued axle to 120ft/lbs. Complete: Customer Contact - 9/25/2024 10:42:50 AM Customer has been advised vehicle is ready for pickup; Customer pickup - 9/26/2024 11:31:59 AM Customer picked up vehicle

5/23/2025 9:58:44 AM

WORK ORDER: 184647
ASSET NUMBER: 30547

Work Order Status: C - C - Closed Date In: 12/03/2024

Work Order Shop: 1 - TTM-VehicleRepair Date Out: 12/03/2024

ASSET NUMBER INFORMATION

YEAR: 2016 ORG: Active Fleet TIRE SIZE: P225/65R17

MAKE: Dodge DEPT: CC10011 - OCIO | Customer Solutions ENGINE SIZE: 3.6L

MODEL: Journey BILL CODE: YYYYYYNNNY1NYY TRANS: 6S Auto

LICENSE: 30-547 SITE: Columbus, Ohio FUEL TYPE: U, NFT

OPERATOR: SERIAL NUMBER: 3C4PDCBG6GT199681 ASSET AVAIL CODE: 0000 to 2359 On Call

24/5

CLASS: Truck, Sport Utility, ¼ Ton, 4 Door, HILM METERS: Mileage - 190524

SUBLET REPAIRS

VENDOR PARTS LABOR OTHER **OPID** DATE BACK REPAIR DESCRIPTION SUBLET COST NonTTMSvc \$106.52 \$0.00 \$0.00 426 12/03/2024 Preventive Maintenance Service / \$106.520 Preventative Maintenance / PM A

Service / Perform

WORK ORDER TOTALS

TOTAL PARTS: \$0.000 PARTS TAX: \$0.000 MANUAL ADJUSTMENTS: \$0.000

TOTAL SUBLET: \$106.520 SUBLET TAX: \$0.000

TOTAL LABOR: \$0.000 TOTAL MISC: \$0.000 **TOTAL COST:** \$106.520

NOTES

PM Service - 12/3/2024 11:30:07 AM Customer took vehicle to Jiffy Lube for PM Service. Service center changed oil and filter. Also replaced both front wiper blades. No other repairs were noted or needed at this time.

p.35

W300d - WorkOrderDetailsByDate

5/23/2025 9:58:44 AM

REPORT PARAMETERS:

Time Zone: Eastern Standard Time

Start Date: 06/17/2016 End Date: 05/23/2025 Organization: All Values Department: All Values Asset Number: 30547

Maint Shop: All Values Labor Hours: Actual Hours

Page Breaks: Yes

or True Cost or Issue Price:

REPORT VERSIONS:

Report Version: 20200729.1200 Script Version: 20210804.1400