

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------------|-----------------|--------------------|--|
| ST39: 2005 STERLING TANDEM | 38839 | 164,954.0 Miles | 03/05/2025 | 012: Hydraulic system Labor: 63 - MYERS, BRIAN <u>63 - MYERS, BRIAN (03/04/2025: 8:46 AM)</u> topped off hydraulic oil |
| ST39: 2005 STERLING TANDEM | 38472 | 164,753.0 Miles | 01/08/2025 | 008: Frame&Chassis Labor: 80 - HERTZIG, RICHARD Labor: 81 - ALBACK, CHARLES |
| ST39: 2005 STERLING TANDEM | 38306 | 164,246.0 Miles | 12/11/2024 | 002: Drivetrain (trans, diff) Labor: 67 - KWASNIEWSKI, STEPHEN <u>67 - KWASNIEWSKI, STEPHEN (12/02/2024: 7:10 AM)</u> Replaced tranny cooler lines Fixed driver side tail lights 005: Electrical system |
| ST39: 2005 STERLING TANDEM | 38075 | 163,644.0 Miles | 10/23/2024 | 003: Steering&Suspension Labor: 62 - URBAN, TAYLOR <u>62 - URBAN, TAYLOR (10/21/2024: 1:27 PM)</u> PM A & B done air leak at fan hub, tightened fitting replaced wiper blades Repaired RFID tire Topped off p/s fluid and replaced cap Replaced left rear strobe Hydraulic hose leaking from crimps, replaced hose LFD shoes separating, replaced shoes and drum Front diff filter leaking, replaced and topped off oil Repaired heat shield/grab handle on muffler 004: Brake system 005: Electrical system 011: Tires 012: Hydraulic system PMA: PMA |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code PMB: PMB |
|----------------------------|-------|-----------------|-------------|--|
| ST39: 2005 STERLING TANDEM | 37839 | 163,264.0 Miles | 09/06/2024 | 011: Tires Labor: 63 - MYERS, BRIAN 63 - MYERS, BRIAN (09/06/2024: 9:29 AM) right intermidaitte inner dual tire had a hole in the side wall. replace the tire with one from the tire rack and replaced the valve stem |
| ST39: 2005 STERLING TANDEM | 37604 | 162,445.0 Miles | 08/07/2024 | 012: Hydraulic system Labor: 67 - KWASNIEWSKI, STEPHEN 67 - KWASNIEWSKI, STEPHEN (08/06/2024: 1:17 PM) Reprimed pump and fixed hydraulic oil leak |
| ST39: 2005 STERLING TANDEM | 37259 | 162,274.0 Miles | 06/07/2024 | 004: Brake system Labor: 63 - MYERS, BRIAN 63 - MYERS, BRIAN (06/06/2024: 10:01 AM) called out on service call for loss of air pressure, found a melted air line next to the tranny due to exhaust pipe broken. Installed a 3/8 air line union and replaced flex pipe, exhaust pipe and muffler with clamps and hardware 010: Exhaust |
| ST39: 2005 STERLING TANDEM | 36914 | 161,148.0 Miles | 04/03/2024 | 003: Steering&Suspension Labor: 67 - KWASNIEWSKI, STEPHEN 67 - KWASNIEWSKI, STEPHEN (04/02/2024: 10:45 AM) PMA PMC PMD Did bushings on front springs And replaced all shocks Replaced steer tires and the rear drive tires 011: Tires PMA: PMA PMC: PMC PMD: PMD |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------|-----------------|-------------|---|
| ST39: 2005 STERLING TANDEM | 36719 | 160,840.0 Miles | 02/21/2024 | 009: Body Labor: 63 - MYERS, BRIAN <u>63 - MYERS, BRIAN (02/20/2024: 7:12 AM)</u> replaced drivers side front fuel tank strap along with hardware for it |
| ST39: 2005 STERLING TANDEM | 36390 | 160,286.0 Miles | 01/23/2024 | 002: Drivetrain (trans, diff) Labor: 62 - URBAN, TAYLOR 003: Steering&Suspension <u>62 - URBAN, TAYLOR (01/05/2024: 2:38 PM)</u> Found coolant leaking from a hose by the fuel injectors. Replaced hose and filled the coolant. Pressure tested and no more leaks. Looked over and found the right rear, rear dule tires were missing 2 stubs a d all the others were loose both rims were egged out and got into the hub. Removed the rims and tires, removed the brake drum and hub assembly. Installed a new hub, bearings, seal and installed all new. Reassembled and replaced both tires and rims. Torqued the lug nuts to spec. Order a new fuel tank strap for the left tank , lower step comming off. 005: Electrical system 007: Fuel System |
| ST39: 2005 STERLING TANDEM | 36144 | 159,483.0 Miles | 11/07/2023 | 011: Tires Labor: 63 - MYERS, BRIAN <u>63 - MYERS, BRIAN (11/02/2023: 10:46 AM)</u> replaced 2 rear tires due to seperation |
| ST39: 2005 STERLING TANDEM | 36141 | 159,097.0 Miles | 11/07/2023 | 012: Hydraulic system Labor: 80 - HERTZIG, RICHARD Labor: 81 - ALBACK, CHARLES <u>80 - HERTZIG, RICHARD (11/07/2023: 7:19 AM)</u> remove front plow hitch and plow lift and turn and relief hydraulic lines |
| ST39: 2005 STERLING TANDEM | 35693 | 158,263.0 Miles | 08/22/2023 | 002: Drivetrain (trans, diff) Labor: 63 - MYERS, BRIAN Labor: 65 - KWASNIEWSKI, DANIEL <u>63 - MYERS, BRIAN (08/22/2023: 9:57 AM)</u> |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------|-----------------|-------------|--|
| | | | | performed A service changed oil and filter greased chassis, checked front end and brakes all good batteries tested good, topped off tranny fluid PMA: PMA |
| ST39: 2005 STERLING TANDEM | 35170 | 157,182.0 Miles | 06/01/2023 | 010: Exhaust Labor: 62 - URBAN, TAYLOR Labor: 63 - MYERS, BRIAN 63 - MYERS, BRIAN (05/31/2023: 2:11 PM) replaced blown hydraulic hose, topped off fluid and bled air out of the pump. Found a rotted exhaust pipe after the turbo, replaced exhaust pipe with new clamps, tightened coolant hose clamps. Found broken hood hinge on driver side, Joe volunteered to fix hinge and welded it back together. The sending unit for the hydraulic tank was broken and deteriorated , replaced sending unit 012: Hydraulic system |
| ST39: 2005 STERLING TANDEM | 34695 | 155,924.0 Miles | 03/17/2023 | 011: Tires Labor: 65 - KWASNIEWSKI, DANIEL 65 - KWASNIEWSKI, DANIEL (03/15/2023: 10:40 AM) replaced tire front tandem pass. side outside duel slash in side wall |
| ST39: 2005 STERLING TANDEM | 34480 | 155,733.0 Miles | 02/08/2023 | 001: Engine Labor: 62 - URBAN, TAYLOR 62 - URBAN, TAYLOR (02/02/2023: 8:43 AM) looked over. Washed off under the unit and ran. Found a main hose leaking from the pump to the tank. Replaced and ran. Adjusted all the brakes. Repaired the right front abs sensor wire. Bent the left rear rear brake can/s cam back into place. Let set overnight and main hydraulic hut off was leaking. Cleaned and was able to seal up. Topped off the coolant and test drove. 012: Hydraulic system |
| ST39: 2005 STERLING TANDEM | 34259 | 155,447.0 Miles | 01/11/2023 | 009: Body Labor: 63 - MYERS, BRIAN 63 - MYERS, BRIAN (01/10/2023: 9:14 AM) call out for a flat tire, had to bring truck into shop to get the lugnuts off due to major rust, found a tire in the rack to put on the truck since the one that went flat was bald, found ignition bezel all broken and replaced ignition bezel and |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------|-----------------|-------------|--|
| | | | | repair a wire on the headlight switch |
| | | | | 011: Tires |
| ST39: 2005 STERLING TANDEM | 34120 | 155,358.0 Miles | 12/09/2022 | 011: Tires Labor: 63 - MYERS, BRIAN Labor: 65 - KWASNIEWSKI, DANIEL 63 - MYERS, BRIAN (12/09/2022: 1:33 PM) repaired rim and replaced tire with valve stem on intermediate axel outside dual drivers side |
| ST39: 2005 STERLING TANDEM | 33981 | 155,233.0 Miles | 12/05/2022 | 001: Engine Labor: 63 - MYERS, BRIAN 63 - MYERS, BRIAN (11/30/2022: 7:08 AM) replaced 3 hoses and one steel elbow for coolant leak along with coolant filter. also had no heat inside the truck found 1 actuator door broken and 2 bad motors. Pulled the dash completely out to replace the door and both motors. Also repaired a feed back issue in the lights when using the left turn signal, it was making the gear selector indicator flash and the box light. @ wires were connected backward. I rewired all the connections on the left rear 006: Heating & Air Conditioning 009: Body 011: Tires |
| ST39: 2005 STERLING TANDEM | 33781 | 154,785.0 Miles | 10/11/2022 | 009: Body Labor: 67 - KWASNIEWSKI, STEPHEN 67 - KWASNIEWSKI, STEPHEN (10/11/2022: 1:24 PM) PMA. replaced whiper blades 011: Tires PMA: PMA |
| ST39: 2005 STERLING TANDEM | 33557 | 154,265.0 Miles | 09/07/2022 | 012: Hydraulic system Labor: 62 - URBAN, TAYLOR Labor: 82 - DRELICHARZ, ALBERT |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------|-----------------|-------------|---|
| | | | | <u>62 - URBAN, TAYLOR (09/07/2022: 7:10 AM)</u> replaced a hydro hose for the box pressure side. Filled with atf and checked operation. |
| ST39: 2005 STERLING TANDEM | 33165 | 153,431.0 Miles | 08/02/2022 | 003: Steering&Suspension Labor: 63 - MYERS, BRIAN <u>63 - MYERS, BRIAN (06/30/2022: 1:53 PM)</u> replaced power steering hose that goes from one steering box to the other. used 3 quarts of power steering fluid |
| ST39: 2005 STERLING TANDEM | 32871 | 152,732.0 Miles | 05/11/2022 | 012: Hydraulic system Labor: 65 - KWASNIEWSKI, DANIEL <u>65 - KWASNIEWSKI, DANIEL (05/05/2022: 1:03 PM)</u> Replace 2 hydraulic hose fitting's O-ring, |
| ST39: 2005 STERLING TANDEM | 32804 | 152,732.0 Miles | 04/29/2022 | 012: Hydraulic system Labor: 65 - KWASNIEWSKI, DANIEL <u>65 - KWASNIEWSKI, DANIEL (04/28/2022: 1:17 PM)</u> Replace front hydraulic hose from pump-valve body. Replace back hydraulic hose from pump-valve body. Top of hydraulic fluid, clean up mess & check for leaks. Repair LH power steering gear box leak. |
| ST39: 2005 STERLING TANDEM | 32649 | 152,151.0 Miles | 04/05/2022 | 003: Steering&Suspension Labor: 67 - KWASNIEWSKI, STEPHEN <u>67 - KWASNIEWSKI, STEPHEN (04/04/2022: 6:40 AM)</u> Replaced passenger side steering gear box Fixed 3 hydraulic leaks on valve body Adjusted micro switch for dump box 012: Hydraulic system |
| ST39: 2005 STERLING TANDEM | 32265 | 151,918.0 Miles | 03/17/2022 | 007: Fuel System Labor: 80 - HERTZIG, RICHARD Labor: 81 - ALBACK, CHARLES <u>80 - HERTZIG, RICHARD (03/14/2022: 6:38 PM)</u> replace dump cylinder 009: Body |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> 012: Hydraulic system |
|----------------------------|-------------|-----------------|--------------------|--|
| ST39: 2005 STERLING TANDEM | 32221 | 151,918.0 Miles | 01/25/2022 | 001: Engine Labor: 63 - MYERS, BRIAN 63 - MYERS, BRIAN (01/21/2022: 12:58 PM) replaced a hose clamp om the fill jug of cooling system |
| ST39: 2005 STERLING TANDEM | 32127 | 151,918.0 Miles | 01/14/2022 | 001: Engine Labor: 63 - MYERS, BRIAN 63 - MYERS, BRIAN (01/13/2022: 7:45 AM) Service call out to tree dump last thursday for fuel leak and no start. Had towed in and found a bad fuel line connection to injector #4. Nut was stripped out. Pulled intake to replace fuel line and replaced all gaskets for the intake. While test driving found a cracked coolant line, replaced all steel coolant lines test drove no leaks Towing: Towing |
| ST39: 2005 STERLING TANDEM | 31891 | 151,517.0 Miles | 12/22/2021 | 001: Engine Labor: 62 - URBAN, TAYLOR Labor: 63 - MYERS, BRIAN 62 - URBAN, TAYLOR (12/22/2021: 9:59 AM) took over for a no start. Checked the fuel system and removed the water separator filter and housing. By passed and removed the ecm and resealed the fuel cooler. Tested the fuel check valves and all were OK. Primed the fuel system and ran unit. Let set and rechecked for no start. Unit starts up even after 24hours. Replaced both front hub caps for leaking. Repaired the left rear tail light wiring. cleaned off the steering gears and greased the seals for leaking. Test drove and returned to service. 004: Brake system 005: Electrical system 005: Electrical system 009: Body 012: Hydraulic system PMA: PMA |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------|-----------------|-------------|--|
| | | | | PMB: PMB |
| ST39: 2005 STERLING TANDEM | 31829 | 151,321.0 Miles | 11/24/2021 | 001: Engine Labor: 62 - URBAN, TAYLOR 62 - URBAN, TAYLOR (11/18/2021: 10:43 AM) went to location. Looked over and scanned ecm. Code for coolant level low. Got coolant and filled unit up. Test ran for 30 minutes and stays running. Cleared code. |
| ST39: 2005 STERLING TANDEM | 31132 | 149,763.0 Miles | 07/23/2021 | 001: Engine Labor: 67 - KWASNIEWSKI, STEPHEN 67 - KWASNIEWSKI, STEPHEN (07/21/2021: 2:21 PM) Idler pulley seized up. Replaced idler pulley, both belts and both belt tensioners |
| ST39: 2005 STERLING TANDEM | 30993 | 149,763.0 Miles | 06/29/2021 | 012: Hydraulic system Labor: 63 - MYERS, BRIAN 63 - MYERS, BRIAN (06/24/2021: 10:37 AM) found pinched and torn o-ring under valve body for hydraulics Replaced o-ring and tested no leaks |
| ST39: 2005 STERLING TANDEM | 30821 | 149,460.0 Miles | 05/26/2021 | 002: Drivetrain (trans, diff) PMA: PMA Labor: 63 - MYERS, BRIAN 63 - MYERS, BRIAN (05/24/2021: 12:05 PM) performed A service with inspection changed oil and filter greased chassis , changed front differential filter and topped off both differentials. batteries are OK |
| ST39: 2005 STERLING TANDEM | 30661 | 149,204.0 Miles | 04/28/2021 | 005: Electrical system Labor: 63 - MYERS, BRIAN 63 - MYERS, BRIAN (04/26/2021: 10:17 AM) complaint was when left turn signal or brake light was on the transmission indicator would flash along with the controls for the hydraulics. Found an |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------|-----------------|-------------|---|
| | | | | extra wire hooked into the power wire which was causing a back feed. Cut the extra wire out and all lights and components working normal, replaced 1 box light and tail light along with passenger side box light pigtail due to broken wire |
| ST39: 2005 STERLING TANDEM | 30460 | 148,383.0 Miles | 03/29/2021 | 005: Electrical system Labor: 80 - HERTZIG, RICHARD Labor: 81 - ALBACK, CHARLES Welding: Welding&Repairs Labor: 80 - HERTZIG, RICHARD Labor: 81 - ALBACK, CHARLES Labor: 82 - DRELICHARZ, ALBERT |
| ST39: 2005 STERLING TANDEM | 30354 | 148,897.0 Miles | 03/03/2021 | 004: Brake system Labor: 62 - URBAN, TAYLOR 62 - URBAN, TAYLOR (03/01/2021: 8:44 AM) looked over. Checked the brakes and replaced the rear slack adjusters. Adjusted the brakes. Changed the engine coolant and filters for C and D services 009: Body PMC: PMC PMD: PMD |
| ST39: 2005 STERLING TANDEM | 29335 | 146,396.0 Miles | 10/20/2020 | 006: Heating & Air Conditioning Labor: 62 - URBAN, TAYLOR 62 - URBAN, TAYLOR (10/14/2020: 3:41 PM) Replaced the exhaust flex pipe and clamps. Replaced the blower motor and filter. Changed the oil and filter. Performed A service. 010: Exhaust PMA: PMA |
| ST39: 2005 STERLING TANDEM | 28940 | 145,606.0 Miles | 08/04/2020 | 008: Frame&Chassis Labor: 67 - KWASNIEWSKI, STEPHEN |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------|-----------------|-------------|---|
| | | | | <u>67 - KWASNIEWSKI, STEPHEN (08/04/2020: 6:14 AM)</u> Replaced the tailgate lock and unlock valve in cab |
| ST39: 2005 STERLING TANDEM | 28121 | 143,101.0 Miles | 03/05/2020 | 003: Steering&Suspension Labor: 62 - URBAN, TAYLOR <u>62 - URBAN, TAYLOR (03/03/2020: 2:02 PM)</u> Went to location and found the right rear spring had broken in half. They got it unloaded and we drove it back to the shop. Disassembled and ordered all parts. Reassembled the right side. Test drove. |
| ST39: 2005 STERLING TANDEM | 28107 | 143,125.0 Miles | 03/04/2020 | 003: Steering&Suspension Labor: 62 - URBAN, TAYLOR <u>62 - URBAN, TAYLOR (03/02/2020: 8:53 AM)</u> Replaced a power steering hose. Replaced the power steering cooler. And replaced the lower radiator steel tube. 006: Heating & Air Conditioning 012: Hydraulic system |
| ST39: 2005 STERLING TANDEM | 28032 | 142,988.0 Miles | 02/14/2020 | 005: Electrical system Labor: 67 - KWASNIEWSKI, STEPHEN <u>67 - KWASNIEWSKI, STEPHEN (02/13/2020: 1:31 PM)</u> A service changed engine oil and filter, changed air filter, checked all fluids, checked brakes, hoses, belts, and greased 012: Hydraulic system PMA: PMA |
| ST39: 2005 STERLING TANDEM | 28001 | 142,948.0 Miles | 02/13/2020 | 012: Hydraulic system Labor: 68 <u>68 (02/11/2020: 1:57 PM)</u> filled hydraulic tank |
| ST39: 2005 STERLING TANDEM | 27968 | 142,120.0 Miles | 02/07/2020 | 005: Electrical system Labor: 62 - URBAN, TAYLOR <u>62 - URBAN, TAYLOR (02/06/2020: 3:17 PM)</u> |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------|-----------------|-------------|---|
| ST39: 2005 STERLING TANDEM | 27955 | 142,835.0 Miles | 02/07/2020 | <p>Replaced terminals for the truck side for the Brin system connector.</p> <p>004: Brake system Labor: 62 - URBAN, TAYLOR</p> <p><u>62 - URBAN, TAYLOR (02/05/2020: 10:59 AM)</u> Went to location and found all the brakes to have air pressure. Found the brake pedal packed full of dirt. Cleaned out and got back to the shop. Removed the floor cover and vacuum up the dirt. Removed the pedal and cleaned the rust. Reassembled and tested.</p> |
| ST39: 2005 STERLING TANDEM | 27813 | 140,365.0 Miles | 01/17/2020 | <p>011: Tires</p> |
| ST39: 2005 STERLING TANDEM | 27801 | 141,538.0 Miles | 01/30/2020 | <p>Tire Service Test Labor: 63 - MYERS, BRIAN Labor: 67 - KWASNIEWSKI, STEPHEN</p> <p><u>63 - MYERS, BRIAN (01/21/2020: 1:55 PM)</u> replaced both front tires due to a blow out last week. torqued lugnuts, replaced one valve stem and one lugnut. Steve K. helped</p> <p>011: Tires</p> <p>012: Hydraulic system</p> |
| ST39: 2005 STERLING TANDEM | 27758 | 140,149.0 Miles | 01/16/2020 | <p>012: Hydraulic system Labor: 67 - KWASNIEWSKI, STEPHEN</p> <p><u>67 - KWASNIEWSKI, STEPHEN (01/15/2020: 11:25 AM)</u> Fixed suction side hose at rear of truck</p> |
| ST39: 2005 STERLING TANDEM | 27717 | 136,773.0 Miles | 01/09/2020 | <p>Plow blade repair: Plow blade repair</p> <p>Plow blade repair: Plow blade repair Labor: 81 - ALBACK, CHARLES Labor: 82 - DRELICHARZ, ALBERT</p> |
| ST39: 2005 STERLING TANDEM | 27652 | 136,773.0 Miles | 12/20/2019 | <p>Sander repair: Sander repair Labor: 62 - URBAN, TAYLOR</p> <p><u>62 - URBAN, TAYLOR (12/19/2019: 10:26 AM)</u> Pre wet alarm comes on with the park lights and has no way of turning off.</p> |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------|-----------------|-------------|---|
| | | | | <p>Tested the wires and tracked down wiring diagram. Found a yellow wire hooked up to the park lights. Disconnected it and had brine installed. Found bad connections at the 4way plug. Repaired and moved wires to match to the pump wires. Checked pump operations and its spraying now but low pressure buzzer is inop. Disassembled the sensors and the pump broke. Replaced the pump and cleaned the pressure switch line . Found it was blocked. Reassembled and tested.</p> |
| ST39: 2005 STERLING TANDEM | 27630 | 136,773.0 Miles | 12/19/2019 | <p>005: Electrical system Labor: 62 - URBAN, TAYLOR</p> <p><u>62 - URBAN, TAYLOR (12/16/2019: 2:17 PM)</u> Tested the hydraulic motor and pressure. Swapped wiring for solenoids and was able to run. Replaced the control head and got all to work. Reassembled and tested. Found the circuit board bad in the old units . Marked and gave back to fab.</p> |
| ST39: 2005 STERLING TANDEM | 27471 | 139,699.0 Miles | 12/13/2019 | <p>005: Electrical system Labor: 62 - URBAN, TAYLOR</p> <p><u>62 - URBAN, TAYLOR (11/27/2019: 8:39 AM)</u> Tested the sprayer valves for powers and grounds. Found the left valve bad and none of the valves getting open and clos signal. Tested the wiring and connections. Tested at the control circuit board and signal not coming out. By passed the wires and replaced the bad valve. Got the valves to open and close. Ran a by pass wiring to the flow sensor and tried operating the system. Cleaned out the flow wheel and retested. Order a new sensor. Installed the sensor and system will not work. Circuit board is bad. Ran a switch to the hydrolic control valve and to operate manually. Set the flow and tested the spray. Removed the left fuel tank and sent out to get repaired for leaking. Installed the fuel tank and fuel.</p> <p>007: Fuel System</p> |
| ST39: 2005 STERLING TANDEM | 27344 | 139,340.0 Miles | 11/26/2019 | <p>Fabrication: Fabrication Labor: 81 - ALBACK, CHARLES Labor: 82 - DRELICHARZ, ALBERT</p> <p>Secured or Unknown</p> |
| ST39: 2005 STERLING TANDEM | 27260 | 139,597.0 Miles | 10/30/2019 | <p>002: Drivetrain (trans, diff) Labor: 63 - MYERS, BRIAN</p> |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------|-----------------|-------------|--|
| | | | | <u>63 - MYERS, BRIAN (10/28/2019: 7:32 AM)</u> performed A and B services, yearly pm. replaced front axle input seal, replaced front differential u-joint, rear brakes on very rear axle with drums and dust shields. Replaced blower motor and resistor along with blower motor switch. replaced rubber holders for hydraulic tank cover, wiper blades, fuel filter, air dryer transmission fluid and filters, oil filter, 3 hydraulic couplers 004: Brake system 006: Heating & Air Conditioning 009: Body 012: Hydraulic system PMA: PMA PMB: PMB |
| ST39: 2005 STERLING TANDEM | 27003 | 138,517.0 Miles | 09/06/2019 | 008: Frame&Chassis Labor: 63 - MYERS, BRIAN <u>63 - MYERS, BRIAN (09/04/2019: 10:43 AM)</u> replaced mudflap on right rear with new bolts |
| ST39: 2005 STERLING TANDEM | 26685 | 137,196.0 Miles | 07/17/2019 | 006: Heating & Air Conditioning Labor: 67 - KWASNIEWSKI, STEPHEN <u>67 - KWASNIEWSKI, STEPHEN (07/17/2019: 7:21 AM)</u> Changed blower motor resistor Changed blower motor relay Fixed window molding |
| ST39: 2005 STERLING TANDEM | 26043 | 135,914.0 Miles | 04/08/2019 | 011: Tires |
| ST39: 2005 STERLING TANDEM | 26041 | 135,914.0 Miles | 04/08/2019 | 011: Tires Labor: 63 - MYERS, BRIAN <u>63 - MYERS, BRIAN (04/08/2019: 8:13 AM)</u> Replaced all 8 rear tires and 1 valve stem |
| ST39: 2005 STERLING TANDEM | 26001 | 135,872.0 Miles | 04/04/2019 | 005: Electrical system |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> |
|----------------------------|-------------|-----------------|--------------------|---|
| | | | | Labor: 62 - URBAN, TAYLOR |
| | | | | <u>62 - URBAN, TAYLOR (04/04/2019: 7:16 AM)</u> pulled out wires and rewired for a new style of plug that we keep in stock. while here found both cab air bags were blown out. installed new ones. replaced the right rear tail light and plug. 009: Body |
| ST39: 2005 STERLING TANDEM | 25894 | 135,135.0 Miles | 03/13/2019 | Welding: Welding&Repairs Labor: 81 - ALBACK, CHARLES Labor: 82 - DRELICHARZ, ALBERT |
| | | | | <u>CINDY - BISHOP, CYNTHIA (03/12/2019: 10:28 AM)</u> Weld castle nut and replaced weather pack |
| ST39: 2005 STERLING TANDEM | 25892 | 135,135.0 Miles | 03/13/2019 | Welding: Welding&Repairs Labor: 80 - HERTZIG, RICHARD Labor: 81 - ALBACK, CHARLES |
| | | | | <u>CINDY - BISHOP, CYNTHIA (03/12/2019: 10:20 AM)</u> Replaced worn cutting edge |
| ST39: 2005 STERLING TANDEM | 25882 | 135,579.0 Miles | 03/28/2019 | PMA: PMA Labor: 63 - MYERS, BRIAN |
| | | | | <u>63 - MYERS, BRIAN (03/22/2019: 10:10 AM)</u> Performed A, B and C service. Replaced starter, master light switch, along with installing a air line union. Checked batteries and cables and cleaned both PMC: PMC PMD: PMD |
| ST39: 2005 STERLING TANDEM | 25856 | 135,137.0 Miles | 03/07/2019 | 009: Body Labor: 64 - VICK, CAMERON |
| | | | | <u>64 - VICK, CAMERON (03/07/2019: 9:08 AM)</u> replaced wiper blades |
| ST39: 2005 STERLING TANDEM | 25785 | 134,224.2 Miles | 03/01/2019 | 005: Electrical system Labor: 68 |
| | | | | <u>68 (02/27/2019: 9:06 AM)</u> |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> |
|----------------------------|-------------|-----------------|--------------------|--|
| | | | | replaced left rear taillight |
| ST39: 2005 STERLING TANDEM | 25763 | 133,853.0 Miles | 02/26/2019 | Welding: Welding&Repairs Labor: 80 - HERTZIG, RICHARD Labor: 81 - ALBACK, CHARLES Labor: 82 - DRELICHARZ, ALBERT <u>CINDY - BISHOP, CYNTHIA (02/25/2019: 2:51 PM)</u> Repaired broken plow |
| ST39: 2005 STERLING TANDEM | 25744 | 133,940.0 Miles | 02/26/2019 | 012: Hydraulic system Labor: 67 - KWASNIEWSKI, STEPHEN <u>67 - KWASNIEWSKI, STEPHEN (02/25/2019: 1:46 PM)</u> replaced both hydraulic fittings on block for plow |
| ST39: 2005 STERLING TANDEM | 25721 | 133,045.0 Miles | 02/21/2019 | Welding: Welding&Repairs Labor: 81 - ALBACK, CHARLES Labor: 82 - DRELICHARZ, ALBERT <u>CINDY - BISHOP, CYNTHIA (02/20/2019: 11:45 AM)</u> Replaced 2' mold board |
| ST39: 2005 STERLING TANDEM | 25688 | 133,290.0 Miles | 02/21/2019 | 005: Electrical system Labor: 62 - URBAN, TAYLOR Labor: 68 <u>62 - URBAN, TAYLOR (02/20/2019: 8:18 AM)</u> replaced the ignition switch for battery drain. <u>68 (02/19/2019: 2:37 PM)</u> service call to sw shop to jumpstart truck |
| ST39: 2005 STERLING TANDEM | 25630 | 132,239.0 Miles | 02/08/2019 | Welding: Welding&Repairs Labor: 80 - HERTZIG, RICHARD Labor: 81 - ALBACK, CHARLES Labor: 82 - DRELICHARZ, ALBERT <u>CINDY - BISHOP, CYNTHIA (02/08/2019: 8:47 AM)</u> Replaced 2' blade and replace lift cylinder |
| ST39: 2005 STERLING TANDEM | 25561 | 132,054.0 Miles | 02/05/2019 | 004: Brake system Labor: 63 - MYERS, BRIAN Labor: 63 - MYERS, BRIAN |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------|-----------------|-------------|---|
| | | | | <u>63 - MYERS, BRIAN (02/04/2019: 1:50 PM)</u> Performed A service oil change and filter change, greased truck and checked batteries which are good. Replace intermediate axle brake shoes, drums and hardware along with flange gaskets and axle hub seals. Cleaned and relubed brake pedal PMA: PMA Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 25518 | 131,366.0 Miles | 01/30/2019 | Welding: Welding&Repairs Labor: 80 - HERTZIG, RICHARD Labor: 81 - ALBACK, CHARLES Labor: 82 - DRELICHARZ, ALBERT <u>CINDY - BISHOP, CYNTHIA (01/25/2019: 1:43 PM)</u> Replaced cutting edge |
| ST39: 2005 STERLING TANDEM | 25488 | 131,366.0 Miles | 01/30/2019 | 009: Body Labor: 62 - URBAN, TAYLOR <u>62 - URBAN, TAYLOR (01/23/2019: 1:05 PM)</u> replaced the right plow wip |
| ST39: 2005 STERLING TANDEM | 25429 | 130,894.0 Miles | 01/15/2019 | Welding: Welding&Repairs Labor: 80 - HERTZIG, RICHARD Labor: 81 - ALBACK, CHARLES Labor: 82 - DRELICHARZ, ALBERT <u>CINDY - BISHOP, CYNTHIA (01/15/2019: 1:15 PM)</u> Replaced 1 - 2' blade and 2 - TME |
| ST39: 2005 STERLING TANDEM | 25420 | 130,894.0 Miles | 01/23/2019 | 001: Engine Labor: 67 - KWASNIEWSKI, STEPHEN <u>61 - RIEPLE, MATTHEW (01/17/2019: 9:09 AM)</u> took to interstate Detroit, they replaced EGR valve. invoice#R013072896 |
| ST39: 2005 STERLING TANDEM | 25336 | 130,838.0 Miles | 01/09/2019 | 005: Electrical system Labor: 62 - URBAN, TAYLOR <u>62 - URBAN, TAYLOR (01/09/2019: 1:10 PM)</u> replaced the throttle pedal and position sensor. |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------------|-----------------|--------------------|---|
| ST39: 2005 STERLING TANDEM | 25269 | 129,453.0 Miles | 12/21/2018 | Welding: Welding&Repairs Labor: 81 - ALBACK, CHARLES Labor: 82 - DRELICHARZ, ALBERT |
| ST39: 2005 STERLING TANDEM | 25171 | 129,426.0 Miles | 12/05/2018 | 005: Electrical system Labor: 63 - MYERS, BRIAN <u>63 - MYERS, BRIAN (12/03/2018: 12:25 PM)</u> Installed new rubber grommet for right rear strobe, light works fine |
| ST39: 2005 STERLING TANDEM | 25274 | 129,250.0 Miles | 12/21/2018 | Welding: Welding&Repairs Labor: 80 - HERTZIG, RICHARD Labor: 81 - ALBACK, CHARLES Labor: 82 - DRELICHARZ, ALBERT <u>CINDY - BISHOP, CYNTHIA (12/21/2018: 9:30 AM)</u> replace worn cutting edge |
| ST39: 2005 STERLING TANDEM | 24934 | 128,756.0 Miles | 10/31/2018 | 001: Engine Labor: 63 - MYERS, BRIAN <u>63 - MYERS, BRIAN (10/29/2018: 12:22 PM)</u> Performed yearly pm A service. Replaced wiper blades, oil and filter, driver side drag link and engine fan clutch assembly. Sent the truck down to fabrication for front plow lift cylinder is leaking. Performed battery cable and battery maint. Replaced main ground wire on the battery, replace both license plates and test drove. PMA: PMA |
| ST39: 2005 STERLING TANDEM | 24596 | 128,085.0 Miles | 08/28/2018 | 009: Body Labor: 63 - MYERS, BRIAN <u>63 - MYERS, BRIAN (08/27/2018: 10:08 AM)</u> Replaced wiper arm transmission due to being rusted and frozen up |
| ST39: 2005 STERLING TANDEM | 24310 | 127,222.0 Miles | 07/12/2018 | 008: Frame&Chassis Labor: 67 - KWASNIEWSKI, STEPHEN <u>07/10/2018: 8:08 AM)</u> replaced mud flap passenger side |
| ST39: 2005 STERLING TANDEM | 24209 | 127,093.0 Miles | 07/10/2018 | Secured or Unknown |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> |
|----------------------------|-------------|-----------------|--------------------|--|
| | | | | Labor: 67 - KWASNIEWSKI, STEPHEN |
| | | | | 06/29/2018: 12:36 PM) replaced radiator |
| ST39: 2005 STERLING TANDEM | 23024 | 126,658.0 Miles | 05/23/2018 | REPLACED SPOTTER MIRROR Labor: 63 - MYERS, BRIAN |
| | | | | REPAIRED R.R. OUTER TIRE Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 24047 | 125,744.0 Miles | 04/11/2018 | A-SERVICE DONE - SEE W/O #64714 FOR INFO |
| ST39: 2005 STERLING TANDEM | 21854 | 125,721.0 Miles | 04/06/2018 | REPLACED DEUTCSH PLUG AND WIRING Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 22628 | 125,744.0 Miles | 03/30/2018 | A-B SERVICE Labor: 67 - KWASNIEWSKI, STEPHEN |
| ST39: 2005 STERLING TANDEM | 23099 | 125,284.0 Miles | 03/13/2018 | REPLACED MOLD BOARD Labor: 0 - BARTELSON, MATTHEW |
| | | | | ASSISTED WITH REPAIRS Labor: 80 - HERTZIG, RICHARD |
| | | | | ASSSTED WITH REPAIRS Labor: 81 - ALBACK, CHARLES |
| ST39: 2005 STERLING TANDEM | 22337 | 123,717.0 Miles | 02/15/2018 | REPLACED BLOWER MOTOR Labor: 70 - SALGADO, ISNARDO |
| ST39: 2005 STERLING TANDEM | 23086 | 123,658.0 Miles | 02/14/2018 | REPLACED CUTTING EDGE Labor: 0 - BARTELSON, MATTHEW |
| | | | | ASSISTED WITH REPAIR Labor: 80 - HERTZIG, RICHARD |
| | | | | ASSISTED WITH REPAIR |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> Labor: 81 - ALBACK, CHARLES |
|----------------------------|-------------|-----------------|--------------------|--|
| ST39: 2005 STERLING TANDEM | 22340 | 123,022.0 Miles | 02/09/2018 | PARTS ONLY. SEE W/O #64247 FOR LABOR, ETC. |
| ST39: 2005 STERLING TANDEM | 22190 | 122,816.0 Miles | 01/18/2018 | REPLACED HOSES AND HYD. VALVE FOR SPINNER Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 23043 | 122,678.0 Miles | 01/12/2018 | PLOW REPAIR Labor: 0 - BARTELSON, MATTHEW ASSISTED WITH REPAIR Labor: 80 - HERTZIG, RICHARD ASSISTED WITH REPAIR Labor: 81 - ALBACK, CHARLES |
| ST39: 2005 STERLING TANDEM | 22059 | 122,320.0 Miles | 12/22/2017 | REPLACED WIPER BLADES Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 22013 | 122,209.0 Miles | 12/22/2017 | REPLACED NIPPLE ON HYD. TANK Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 21936 | 122,225.0 Miles | 12/01/2017 | REBUILD HYDRAULIC MOTOR / PUMP FOR BRINE SYSTEM. Labor: 80 - HERTZIG, RICHARD ASSISTED WITH REPAIRS Labor: 81 - ALBACK, CHARLES |
| ST39: 2005 STERLING TANDEM | 20331 | 122,127.0 Miles | 11/16/2017 | REPLACED HYDRO ENDS ON BRINE TANK Labor: 81 - ALBACK, CHARLES |
| ST39: 2005 STERLING TANDEM | 21745 | 122,120.0 Miles | 11/09/2017 | W/O #2 OF 2 (SEE #63725 FOR WRITE UP) |
| ST39: 2005 STERLING TANDEM | 21696 | 122,120.0 Miles | 11/09/2017 | A-C-D SERVICE ... B-SERVICE PERFORMED 5/5/2017. R Labor: 63 - MYERS, BRIAN |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> |
|----------------------------|-------------|-----------------|--------------------|--|
| | | | | A-SERVICE |
| | | | | C-SERVICE |
| | | | | D-SERVICE |
| | | | | UNIT TOWED TO SHOP. REPLACED HYDRAULIC PUMP, HOSE Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 21658 | 121,938.0 Miles | 10/20/2017 | A-C-D SERVICES WITH OIL, AIR, CABIN AIR, COOLANT A Labor: 63 - MYERS, BRIAN |
| | | | | C-SERVICE |
| | | | | D-SERVICE |
| | | | | REPAIRED BRAKE PEDAL AND VALVE |
| ST39: 2005 STERLING TANDEM | 20319 | 121,954.0 Miles | 10/13/2017 | WELD NEW PINS ON BRUSH GATE Labor: 80 - HERTZIG, RICHARD |
| | | | | ASSISTED WITH REPAIR Labor: 81 - ALBACK, CHARLES |
| ST39: 2005 STERLING TANDEM | 20879 | 118,759.0 Miles | 05/19/2017 | A-B SERVICE. REPLACED WIPER BLADES Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 20797 | 118,702.0 Miles | 05/05/2017 | REPLACED MUD FLAP Labor: 68 |
| ST39: 2005 STERLING TANDEM | 20578 | 118,089.0 Miles | 03/17/2017 | REPLACED MUD FLAP Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 20277 | 117,613.0 Miles | 03/08/2017 | REPLACED TRIP MOUND EAR AND HARDWARE Labor: 0 - BARTELSON, MATTHEW |
| | | | | ASSISTED WITH REPAIRS |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> |
|----------------------------|-------------|-----------------|--------------------|--|
| | | | | Labor: 80 - HERTZIG, RICHARD |
| | | | | ASSISTED WITH REPAIRS Labor: 81 - ALBACK, CHARLES |
| | | | | REBUILD KICKER BAR Labor: 0 - BARTELSON, MATTHEW |
| | | | | ASSISTED WITH REPAIR Labor: 80 - HERTZIG, RICHARD |
| | | | | ASSISTED WITH REPAIR Labor: 81 - ALBACK, CHARLES |
| ST39: 2005 STERLING TANDEM | 20259 | 117,265.0 Miles | 02/17/2017 | REPLACED BROKEN MOLD BOARD, TRIP MOUNT EAR, CUTTIN Labor: 0 - BARTELSON, MATTHEW |
| | | | | ASSISTED WITH REPAIRS Labor: 80 - HERTZIG, RICHARD |
| | | | | ASSISTED WITH REPAIRS Labor: 81 - ALBACK, CHARLES |
| ST39: 2005 STERLING TANDEM | 20393 | 117,210.0 Miles | 02/01/2017 | ADDED ATF OIL Labor: 70 - SALGADO, ISNARDO |
| ST39: 2005 STERLING TANDEM | 20243 | 116,425.0 Miles | 01/24/2017 | REPLACED HY. SPINNER MOTOR Labor: 0 - BARTELSON, MATTHEW |
| | | | | ASSISTED WITH REPAIRS Labor: 80 - HERTZIG, RICHARD |
| | | | | ASSISTED WITH REPAIRS Labor: 81 - ALBACK, CHARLES |
| ST39: 2005 STERLING TANDEM | 20239 | 116,865.0 Miles | 01/24/2017 | REMOVE/REPLACE VALVES ON BRINE TANK Labor: 80 - HERTZIG, RICHARD |
| | | | | ASSISTED WITH REPAIRS Labor: 81 - ALBACK, CHARLES |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------------|-----------------|--------------------|---|
| ST39: 2005 STERLING TANDEM | 20182 | 116,865.0 Miles | 01/24/2017 | PARTS ONLY FOR REPAIR |
| ST39: 2005 STERLING TANDEM | 20131 | 116,865.0 Miles | 01/24/2017 | REPLACED WIPER BLADES Labor: 68 |
| ST39: 2005 STERLING TANDEM | 19800 | 115,322.0 Miles | 11/10/2016 | REPLACED 4 BATTERIES Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 19446 | 115,312.0 Miles | 11/10/2016 | REPAIRED HYDRAULIC FITTINGS ON TRUCK, BRINE TANK A Labor: 80 - HERTZIG, RICHARD |
| ST39: 2005 STERLING TANDEM | 19749 | 115,357.0 Miles | 11/04/2016 | REPAIR ELBOW ON BRINE TANK Labor: 0 - BARTELSON, MATTHEW ASSISTED WITH REPAIR Labor: 80 - HERTZIG, RICHARD |
| ST39: 2005 STERLING TANDEM | 19682 | 115,240.0 Miles | 10/28/2016 | A-SERVICE / PM INSPECTION. NO OIL CHANGE NEEDED. Labor: 66 - SEDLACEK, STEVEN REPLACED LED LIGHTS |
| ST39: 2005 STERLING TANDEM | 19538 | 114,766.0 Miles | 09/30/2016 | A-SERVICE. TOPPED FLUIDS. REPLACED MUD FLAP Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 19373 | 114,296.0 Miles | 08/29/2016 | REPLACED STROBE Labor: 63 - MYERS, BRIAN REPLACED RUBBER GROMMETS AND SPREADER CONNECTOR CA Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 19208 | 113,980.0 Miles | 08/18/2016 | REPLACED MUD FLAP Labor: 70 - SALGADO, ISNARDO |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> |
|----------------------------|-------------|-----------------|--------------------|---|
| | | | | REPLACED TAIL LIGHT Labor: 70 - SALGADO, ISNARDO REPAIR LIFT BOX CYLINDER Labor: 70 - SALGADO, ISNARDO |
| ST39: 2005 STERLING TANDEM | 19294 | 113,809.0 Miles | 07/20/2016 | REPLACED 8 TIRES AND 1 LUGNUT Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 19091 | 113,702.0 Miles | 07/08/2016 | TIRES FOR ST39 |
| ST39: 2005 STERLING TANDEM | 18629 | 112,230.0 Miles | 03/23/2016 | REPORT OF OIL LEAK. CLEAN OIL TANK/CHECK FOR LEAK Labor: 62 - URBAN, TAYLOR |
| ST39: 2005 STERLING TANDEM | 18504 | 111,755.0 Miles | 02/26/2016 | PARTS ONLY |
| ST39: 2005 STERLING TANDEM | 18413 | 111,932.0 Miles | 02/25/2016 | REPLACED EXHAUST PIPE Labor: 62 - URBAN, TAYLOR |
| ST39: 2005 STERLING TANDEM | 18408 | 111,376.0 Miles | 02/09/2016 | A-B SERVICE WITH OIL AND CABIN AIR FILTERS. BRAKE Labor: 63 - MYERS, BRIAN EXHAUST SYST |
| ST39: 2005 STERLING TANDEM | 18262 | 110,114.0 Miles | 01/20/2016 | PICKED UP BY SCOTT |
| ST39: 2005 STERLING TANDEM | 17692 | 109,660.0 Miles | 01/15/2016 | REPLACED CUTTING EDGE ON SNOW PLOW Labor: 81 - ALBACK, CHARLES |
| ST39: 2005 STERLING TANDEM | 17673 | 109,660.0 Miles | 01/15/2016 | PLOW REPAIRS Labor: 0 - BARTELSON, MATTHEW ASSISTED WITH PLOW REPAIRS Labor: 80 - HERTZIG, RICHARD |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> ASSISTED WITH PLOW REPARIS Labor: 81 - ALBACK, CHARLES |
|----------------------------|-------------|-----------------|--------------------|--|
| ST39: 2005 STERLING TANDEM | 18245 | 109,904.0 Miles | 01/14/2016 | REPLACED BRINE HOSE Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 18176 | 109,699.0 Miles | 01/14/2016 | PICKED UP BY CHAD |
| ST39: 2005 STERLING TANDEM | 18167 | 109,660.0 Miles | 01/14/2016 | REPLACED EXHAUST FLEX PIPE Labor: 70 - SALGADO, ISNARDO REPAIR FRONT FENDER HOLD DOWN BRACKETS Labor: 70 - SALGADO, ISNARDO |
| ST39: 2005 STERLING TANDEM | 18123 | 109,095.0 Miles | 01/07/2016 | REPLACED WIPER BLADES Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 17660 | 108,671.0 Miles | 11/20/2015 | REPAIR SPINNER BEARING Labor: 0 - BARTELSON, MATTHEW |
| ST39: 2005 STERLING TANDEM | 23988 | 107,836.0 Miles | 10/29/2015 | B-SERVICE PERFORMED C-SERVICE PERFORMED D-SERVICE PERFORMED |
| ST39: 2005 STERLING TANDEM | 17777 | 107,836.0 Miles | 10/29/2015 | A-B-C-D-E SERVICES / ANNUAL PM INSPECTION. REPLAC Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 17164 | 106,986.0 Miles | 07/23/2015 | REPLACED ALTERNATOR Labor: 66 - SEDLACEK, STEVEN MOUNT/BALANCE FRONT TIRES Labor: 66 - SEDLACEK, STEVEN |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------------|-----------------|--------------------|--|
| ST39: 2005 STERLING TANDEM | 17127 | 106,986.0 Miles | 07/15/2015 | TIRES FOR ST39 |
| ST39: 2005 STERLING TANDEM | 16580 | 105,950.0 Miles | 03/27/2015 | REPLACED MUD FLAP Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 16341 | 105,181.0 Miles | 03/18/2015 | REPLACED WIPER BLADES Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 16528 | 105,584.0 Miles | 03/12/2015 | INSTALLED REPAIRED TIRE Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 16471 | 105,448.0 Miles | 03/04/2015 | TIRE REPAIR Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 16433 | 105,353.0 Miles | 02/25/2015 | TIRE REMOUNT Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 16316 | 105,340.0 Miles | 02/11/2015 | REPLACED BLOWER MOTOR SWITCH AND PIGTAIL Labor: 63 - MYERS, BRIAN TIRE REPAIR Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 16307 | 104,758.0 Miles | 02/03/2015 | REPAIR SANDER WEATHER PACK Labor: 66 - SEDLACEK, STEVEN REPLACED BEACON STROBE REPLACED WIPER BLADES |
| ST39: 2005 STERLING TANDEM | 16261 | 104,601.0 Miles | 01/23/2015 | B-SERVICE WITH CAB FILTERS Labor: 63 - MYERS, BRIAN A-SERVICE |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------------|-----------------|--------------------|--|
| ST39: 2005 STERLING TANDEM | 16045 | 103,427.0 Miles | 12/09/2014 | REPLACED MUD FLAP Labor: 63 - MYERS, BRIAN REPAIR EXHAUST STACK Labor: 63 - MYERS, BRIAN REPLACED VALVE STEM CORE/TIRE REPAIR Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 16022 | 103,358.0 Miles | 11/26/2014 | REPLACED RADIATOR HOSE AND FILLED SYSTEM Labor: 63 - MYERS, BRIAN MUD FLAPS |
| ST39: 2005 STERLING TANDEM | 15588 | 101,626.0 Miles | 10/07/2014 | REPAIR TIRE, RESEALED FRONT HUBS, REPLACED MUD FLA Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 15405 | 101,391.0 Miles | 09/17/2014 | A-B-C-D-E SERVICES PERFORMED / ANNUAL PM INSPECTIO Labor: 63 - MYERS, BRIAN B-SERVICE -- W/O TICKET #1 (\$1,1182.07) OF 2 (SEE C-SERVICE D-SERVICE E-SERVICE REPLACED REAR BRAKES, DRUMS, HARDWARE Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 15386 | 101,391.0 Miles | 09/17/2014 | W/O 2 OF 2 ... SEE # 56450. THIS TICKET INCLUDES |
| ST39: 2005 STERLING TANDEM | 15231 | 100,941.0 Miles | 08/07/2014 | REPLACED STARTER Labor: 68 REPLACED EXHAUST CLAMP Labor: 68 |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------------|-----------------|--------------------|--|
| | | | | REPLACED BACK UP ALARM Labor: 68 |
| ST39: 2005 STERLING TANDEM | 15177 | 100,937.0 Miles | 07/28/2014 | REPLACED STARTER SWITCH Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 15115 | 100,770.0 Miles | 07/24/2014 | REPLACED AIR DUMP VALVE Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 14741 | 100,055.0 Miles | 06/04/2014 | CHECKED BATTERIES THROUGHOUT WEEKEND Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 14607 | 99,758.0 Miles | 04/10/2014 | A-SERVICE Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 14408 | 99,669.0 Miles | 03/06/2014 | REPLACED SANDER 4 PIN CONNECTORS & WIRING Labor: 70 - SALGADO, ISNARDO |
| ST39: 2005 STERLING TANDEM | 14335 | 99,487.0 Miles | 02/14/2014 | REPAIR WINDSHIELD WASHER HOSE ON DRIVERS SIDE Labor: 68 |
| ST39: 2005 STERLING TANDEM | 14283 | 98,788.0 Miles | 02/05/2014 | REPLACED WIPER BLADES Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 14058 | 98,132.0 Miles | 12/24/2013 | REPLACED REAR AXLE SLACK ADJUSTERS. TOPPED OFF HY Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 13886 | 97,574.0 Miles | 11/25/2013 | REPLACED MUD FLAP Labor: 0 - BARTELSON, MATTHEW |
| ST39: 2005 STERLING TANDEM | 13386 | 97,295.0 Miles | 10/16/2013 | PARTS ONLY ... SEE WORK ORDER TICKET #54219 (8/21/ |
| ST39: 2005 STERLING TANDEM | 13704 | 97,355.0 Miles | 10/15/2013 | A-SERVICE / ANNUAL PM INSPECTION WITH AIR, OIL, FU |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> |
|----------------------------|-------------|----------------|--------------------|---|
| | | | | Labor: 63 - MYERS, BRIAN |
| | | | | B-SERVICE Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 13430 | 96,941.0 Miles | 09/05/2013 | REPAIRED LEFT REAR OUTER TIRE Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 13076 | 94,826.0 Miles | 06/13/2013 | REPLACE PASSENGER SIDE WINDOW SWITCH Labor: 66 - SEDLACEK, STEVEN |
| | | | | REPLACE A/C BELT AND LOW PSI LINE Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 12747 | 93,728.0 Miles | 04/09/2013 | REPLACED LEFT FRONT HEAD LIGHT Labor: 68 |
| ST39: 2005 STERLING TANDEM | 12748 | 93,728.0 Miles | 03/28/2013 | REPLACED HEADLAMP Labor: 68 |
| | | | | REPAIRED RIGHT FRONT FENDER, REPLACED BROKEN BRACE Labor: 68 |
| ST39: 2005 STERLING TANDEM | 12738 | 93,722.0 Miles | 03/26/2013 | REPAIR TRANSMISSION CONTROLLER Labor: 68 |
| ST39: 2005 STERLING TANDEM | 12642 | 93,578.0 Miles | 03/19/2013 | A-SERVICE WITH OIL, AIR AND CAB FILTER Labor: 63 - MYERS, BRIAN |
| | | | | REPLACED WIPER BLADES Labor: 63 - MYERS, BRIAN |
| | | | | REPLACED BRAKE PEDAL AIR VALVE AND PEDAL Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 12298 | 91,680.0 Miles | 01/08/2013 | REPAIR FLAT TIRE Labor: 63 - MYERS, BRIAN |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------------|----------------|--------------------|---|
| ST39: 2005 STERLING TANDEM | 12202 | 90,787.0 Miles | 12/24/2012 | REPAIR FLAT REAR TIRE Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 12216 | 90,873.0 Miles | 12/20/2012 | REPLACED BROKEN HYDRAULIC HOSE Labor: 68 |
| ST39: 2005 STERLING TANDEM | 11797 | 89,961.0 Miles | 09/25/2012 | REPLACED WINDOW MOTOR AND REGULATOR ON DRIVER'S WI Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 11707 | 89,744.0 Miles | 09/20/2012 | A-SERVICE / YEARLY PM INSPECTION. Labor: 66 - SEDLACEK, STEVEN REPLACED SLACK ADJUSTER, KING PIN, REAR BRAKE CANS Labor: 66 - SEDLACEK, STEVEN REPLACED 8 REAR DRIVE TIRES Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 11718 | 89,744.0 Miles | 08/31/2012 | PURCHASED NEW TIRES FOR REAR OF TRUCK |
| ST39: 2005 STERLING TANDEM | 11554 | 89,183.0 Miles | 07/25/2012 | Recharge A/C System Labor: 68 Replaced Hyd Coupler On rear of truck Labor: 68 |
| ST39: 2005 STERLING TANDEM | 11176 | 87,512.0 Miles | 05/07/2012 | REPAIRED FLAT TIRE Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 23105 | 86,974.0 Miles | 03/28/2012 | REPLACED TAIL LIGHT ASSEMBLY Labor: 68 |
| ST39: 2005 STERLING TANDEM | 10964 | 86,853.0 Miles | 03/23/2012 | A-SERVICE Labor: 63 - MYERS, BRIAN |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------------|----------------|--------------------|--|
| | | | | TUNED ENGINE Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 10851 | 86,165.0 Miles | 02/23/2012 | TOPPED HYDRAULIC OIL Labor: 62 - URBAN, TAYLOR |
| ST39: 2005 STERLING TANDEM | 10786 | 86,026.0 Miles | 02/10/2012 | PARTS PICKED UP BY KENNY ROWE |
| ST39: 2005 STERLING TANDEM | 10803 | 85,902.0 Miles | 02/08/2012 | REPLACED WIPER BLADES Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 10768 | 85,503.0 Miles | 02/02/2012 | REPLACED HEATER CORE Labor: 63 - MYERS, BRIAN REPLACED DRIVER SIDE WINDOW SWITCH Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 10620 | 84,728.0 Miles | 12/21/2011 | TOPPED OFF HYDRAULIC FLUIDS Labor: 68 |
| ST39: 2005 STERLING TANDEM | 10530 | 83,657.0 Miles | 12/09/2011 | REPLACED WIPER BLADES Labor: 68 |
| ST39: 2005 STERLING TANDEM | 10525 | 83,535.0 Miles | 12/07/2011 | REPAIRED STROBE LIGHT, REPLACED SWITCHES ON PLOW L Labor: 68 |
| ST39: 2005 STERLING TANDEM | 10383 | 83,442.0 Miles | 11/29/2011 | INSTALLED GPS AND SANDERS CONTROL BOX Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 10315 | 83,385.0 Miles | 08/29/2011 | A-SERVICE - ANNUAL PM INSPECTION -- REPLACED FRONT Labor: 63 - MYERS, BRIAN C-SERVICE |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> D-SERVICE |
|----------------------------|-------------|----------------|--------------------|--|
| ST39: 2005 STERLING TANDEM | 9822 | 82,849.0 Miles | 07/26/2011 | A-SERVICE WITH OIL AND AIR FILTERS Labor: 70 - SALGADO, ISNARDO CHARGED A/C SYSTEM Labor: 70 - SALGADO, ISNARDO REPLACED WINDOW REGULATOR Labor: 70 - SALGADO, ISNARDO REPAIRED LIGHTS Labor: 70 - SALGADO, ISNARDO |
| ST39: 2005 STERLING TANDEM | 9657 | 81,966.0 Miles | 05/25/2011 | REPLACED HEATER CORE AND COOLANT RESEVOIR Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 9275 | 79,461.0 Miles | 02/10/2011 | A-SERVICE, REPLACED OIL, CAB AND AIR FILTERS. TOP Labor: 67 - KWASNIEWSKI, STEPHEN |
| ST39: 2005 STERLING TANDEM | 9208 | 78,505.0 Miles | 02/10/2011 | REPLACED STEERING SHAFT U-JOINT Labor: 67 - KWASNIEWSKI, STEPHEN |
| ST39: 2005 STERLING TANDEM | 9245 | 79,051.0 Miles | 02/04/2011 | REPLACED WIPER BLADES Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 9179 | 78,195.0 Miles | 01/26/2011 | REPLACED BROKEN HYDRAULIC HOSE AND TOPPED OFF FLUI Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 9172 | 78,095.0 Miles | 01/26/2011 | REPLACED WIPER BLADES Labor: 68 |
| ST39: 2005 STERLING TANDEM | 9168 | 78,021.0 Miles | 01/26/2011 | REPLACED WIPER BLADES Labor: 63 - MYERS, BRIAN TOPPED OFF HYDRAULIC FLUID |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> Labor: 63 - MYERS, BRIAN |
|----------------------------|-------------|----------------|--------------------|---|
| ST39: 2005 STERLING TANDEM | 9045 | 75,907.0 Miles | 01/06/2011 | REPLACED A/C CONDENSOR, ACCUMULATOR AND ORFICE TUB Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 8989 | 75,563.0 Miles | 12/20/2010 | REPLACED PLUG SOCKET FOR BRINE SYSTEM Labor: 68 |
| ST39: 2005 STERLING TANDEM | 8970 | 75,552.0 Miles | 12/20/2010 | INSTALLED GPS SYSTEM Labor: 61 - RIEPLE, MATTHEW |
| ST39: 2005 STERLING TANDEM | 8931 | 75,253.0 Miles | 12/13/2010 | REPLACED DASH PANEL BRACKET Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 8900 | 74,978.0 Miles | 12/02/2010 | SUPPLIES FOR ST39 ... PARTS TO BE INSTALLED BY VER |
| ST39: 2005 STERLING TANDEM | 8746 | 74,328.0 Miles | 11/05/2010 | A-SERVICE YEARLY PM INSPECTION. REPLACED OIL FILT Labor: 63 - MYERS, BRIAN FLUSH/FILL TRANSMISSION, REPLACED AIR DRYER AND CA Labor: 63 - MYERS, BRIAN REPLACED HYDRAULIC LIFT CYLINDER FOR PLOW Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 8729 | 74,136.0 Miles | 10/13/2010 | REPLACED LEFT FRONT HEAD LIGHT Labor: 68 |
| ST39: 2005 STERLING TANDEM | 8374 | 71,937.0 Miles | 07/02/2010 | REPLACED BRAKE PEDAL AND MOUNTING PLATE Labor: 62 - URBAN, TAYLOR |
| ST39: 2005 STERLING TANDEM | 8363 | 72,444.0 Miles | 06/24/2010 | REPLACED WINDSHIELD (METRO GLASS) |
| ST39: 2005 STERLING TANDEM | 8346 | 72,444.0 Miles | 06/24/2010 | REPLACED REAR SLACK ADJUSTERS |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> Labor: 66 - SEDLACEK, STEVEN |
|----------------------------|-------------|----------------|--------------------|--|
| ST39: 2005 STERLING TANDEM | 8104 | 71,584.0 Miles | 04/07/2010 | REPAIRED FLAT TIRE Labor: 68 |
| ST39: 2005 STERLING TANDEM | 8021 | 70,657.0 Miles | 03/23/2010 | A-SERVICE - REPLACED OIL, AIR AND FUEL FILTERS Labor: 64 - VICK, CAMERON B-SERVICE - CHECKED TRANSMISSION, REPAIRED TRANNY Labor: 64 - VICK, CAMERON REPLACED MARKER LIGHT Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 7843 | 67,245.0 Miles | 01/28/2010 | A-SERVICE, REPLACED OIL, AIR AND FUEL FILTERS Labor: 63 - MYERS, BRIAN TOPPED OFF TRANNY FLUID AND REPLACED DIPSTICK Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 7811 | 66,866.0 Miles | 01/22/2010 | REPAIR REAR TIRE Labor: 0 - BARTELSON, MATTHEW REPLACED WINDOW WIPERS Labor: 0 - BARTELSON, MATTHEW |
| ST39: 2005 STERLING TANDEM | 7658 | 64,443.0 Miles | 12/30/2009 | REPLACED AIR LINE Labor: 68 |
| ST39: 2005 STERLING TANDEM | 7598 | 63,669.0 Miles | 12/24/2009 | REPLACED MIC ON RADIO Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 7578 | 63,417.0 Miles | 12/09/2009 | REPLACED WIPER BLADES, TOPPED OFF FLUID Labor: 61 - RIEPLE, MATTHEW |
| ST39: 2005 STERLING TANDEM | 7563 | 63,211.0 Miles | 12/08/2009 | REPLACED RADIO ANTENNA |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> Labor: 63 - MYERS, BRIAN |
|----------------------------|-------------|----------------|--------------------|--|
| ST39: 2005 STERLING TANDEM | 7552 | 63,041.0 Miles | 12/08/2009 | REPLACED WINDOW WIPERS Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 7465 | 62,713.0 Miles | 11/06/2009 | REPLACED STROBE LIGHT Labor: 68 REMOVED BROKEN BOLT IN TRANSMISSION AND REPLACED S Labor: 68 |
| ST39: 2005 STERLING TANDEM | 7252 | 61,168.0 Miles | 09/04/2009 | YEARLY PM INSPECTION, NO SERVICE DUE Labor: 66 - SEDLACEK, STEVEN REPLACED HYDRAULIC HOSE AND DIP STICK, FILL TUBE S Labor: 66 - SEDLACEK, STEVEN REPLACED 8 REAR TIRES WITH SNOWS Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 7099 | 59,984.0 Miles | 07/20/2009 | REPLACED WIPER ARM ON PASSENGER SIDE Labor: 61 - RIEPLE, MATTHEW |
| ST39: 2005 STERLING TANDEM | 7112 | 59,969.0 Miles | 07/16/2009 | REMOVED EGR VALVE & CLEANED. INSTALLED 06M6 MOD L |
| ST39: 2005 STERLING TANDEM | 7033 | 59,854.0 Miles | 07/06/2009 | A-SERVICE Labor: 0 - BARTELSON, MATTHEW B-SERVICE - REPLACED FUEL FILTER Labor: 0 - BARTELSON, MATTHEW C-SERVICE - FLUSHED COOLANT SYSTEM Labor: 0 - BARTELSON, MATTHEW D-SERVICE - REPLACED AIR FILTERS Labor: 0 - BARTELSON, MATTHEW E-SERVICE - REPLACED REAR AXLE FILTER, AXLE O-RING |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> |
|----------------------------|-------------|----------------|--------------------|--|
| | | | | Labor: 63 - MYERS, BRIAN |
| | | | | REPLACED BATTERIES Labor: 0 - BARTELSON, MATTHEW |
| ST39: 2005 STERLING TANDEM | 7015 | 59,854.0 Miles | 06/30/2009 | REPLACED A/C COMPRESSOR AND DRIVE BELT, REPAIRED B Labor: 61 - RIEPLE, MATTHEW |
| ST39: 2005 STERLING TANDEM | 6799 | 58,635.0 Miles | 04/21/2009 | REPAIRED FLAT TIRE Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 6598 | 57,188.0 Miles | 02/19/2009 | LUBED PIN ON BRAKE PEDAL Labor: 70 - SALGADO, ISNARDO |
| ST39: 2005 STERLING TANDEM | 6546 | 56,616.0 Miles | 02/05/2009 | A-SERVICE, REPLACED OIL AND AIR FILTERS Labor: 63 - MYERS, BRIAN |
| | | | | REPLACED LIGHT BULB Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 6471 | 55,659.0 Miles | 01/16/2009 | TOPPED OFF HYDRAULIC FLUID Labor: 0 - BARTELSON, MATTHEW |
| ST39: 2005 STERLING TANDEM | 6438 | 54,531.0 Miles | 01/08/2009 | REPLACED BRINE SYSTEM CONNECTOR Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 6298 | 52,678.0 Miles | 12/11/2008 | REPLACED BATTERIES Labor: 63 - MYERS, BRIAN |
| | | | | A-SERVICE, REPLACED OIL, AIR, FUEL AND CAB FILTERS Labor: 63 - MYERS, BRIAN |
| | | | | REPLACED TWO HYDRAULIC HOSE FITTINGS Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 6136 | 50,831.0 Miles | 10/15/2008 | REPLACED FRONT WINDOW, METRO GLASS COMPANY |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> |
|----------------------------|-------------|----------------|--------------------|---|
| ST39: 2005 STERLING TANDEM | 6113 | 52,544.0 Miles | 12/11/2008 | REPLACED CAB FILTER AND AIR DRYER Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 5837 | 49,436.0 Miles | 07/24/2008 | A-SERVICE Labor: 66 - SEDLACEK, STEVEN B-SERVICE Labor: 66 - SEDLACEK, STEVEN REWIRE REAR LIGHTS Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 5535 | 47,483.0 Miles | 04/15/2008 | REPLACED WIPER BLADES, KENNY ROW INSTALLED |
| ST39: 2005 STERLING TANDEM | 5419 | 45,983.0 Miles | 03/15/2008 | A-SERVICE, ADJUSTED BRAKES Labor: 63 - MYERS, BRIAN REPLACED BELTS Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 5345 | 45,138.0 Miles | 02/19/2008 | REPLACED LIGHT BULB Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 5327 | 44,717.0 Miles | 02/05/2008 | REPLACED STEERING SHAFT U-JOINT Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 5317 | 44,400.0 Miles | 02/04/2008 | ADJUST FRONT AND REAR BRAKE Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 5248 | 43,991.0 Miles | 01/22/2008 | REPAIR STICKY BRAKE PEDAL Labor: 61 - RIEPLE, MATTHEW |
| ST39: 2005 STERLING TANDEM | 5245 | 43,519.0 Miles | 01/11/2008 | REPLACED BUSHING IN HYDRAULIC LIFT Labor: 66 - SEDLACEK, STEVEN |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------------|----------------|--------------------|---|
| ST39: 2005 STERLING TANDEM | 5215 | 43,427.0 Miles | 01/03/2008 | INSTALL HYDRAULIC HOSE Labor: 67 - KWASNIEWSKI, STEPHEN |
| ST39: 2005 STERLING TANDEM | 5201 | 43,320.0 Miles | 12/31/2007 | REPAIRED TAIL LIGHTS Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 5180 | 43,117.0 Miles | 01/03/2008 | REPLACED HEATER BLOWER MOTOR Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 5160 | 42,618.0 Miles | 12/20/2007 | A-SERVICE Labor: 66 - SEDLACEK, STEVEN B-SERVICE Labor: 66 - SEDLACEK, STEVEN REPLACED DUMP BOX HYDRAULIC CYLINDER Labor: 66 - SEDLACEK, STEVEN REPLACED BROKEN HYDRAULIC LINES Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 5154 | 42,503.0 Miles | 12/20/2007 | REPAIRED PRESSURE REFIEF VALVE. TOPPED OFF FLUID Labor: 65 - KWASNIEWSKI, DANIEL |
| ST39: 2005 STERLING TANDEM | 5115 | 41,696.0 Miles | 12/07/2007 | REPLACED WIPER BLADES & ICE SCRAPER FOR DRIVER Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 5087 | 41,328.0 Miles | 12/03/2007 | REPLACED LIGHT BULB Labor: 61 - RIEPLE, MATTHEW |
| ST39: 2005 STERLING TANDEM | 4939 | 39,749.0 Miles | 10/18/2007 | PURCHASED TIRES FOR STREET 39 |
| ST39: 2005 STERLING TANDEM | 4924 | 40,029.0 Miles | 10/10/2007 | Mount and Balance eight new rear tires Labor: 63 - MYERS, BRIAN |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------------|----------------|--------------------|---|
| ST39: 2005 STERLING TANDEM | 4794 | 39,538.0 Miles | 10/04/2007 | C-SERVICE, REPLACED HEATER CORE, REPAIRED OIL , FL Labor: 66 - SEDLACEK, STEVEN D-SERVICE, REPLACED CAB FILTER & HYDRAULIC HOSES Labor: 66 - SEDLACEK, STEVEN REPLACED MUD FLAPS Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 4475 | 37,579.0 Miles | 06/26/2007 | REPLACED BOTH FRONT TIRES AND TWO WHEEL STUDS AND Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 4445 | 37,518.0 Miles | 06/14/2007 | A-SERVICE, ADJUST BRAKES Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 4349 | 35,310.0 Miles | 05/22/2007 | FILLED COOLANT SYSTEM Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 4329 | 35,272.0 Miles | 05/18/2007 | TOPPED OFF TRANSMISSION FLUID Labor: 61 - RIEPLE, MATTHEW |
| ST39: 2005 STERLING TANDEM | 4245 | 34,670.0 Miles | 04/25/2007 | REPLACED TAIL LIGHT LENS Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 4077 | 33,972.0 Miles | 03/29/2007 | REPLACED WIPER BLADES Labor: 67 - KWASNIEWSKI, STEPHEN |
| ST39: 2005 STERLING TANDEM | 4051 | 33,941.0 Miles | 03/23/2007 | A-SERVICE WITH AIR AND CAB FILTER Labor: 63 - MYERS, BRIAN SERVICED TRANSMISSION Labor: 63 - MYERS, BRIAN REPAIRED MARKER LIGHTS, REPLACED LIGHT BULBS Labor: 63 - MYERS, BRIAN |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> |
|----------------------------|-------------|----------------|--------------------|--|
| | | | | REPLACED FRONT WINDOW, METRO GLASS Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 4031 | 33,845.0 Miles | 03/14/2007 | TOPPED OFF HYDRAULIC FLUID Labor: 67 - KWASNIEWSKI, STEPHEN |
| ST39: 2005 STERLING TANDEM | 3983 | 32,388.0 Miles | 02/26/2007 | REPLACED TRANSMISSION COOLER Labor: 67 - KWASNIEWSKI, STEPHEN |
| | | | | SERVICE CALL 2/25 - REPAIRED MAIN HYDRAULIC HOSE A Labor: 62 - URBAN, TAYLOR |
| ST39: 2005 STERLING TANDEM | 3955 | 31,656.0 Miles | 02/16/2007 | REPLACED BACK-UP ALARM Labor: 67 - KWASNIEWSKI, STEPHEN |
| | | | | FILLED HYDRAULIC SYSTEM Labor: 67 - KWASNIEWSKI, STEPHEN |
| ST39: 2005 STERLING TANDEM | 3876 | 30,914.0 Miles | 01/26/2007 | A-SERVICE WITH AIR AND FUEL FILTER Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 3852 | 30,000.0 Miles | 01/18/2007 | REFILL HYDRAULICS TANK Labor: 62 - URBAN, TAYLOR |
| ST39: 2005 STERLING TANDEM | 3830 | 29,417.0 Miles | 01/12/2007 | REPAIRED BRINE SYSTEM ON REAR OF TRUCK Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 3801 | 28,970.0 Miles | 01/10/2007 | REPLACED TAIL LIGHT Labor: 62 - URBAN, TAYLOR |
| ST39: 2005 STERLING TANDEM | 3789 | 28,884.0 Miles | 01/02/2007 | Repaired Tail lights and Wiring Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 3783 | 28,811.0 Miles | 01/02/2007 | Replaced Wiper Blades |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> |
|----------------------------|-------------|----------------|--------------------|---|
| | | | | Labor: 65 - KWASNIEWSKI, DANIEL |
| ST39: 2005 STERLING TANDEM | 3776 | 28,604.0 Miles | 12/31/2006 | Replaced Tail Light Labor: 63 - MYERS, BRIAN Replaced Heated right side mirror Labor: 63 - MYERS, BRIAN Replaced Broken Radio Antenna Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 3661 | 27,388.0 Miles | 11/06/2006 | A-SERVICE, BPM SERVICE, REPLACED AIR FILTER, FUEL Labor: 66 - SEDLACEK, STEVEN REPLACED MUD FLAPS REPLACED HEATER CORE Labor: 66 - SEDLACEK, STEVEN REPAIRED TAIL LIGHT Labor: 66 - SEDLACEK, STEVEN REPLACED POWER STEERING HOSE Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 3447 | 25,195.0 Miles | 08/08/2006 | REPLACED TAIL LIGHT Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 3331 | 24,763.0 Miles | 07/05/2006 | A-SERVICE WITH FUEL FILTER, CARB FILTERS Labor: 63 - MYERS, BRIAN REPLACED BACK-UP ALARM Labor: 63 - MYERS, BRIAN REPAIRED LIGHTS Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 3000 | 22,122.0 Miles | 05/10/2006 | REPLACED TANK STRAPS AND TANK STEP Labor: 62 - URBAN, TAYLOR |

Work Order History - Custom

| <u>Asset</u> | <u>WO #</u> | <u>Meter 1</u> | <u>Closed Date</u> | <u>Work Code</u> |
|----------------------------|-------------|----------------|--------------------|--|
| | | | | REPLACED HEAD LIGHT Labor: 62 - URBAN, TAYLOR |
| ST39: 2005 STERLING TANDEM | 2927 | 21,326.0 Miles | 03/29/2006 | A-service with fuel filter Labor: 64 - VICK, CAMERON Repaired Tail lights Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 2912 | 21,240.0 Miles | 03/29/2006 | Repaired rear lights Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 2902 | 20,987.0 Miles | 03/21/2006 | Replaced Power Plug to Brime system Labor: 65 - KWASNIEWSKI, DANIEL |
| ST39: 2005 STERLING TANDEM | 2898 | 20,869.0 Miles | 03/21/2006 | Repaired Radio antenna, Replaced strobe light Labor: 65 - KWASNIEWSKI, DANIEL |
| ST39: 2005 STERLING TANDEM | 2824 | 19,418.0 Miles | 02/28/2006 | Replaced Heater core Labor: 67 - KWASNIEWSKI, STEPHEN |
| ST39: 2005 STERLING TANDEM | 2809 | 19,194.0 Miles | 02/16/2006 | Replaced Side marker Light Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 3186 | 18,151.0 Miles | 12/29/2005 | Repaired strobe connector and replaced blubs Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 3167 | 17,977.0 Miles | 12/27/2005 | A-service, with air, fuel and oil filter Labor: 64 - VICK, CAMERON Replaced Front Window, (Galvin Glass) |
| ST39: 2005 STERLING TANDEM | 3144 | 17,394.0 Miles | 12/14/2005 | Gave Driver Bungee cords straps |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------------|----------------|--------------------|---|
| ST39: 2005 STERLING TANDEM | 3135 | 17,281.0 Miles | 12/14/2005 | Replaced Strobe light, Repaired Connector Labor: 68 |
| ST39: 2005 STERLING TANDEM | 3117 | 16,773.0 Miles | 12/07/2005 | Replaced Strobe light Blub Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 2772 | 15,840.0 Miles | 11/18/2005 | Replaced Front Strobe light Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 2678 | 14,229.0 Miles | 10/10/2005 | Repairs to window switch (Wicks Trucking Company) |
| ST39: 2005 STERLING TANDEM | 2658 | 14,215.0 Miles | 10/06/2005 | A-Service, Replaced Cabin Filter Labor: 62 - URBAN, TAYLOR Conducted Yearly BPM Inspection and service per In Labor: 62 - URBAN, TAYLOR Repaired Strobe light Labor: 62 - URBAN, TAYLOR |
| ST39: 2005 STERLING TANDEM | 2444 | 12,268.0 Miles | 07/13/2005 | A-Service, with fuel filter Labor: 63 - MYERS, BRIAN Repaired Strobe light on top of truck Labor: 63 - MYERS, BRIAN |
| ST39: 2005 STERLING TANDEM | 2286 | 9,185.0 Miles | 05/09/2005 | Repairs to Body damage on sterling Truck,(Paul Lu |
| ST39: 2005 STERLING TANDEM | 2154 | 9,011.0 Miles | 03/25/2005 | A-service with fuel filter, check light, grease Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 2129 | 9,034.0 Miles | 03/22/2005 | Top off Hyd tank Labor: 61 - RIEPLE, MATTHEW |

Work Order History - Custom

| Asset | WO # | Meter 1 | Closed Date | Work Code |
|----------------------------|-------------|----------------|--------------------|--|
| ST39: 2005 STERLING TANDEM | 2109 | 7,946.0 Miles | 03/01/2005 | Repaired loose dip stick tube Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 2105 | 7,855.0 Miles | 02/28/2005 | Instilled new Brime plug Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 2096 | 7,698.0 Miles | 02/24/2005 | Installed high pwoered spot light Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 2042 | 5,849.0 Miles | 01/24/2005 | A-Service with fuel filter Labor: 66 - SEDLACEK, STEVEN New light charges, Lights not installed at this ti Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 2005 | 4,409.0 Miles | 01/06/2005 | Installed winter front Labor: 68 |
| ST39: 2005 STERLING TANDEM | 1946 | 2,501.0 Miles | 11/24/2004 | Hook up and install brime system Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 1917 | 2,497.0 Miles | 12/07/2004 | Wire Brime System, city band radio, finish other w Labor: 64 - VICK, CAMERON |
| ST39: 2005 STERLING TANDEM | 1900 | 1,247.0 Miles | 10/19/2004 | Wired in control unit for dump box, Tail light, Ai Labor: 66 - SEDLACEK, STEVEN |
| ST39: 2005 STERLING TANDEM | 1875 | 1,188.0 Miles | 09/21/2004 | Replaced OTO with New PTO, (Wrong one ordered) Labor: 65 - KWASNIEWSKI, DANIEL |