

UAF Facilities Services PM Asset Notes Log

For Asset:
E4189

WO/Ph/Seq	Notes	
UAF16-0027613 001 1	TIMECARD:545132 ITEM:2 39077 MILES LOCATE VEHICLE AND USER, BRING BACK TO SHOP. PERFORM PMI-AIR, OIL. REPLACE WIPER BLADES, SET TIRE PRESSURES.	CPLOWMAN May 4, 2016
UAF16-0027613 001 2	TIMECARD:545132 ITEM:9 COMPLETE PMI.	CPLOWMAN May 5, 2016
UAF16-0027653 001 1	TIMECARD:545132 ITEM:3 INSPECT ORDER REPLACEMENT LEFT CV AXLE	CPLOWMAN May 4, 2016
UAF16-0027653 001 2	TIMECARD:545132 ITEM:7 REMOVE AND REPLACE BAD LEFT C V AXLE. ROAD TEST NOW OK.	CPLOWMAN May 5, 2016
UAF18-0004406 001 1	TIMECARD:608853 ITEM:3 PMI., 45086 MILES, INSPECTION OF VEHICLE FOUND NO ISSUES	AGALE Aug 25, 2017
UAF18-0029140 001 1	TIMECARD:648348 ITEM:2 PMI., 48246 MILES, INSPECTION OF VEHICLE FOUND RIGHT REAR TAIL LIGHT LENS BROKEN, BRAKES NEED TO BE DONE, A TRANSMISSION SERVICE IS RECOMENDED	AGALE Jun 27, 2018
UAF18-0029141 001 1	TIMECARD:646609 ITEM:3 INSPECTED ON LIFT TO DETERMINE WHAT AXLE IS BAD, PASSENGER SIDE AXLE IS WORN AND DAMAGED, ORDER NEW AXLE	AGALE Jun 13, 2018
UAF18-0029141 001 2	TIMECARD:648348 ITEM:4 REPLACED RIGHT FRONT CV AXLE, PULLED STRUT AND SPINDLE TO REMOVE AXLE, REVERSE ORDER TO ASSEMBLE	AGALE Jun 27, 2018
UAF19-0022809 001 1	TIMECARD:683112 ITEM:4 52255MI PERFORM PMI-AIR, OIL	CPLOWMAN Apr 1, 2019
UAF19-0022810 001 1	TIMECARD:680312 ITEM:3 VERIFY TRANSMISSION SLIPPAGE. DELIVER TO DEALER FOR REPAIRS.	CPLOWMAN Mar 12, 2019
UAF19-0022810 001 2	TIMECARD:683112 ITEM:3 PICK UP FROM DEALER AFTER REPAIRS.	CPLOWMAN Apr 1, 2019
UAF19-0022810 002 1	SENT TO LITHIS FOR TRANSMISSION REPLACEMENT	EROBINSON Mar 13, 2019
UAF20-0007850 001 1	TIMECARD:709613 ITEM:3 REPLACE BATTERY AIR TIRES UP PUT PLASTIC TRIM BACK ON ABS LIGHT WENT OFF	TRBEASLEY Nov 15, 2019

Aug 14, 2025 10:37 AM

UAF Facilities Services PM Asset Notes Log

For Asset:
E4189

WO/Ph/Seq	Notes	
UAF20-0012384 001 1	TIMECARD:710018 ITEM:5 ROTATE TIRES	TRBEASLEY Nov 20, 2019
UAF20-0012384 001 2	TIMECARD:713705 ITEM:2 BEGIN DIAGNOSIS OF COOLANT LEAK. ORDER REPLACEMENT HOSES FROM HEATER TO ENGINE.	CPLOWMAN Dec 20, 2019
UAF20-0012384 001 3	TIMECARD:714681 ITEM:3 REMOVE HEATER LINES. FABRICATE TEST ADAPTER TEST STEEL HEATER LINES FOR POSSIBLE LEAK.. NONE DETECTED. BEGIN REPLACEMENT OF LEAKING HEATER LINES	CPLOWMAN Jan 3, 2020
UAF20-0012384 001 4	TIMECARD:714882 ITEM:3 CONTINUE COOLANT LEAK REPAIR	CPLOWMAN Jan 6, 2020
UAF20-0012384 001 5	TIMECARD:715364 ITEM:3 REPAIR COOLANT LEAK FROM HEATER LINES. FABRICATE REPLACEMENT LINES DUE TO CROSSOVER PIPES BEING MODIFIED. FILL PURGE COOLING SYSTEM. LEFT HEAD LIGHT INTERMITTENTLY OPERATING. DIAGNOSE FOUND CONNECTOR DAMAGED. ORDERED PARTS	CPLOWMAN Jan 7, 2020
UAF20-0012384 001 6	TIMECARD:715962 ITEM:3 REPLACE DRIVERS HEAD LIGHT SOCKET AND BULB. VERIFY OPERATION.	CPLOWMAN Jan 14, 2020
UAF20-0012384 001 7	TIMECARD:725405 ITEM:3 DIAGNOSE POORLY FUNCTIONING HEATER, LOW OUTPUT. REPLACE POLLEN FILTERS. BEGIN DIAGNOSING ABS, TRACTION CONTROL LIGHTS ON. INTERMITTENT CONCERN AT THIS TIME. POSSIBLE LEFT FRONT SPEED SENSOR OR WIRING CONCERN. FOUND RIGHT CV AXLE BOOT DAMAGED. ORDERED PARTS	CPLOWMAN Mar 25, 2020
UAF20-0012384 001 8	TIMECARD:725740 ITEM:4 REPLACE DAMAGED RIGHT CV AXLE. REASSEMBLE ROAD TEST OK. CAN NOT DUPLICATE ABS TRACTION CONTROL CONCERN AT THIS TIME. ORDERED RIGHT TAIL LIGHT LENS.	CPLOWMAN Mar 27, 2020
UAF20-0012384 001 9	TIMECARD:727429 ITEM:2 REPLACE RIGHT TAIL LIGHT HOUSING. VERIFY REPAIRS NOW OK	CPLOWMAN Apr 9, 2020
UAF20-0012384 001 10	TIMECARD:738888 ITEM:2 HEATING ISSUE	TRBEASLEY Jul 28, 2020
UAF20-0012384 001 11	TIMECARD:748777 ITEM:4 REPLACED BAD TURN BULB, READ ABS CODE AND FOUND LEFT FRONT SENSOR ISSUE, DRAINED COOLANT TO MIX WITH WATER AND BLEED SYSYTEM OF AIR-CHRIS HELPED WITH THAT. STARTED REPLACING BRAKES	JSCANNON Nov 12, 2020
UAF20-0012384 001 12	TIMECARD:748861 ITEM:2 FINISHED 4 CORNER FULL BRAKE JOB. REPLACED BATTERY. POSITIVE TERMINAL CONNECTOR BROKE, REPLACED WITH NEW POST STUD ADAPTER, FINISHED WIRING UP NEW OIL PAN HEATER, DIAG ABS ISSUE, FOUND NO ISSUE. AFTER BATTERY REPLACE HAD TO RE LEARN TPMS SYSTEM. TOOK FOR TEST AFTER ALL REPAIRS DONE. NO FURTHER	JSCANNON Nov 13, 2020
UAF20-0014859 001 1	TIMECARD:713705 ITEM:3 52553MI PERFORM PMI-AIR, OIL. COOLANT LEAK. REFERENCE WO 20-12384	CPLOWMAN Dec 20, 2019

Aug 14, 2025 10:37 AM

UAF Facilities Services PM Asset Notes Log

For Asset:
E4189

WO/Ph/Seq	Notes	
UAF21-0007986 001 1	TIMECARD:748777 ITEM:3 PERFORMED PM. CHANGED ENGINE OIL, FILTER AND AIR FILTER. FOUND ABS LIGHT ON, RIGHT FRONT TURN INOP, BRAKES NEED REPLACED, COOLANT RATING TO HIGH AND BAD BATTERY	JSCANNON Nov 12, 2020
UAF21-0011288 001 1	TIMECARD:756645 ITEM:3 BROUGHT INSIDE, VIC WAS COLD, LET WARM UP. INSTALLED NEW BLOWER MOTOR FOR HVAC SYSTEM	JSCANNON Feb 11, 2021
UAF22-0006449 001 1	TIMECARD:780419 ITEM:1 EVERYTHING CHECKS OUT REPLACED THE HEAD LIGHTS BOTH SIDES, BACK UP ALARM WAS WORKING IN THE SHOP NOT SURE WHAT THE ISSUES IS, DONE	TRBEASLEY Dec 2, 2021
UAF22-0008258 001 1	TIMECARD:784603 ITEM:4 PM, 56374 MILES -60 COOLANT ONLY CHANGED THE OIL DUE TO ONLY 32 MILES PUT ON SINCE LAST PM. REPLACE BACK UP ALARM AND FUSES THAT WERE BLOWEN	TRBEASLEY Jan 26, 2022
UAF22-0017757 001 1	TOOK A LOOK AT IT AND IT WAS LOW OF FLUID SO TOPPED OFF STILL MAKING A LITTLE NOISE BUT IT IS DRIVE-ABLE TILL WE CAN GET THE PART ORDERED WITCH IS A POWER STEERING PUMP	TRBEASLEY Jul 11, 2022
UAF23-0002973 001 1	TIMECARD:807205 ITEM:3 DID NOT FIND ANY ISSUES DONE	TRBEASLEY Sep 27, 2022
UAF23-0004223 001 1	TIMECARD:807205 ITEM:2 REPLACE TIRES DONE	TRBEASLEY Sep 27, 2022
UAF23-0008590 001 1	TIMECARD:816122 ITEM:2 FULL PM 59078 MILES -60 COOLANT 1 CHIP IN FRONT WINDSHIELD DONE	TRBEASLEY Jan 3, 2023
UAF24-0004443 001 1	TIMECARD:837426 ITEM:2 61,502 MILES, PM SERVICE EXCHANGED: FLARES, FIRST-AID KIT, FIRE EXTINGUISHER, AIR FILTER, OIL & FILTER BRAKE PAD LIFE: FRONTS: ALL 4 = 8MM OF LIFE	JEMITCHELL3 Sep 25, 2023
UAF24-0008926 001 1	TIMECARD:845330 ITEM:1 BROUGHT VEHICLE IN AND FOUND HEADLIGHT CONNECTOR TO BE MELTED, ORDERED NEW PLUG FOR REPLACEMENT	JEMITCHELL3 Jan 5, 2024
UAF24-0008926 001 2	TIMECARD:845481 ITEM:2 ONCE NEW HEADLIGHT PIGTAIL ARRIVED, I TOOK IT AND REPLACED THE OLD PLUG DUE TO MELTED PLASTIC. AFTERWARDS I INSTALLED A NEW HEADLIGHT. VEHICLE'S HEADLIGHTS WORK GREAT NOW.	JEMITCHELL3 Jan 8, 2024
UAF24-0008949 001 1	TIMECARD:845330 ITEM:3 BROUGHT VEHICLE IN AND PERFORMED A PRESSURE TEST. FOUND THAT THE VEHICLE IS LEAKING COOLANT. WILL INSPECT FURTHER FIRST THING 01/08/24.	JEMITCHELL3 Jan 5, 2024
UAF24-0008949 001 2	TIMECARD:845481 ITEM:3 PURGED ALL AIR FROM COOLANT LINES, AND FILLED VEHICLE BACK UP WITH COOLANT. AFTER TESTING VEHICLE MADE PLENTY OF HEAT. SENT VEHICLE BACK TO CONTACT. COMPLETE	JEMITCHELL3 Jan 8, 2024

Aug 14, 2025 10:37 AM

UAF Facilities Services PM Asset Notes Log

For Asset:
E4189

WO/Ph/Seq	Notes	
UAF24-0008949 001 3	TIMECARD:845506 ITEM:8 ASSIST WITH DIRECTION ON PURGING COOLING SYSTEM.	CPLOWMAN Jan 9, 2024
UAF24-0012298 001 1	TIMECARD:858578 ITEM:2 WENT TO BRING THE VEHICLE IN AND FOUND IT HAD NO POWER TO IT. WAS UNABLE TO GET THE VEHICLE GOING WITH A JUMP PACK, SO I ORDERED AND INSTALLED A NEW BATTERY. WAS UNAWARE OF THE WORK ORDER, SO I AM CURRENTLY AWAITING A POWER-STEERING PUMP TO GO INTO THE VEHICLE.	JEMITCHELL3 Jun 14, 2024
UAF24-0012298 001 2	TIMECARD:862258 ITEM:1 REPLACED POWER STEERING PUMP AND ROAD TESTED AND COMPLETED	JDSTAMEY Jul 11, 2024
UAF24-0012298 001 3	TIMECARD:862725 ITEM:2 REPLACED PUMP RETURNED CORE AND REMAN PUMP INSTALLED IS FAULTY SO I ORDERED A NEW PUMP	JDSTAMEY Jul 17, 2024
UAF24-0012298 001 4	TIMECARD:863475 ITEM:6 ASSIST WITH P/S DIAG	CPLOWMAN Jul 25, 2024
UAF24-0012298 001 5	TIMECARD:863506 ITEM:1 REMOVING BAD POWER STEERING PUMP FOR A 2ND TIME	JDSTAMEY Jul 25, 2024
UAF24-0012298 001 6	TIMECARD:863839 ITEM:4 REPLACED FAULTY REMAN PUMP WITH NEW POWER STEERING PUMP	JDSTAMEY Jul 30, 2024
UAF24-0012298 001 7	REPLACED POWER STEERING PUMP DRIVES FINE POSSIBLE FOLLOW UP ON RACK AND PINION ISSUE	JDSTAMEY Jul 31, 2024
UAF25-0002730 001 1	VEHICLE IS SCHEDULED AT SIMARD AUTOMOTIVE S CUSHMAN 8/12 FOR RACK AND PINION REPLACEMENT. SO 250472	SLBOONEGRANT Aug 8, 2024
UAF25-0002730 001 2	VEHICLE READY FOR PICKUP	SLBOONEGRANT Aug 26, 2024
UAF25-0004462 001 1	TIMECARD:874707 ITEM:4 BROUGHT THE VEHICLE IN AND BEGAN PERFORMING PM. IS CURRENTLY UNFINISHED AS OF THE END OF THE DAY, WILL COMPLETE FIRST THING IN THE MORNING.	JEMITCHELL3 Dec 2, 2024
UAF25-0004462 001 2	TIMECARD:874796 ITEM:1 FINISHED WHEN I CAME IN: 63,105 MILES	JEMITCHELL3 Dec 3, 2024
UAF25-0009202 001 1	EXCHANGED AIR FILTER ON A FILTER TIMECARD:874654 ITEM:1 REPLACE BOTH WIPERS DONE	TRBEASLEY Dec 2, 2024

Aug 14, 2025 10:37 AM

UAF Facilities Services PM Asset Notes Log

For Asset:
E4189

WO/Ph/Seq	Notes	
UAF25-0010350 001 1	TIMECARD:876118 ITEM:3 CHECKED THE ENGINE LIGHT, AND FOUND A MYRIAD OF CODES. BUT WHAT GOT MY ATTENTION WAS A CODE FOR THE CAMSHAFT POSITION SENSOR, AS WELL AS WHEEL SPEED SENSOR CODES FOR 3 WHEELS.	JEMITCHELL3 Dec 16, 2024
UAF25-0010350 001 2	TIMECARD:877142 ITEM:1 BROUGHT THE VAN IN AND REMOVED THE BELT AND POWER STEERING PUMP TO GET TO THE CAMSHAFT POSITION SENSOR. AFTER REPLACING IT, I REMOVED ALL 4 WHEELS, CALIPERS, BRACKETS, AND ROTORS TO REPLACE THE HUBS WITHIN THE VEHICLE. FOUND THAT A NEW CODE APPEARED WHEN POST-FIX TESTING. "P0010: CAMSHAFT POSITION ACTUATOR SOLENOID CIRCUIT POWER CONCERN"	JEMITCHELL3 Jan 2, 2025
UAF25-0010350 001 3	TIMECARD:877177 ITEM:5 ASSIST WITH DIAGNOSTICS	CPLOWMAN Jan 3, 2025
UAF25-0010350 001 4	TIMECARD:877246 ITEM:2 WHEN I CAME IN, I PERFORMED CIRCUIT TESTS TO ENSURE THE CAMSHAFT POSITION ACTUATOR SOLENOID WASN'T FAILING AND CAUSING ISSUES. AFTER TESTING THE CIRCUIT USING THE SCAN TOOL, AND TESTING RESISTANCE WITH A MULTIMETER, WE WERE UNABLE TO FIND ANY ISSUES UNTIL CHRIS PERFORMED A TEST THAT FOUND THE WIRE TO	JEMITCHELL3 Jan 3, 2025
UAF25-0010350 001 5	TIMECARD:877268 ITEM:3 TRAIN TECH WHILE ASSISTING WITH DIAGNOSIS OF CHECK ENGINE LIGHT. PERFORMED MULTIPLE PINPOINT TESTS. FOUND CAM ACTUATOR HARNESS DAMAGED FROM BELT/ PULLEY WEAR DUE TO BROKEN/IMPROPER MOUNTING OF HARNESS ROUTING SUPPORT BRACKET. ADVISED TECH TO ORDER REPLACEMENT PIGTAIL HARNESS.	CPLOWMAN Jan 6, 2025
UAF25-0010350 001 6	TIMECARD:883528 ITEM:3 CAM ACTUATOR HARNESS WAS DAMAGED SO AFTER I PRESSURE WASHED IT I COULD GET TO THE WIRES AND GET IT ALL CLEANED UP SO I COULD REPLACE THE CONNECTOR DONE	TRBEASLEY Feb 23, 2025
UAF25-0012472 001 1	TIMECARD:881785 ITEM:4 BROUGHT THE VAN IN TO INSPECT THE POWER STEERING LEAK. DUE TO ISSUES, THE VEHICLE'S SHOP LEAD TOLD ME TO BRING THE VEHICLE OUT OF THE SHOP AND DELIVER IT BACK. WAS UNABLE TO DISCOVER SOURCE OF THE LEAK.	JEMITCHELL3 Feb 4, 2025
UAF25-0012472 001 2	TIMECARD:882833 ITEM:9 ASSIST WITH DIAG	CPLOWMAN Feb 14, 2025
UAF25-0012472 001 3	TIMECARD:883525 ITEM:3 SO THIS ADDITIONALLY WAS A CONCERN ABOUT A POWER STEERING LEAK BUT I DO NOT THINK IT IS THAT	TRBEASLEY Feb 23, 2025
UAF25-0012472 001 4	TIMECARD:883526 ITEM:2 SO IT HAS A DECENT OIL LEAK COMING FROM SOME WHERE WILL HAVE TO PRESSURE WASH IT TO SEE IF IT CAN BE LOCATED	TRBEASLEY Feb 23, 2025
UAF25-0012472 001 5	TIMECARD:883528 ITEM:2 PRESSURE WASH SO THE OIL LEAK COULD BE LOCATED WITCH WAS THE CRANK SHAFT SEAL.STARTED ON REPLACING IT DID NOT GET IT ALL DONE	TRBEASLEY Feb 23, 2025
UAF25-0012472 001 6	TIMECARD:883529 ITEM:1 FINISH UP WITH SEAL INSTALL AND TEST RUN IT	TRBEASLEY Feb 23, 2025
UAF25-0012472 001 7	TIMECARD:883530 ITEM:6 ALSO REDONE THE WINTER PLUG IN	TRBEASLEY Feb 23, 2025

Aug 14, 2025 10:37 AM

UAF Facilities Services PM Asset Notes Log

For Asset:
E4189

WO/Ph/Seq	Notes	
UAF25-0014493 001 1	TIMECARD:886963 ITEM:4 THE RACK AND PINION HAD BEEN REPLACED SOME TIME AGO AT SIMNARDS BUT IT IS LEAKING ON THE DRIVER SIDE AT THE BOOT WILL BE GOING BACK FOR WARRANTY WORK AND TO REPLACE A LINE I THINK ITS A POWER STEERING LINE FROM THE PUMP	TRBEASLEY Mar 27, 2025
UAF25-0014493 001 2	TIMECARD:886965 ITEM:3 CLEANED UP SOME TO MAKE SURE THE LEAK IS COMING FROM THE PLACE I THINK IT IS AND IT WAS THIS WILL BE GOING OUT TO VENDOR	TRBEASLEY Mar 27, 2025
UAF25-0014493 001 3	TIMECARD:887488 ITEM:4 AFTER CLEANING UP ALL THE OIL I ADDED FLUIDS THEN TEST RUN ONLY TO FIND THAT THE RACK AND PINION ID LEAKING AT THE SEAL INSIDE THE BOOT THERE IS ALSO A LEAK ON A POWER STEERING LINE NOT SURE WITCH ONE BUT IT IS MARKED WITH SOME PINK RIBBON I BELIEVE THIS WILL BE GOING BACK TO SIMNARDS FOR WARRANTY WORK	TRBEASLEY Apr 3, 2025
UAF25-0014493 001 4	TIMECARD:887488 ITEM:12 PULLED OUT OF SHOP AND PARKED IT ON THE RAIL	TRBEASLEY Apr 3, 2025
UAF25-0014493 001 5	THIS MAY BE GOING TO SURPLUS	TRBEASLEY Apr 10, 2025
UAF25-0014493 001 6	VEHICLE IS BEING SURPLUSED, NO MORE WORK TO VEHICLE.	SLBOONEGRANT Jun 2, 2025
UAF25-0018257 001 1	JAMES COMPLETED PREP FOR SURPLUS 5/6/25. HIS TIME CARD HAS BEEN UPDATED. VEHICLE IS BEING SCHEDULED FOR TOW 8/14/25	SLBOONEGRANT Aug 13, 2025