

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF16-0015134 001 1	TIMECARD:522968 ITEM:2 Steam clean, diagnose engine oil leak order parts	FDALRYMPLE Dec 8, 2015
UAF16-0015134 001 2	TIMECARD:523463 ITEM:1 Install fan belt	FDALRYMPLE Dec 11, 2015
UAF16-0015134 001 3	TIMECARD:523928 ITEM:1 Repair oil leak, install belt	FDALRYMPLE Dec 15, 2015
UAF16-0015134 001 4	TIMECARD:530054 ITEM:1 Replace mud flap hangers, replace broken grease lines, order hyd hoses	FDALRYMPLE Jan 26, 2016
UAF16-0015134 001 5	TIMECARD:530284 ITEM:1 Replace leaking hydraulic hoses	FDALRYMPLE Jan 27, 2016
UAF16-0015134 001 6	TIMECARD:531037 ITEM:5 Clean engine, check for oil leak	FDALRYMPLE Feb 1, 2016
UAF16-0021694 001 1	TIMECARD:537680 ITEM:2 PM 137178 MILES 13289 HOURS	FDALRYMPLE Mar 15, 2016
UAF16-0021694 001 2	TIMECARD:537838 ITEM:1 CHECK BACK UP CAMERA	FDALRYMPLE Mar 16, 2016
UAF16-0025932 001 1	TIMECARD:542393 ITEM:2 REPLACE PTO SHAFT YOLK	FDALRYMPLE Apr 15, 2016
UAF16-0026656 001 1	TIMECARD:545178 ITEM:3 REPLACE AIRFILTER ASSY FOR PACKER FUNCTIONS	FDALRYMPLE May 4, 2016
UAF16-0027152 001 1	TIMECARD:544963 ITEM:3 REPAIR PACKER	FDALRYMPLE May 3, 2016
UAF16-0027152 001 2	TIMECARD:546508 ITEM:3 PACKER INOP	FDALRYMPLE May 12, 2016
UAF16-0028401 001 1	TIMECARD:546661 ITEM:1 REPAIR STEERING LEAK	FDALRYMPLE May 13, 2016

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF16-0030749 001 1	TIMECARD:551613 ITEM:3 REPAIR HOPPER COVER	FDALRYMPLE Jun 17, 2016
UAF16-0030749 001 2	TIMECARD:552010 ITEM:2 COMPLETE AUTO CHAIN INSTALLATION	FDALRYMPLE Jun 21, 2016
UAF16-0031114 001 1	PER ED ROBINSON, COMPLETED BY CONTRACTOR ON SITE.	MLSKANIS2 Feb 15, 2017
UAF16-0031440 001 1	TIMECARD:557419 ITEM:2 REPLACE R/SIDE WIPER MOTOR ASSEMBLY	FDALRYMPLE Aug 1, 2016
UAF16-0031440 001 2	TIMECARD:557567 ITEM:2 REPLACE L/SIDE WIPER MOTOR AND WASHER NOZZLE	FDALRYMPLE Aug 2, 2016
UAF17-0000677 001 1	TIMECARD:553844 ITEM:1 REPLACE BLOWN HYDRAULIC HOSE	FDALRYMPLE Jul 6, 2016
UAF17-0000677 001 2	TIMECARD:554581 ITEM:3 DIAGNOSE HOPPER MARKER LIGHTS-GROUNDED WIRE IN BODY	FDALRYMPLE Jul 12, 2016
UAF17-0000677 001 3	TIMECARD:554957 ITEM:4 TROUBLESHOOT HOPPER MARKER LIGHTS	FDALRYMPLE Jul 14, 2016
UAF17-0001208 001 1	TIMECARD:556095 ITEM:4 TRACE HOPPER LIGHT WIRING	FDALRYMPLE Jul 22, 2016
UAF17-0001208 001 2	TIMECARD:557707 ITEM:2 REWIRE HOPPER WIRE MARKER LIGHT WIRE	FDALRYMPLE Aug 3, 2016
UAF17-0001208 001 3	TIMECARD:558259 ITEM:3 CHECK WIRING FROM CAB TO HOPPER. DELIVER TO YUKON EQUIP FOR PACKER REPAIR	FDALRYMPLE Aug 9, 2016
UAF17-0001208 001 4	TIMECARD:563646 ITEM:2 CHECK WIRING IN HOPPER BODY FOR SHORT	FDALRYMPLE Sep 14, 2016
UAF17-0001208 001 5	TIMECARD:563769 ITEM:2 REPAIR PASSENGER SIDE WIPER, CHECK MARKER LIGHT WIRING FROM CAB TO BACK OF TRUCK	FDALRYMPLE Sep 15, 2016

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF17-0001208 001 6	TIMECARD:563872 ITEM:2 REWIRE MARKER LIGHTS IN HOPPER	FDALRYMPLE Sep 16, 2016
UAF17-0001208 001 7	TIMECARD:566095 ITEM:3 CHECK MARKER LIGHTS, TAKE TO WESTERN PETERBELT FOR REPAIR	FDALRYMPLE Oct 3, 2016
UAF17-0001208 001 8	TIMECARD:566892 ITEM:3 REPLACE PACKER AUX LIGHT	FDALRYMPLE Oct 7, 2016
UAF17-0002399 001 1	TIMECARD:556860 ITEM:3 DIAGNOSE PACKER SYSTEM, MAKE TEMPORARY REPAIRS, ORDER PARTS	FDALRYMPLE Jul 29, 2016
UAF17-0002399 001 2	TIMECARD:557707 ITEM:3 CHECK PACKER OPERATION	FDALRYMPLE Aug 3, 2016
UAF17-0002399 001 3	TIMECARD:557832 ITEM:2 CLEAN AND PREP DIFFERENTIAL FOR THRU-SHAFT, DRAIN FLUID, REPLACE FILTER	FDALRYMPLE Aug 4, 2016
UAF17-0002399 001 4	TIMECARD:558006 ITEM:2 REINSTALL DIFFERENTIAL THRU-SHAFT, DIAGNOSE PACKER SYSTEM	FDALRYMPLE Aug 5, 2016
UAF17-0002399 001 5	TIMECARD:559995 ITEM:3 REPAIR PACKER	FDALRYMPLE Aug 19, 2016
UAF17-0002399 001 6	TIMECARD:560510 ITEM:2 REPAIR PACKER SOLENOID WIRES	FDALRYMPLE Aug 24, 2016
UAF17-0002399 001 7	TIMECARD:561334 ITEM:4 REPAIR PACKER	FDALRYMPLE Aug 30, 2016
UAF17-0002399 001 8	TIMECARD:563094 ITEM:4 REPAIR PACKER SYSTEM	FDALRYMPLE Sep 9, 2016
UAF17-0002399 001 9	TIMECARD:566465 ITEM:3 CHANGE SOLENOID BOX	FDALRYMPLE Oct 6, 2016
UAF17-0002399 001 10	TIMECARD:566892 ITEM:4 REINSTALL OLD SOLENOID CONTROL BOX	FDALRYMPLE Oct 7, 2016

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF17-0002399 001 11	TIMECARD:570368 ITEM:1 REPLACE CONTROL BOX FOR PACKER OPERATION	FDALRYMPLE Nov 1, 2016
UAF17-0005887 001 1	TIMECARD:562117 ITEM:4 REPLACE AIR DRIER ASSY	FDALRYMPLE Sep 6, 2016
UAF17-0011988 001 1	COMPLETE	CSMITH Mar 13, 2017
UAF17-0016676 001 1	REPLACED BY GLASS DOCTOR.	CSMITH Jan 26, 2017
UAF17-0017799 001 1	TIMECARD:582868 ITEM:1 REPAIR AIR LEAK, REPLACE SERPENTINE BELT AND TENSIONER, DIAGNOSE HEATER	FDALRYMPLE Feb 8, 2017
UAF17-0017799 001 2	TIMECARD:583022 ITEM:1 REPAIR HEATER TO WORK ON ALL SPEEDS	FDALRYMPLE Feb 9, 2017
UAF17-0017799 001 3	TIMECARD:599860 ITEM:1 REPLACE HEATER MOTOR	FDALRYMPLE Jun 19, 2017
UAF17-0017799 001 4	TIMECARD:599999 ITEM:3 REPAIR AUTO GREASE LINE, REPLACE R/HEADLIGHT, REPAIR WIRING UNDER FRONT OF CAB	FDALRYMPLE Jun 20, 2017
UAF17-0018408 001 1	TIMECARD:595304 ITEM:6 START PM 149078 MILES 14312 HOURS	FDALRYMPLE May 15, 2017
UAF17-0018408 001 2	TIMECARD:595423 ITEM:2 FINISH PM, CHECK HEATER MOTOR, DIAGNOSE PASSENGER WIPER, ORDER REPAIR PARTS	FDALRYMPLE May 16, 2017
UAF17-0018408 001 3	TIMECARD:596847 ITEM:2 REPLACE AIR VALVE FOR R/SIDE WIPER MOTOR	FDALRYMPLE May 26, 2017
UAF17-0018448 001 1	TIMECARD:583829 ITEM:3 ASSIST WITH TIRE REPAIR	FDALRYMPLE Feb 16, 2017
UAF17-0023329 001 1	TIMECARD:590325 ITEM:1 AIR R/FRONT TIRE	FDALRYMPLE Apr 5, 2017

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF17-0027533 001 1	TIMECARD:596349 ITEM:3 DIAGNOSE INOP HYDRAULIC SYSTER	FDALRYMPLE May 23, 2017
UAF17-0027533 001 2	TIMECARD:596632 ITEM:2 REPAIR BROKEN WIRE IN HARNESS FOR PUMP ENGAGE	FDALRYMPLE May 25, 2017
UAF18-0002364 001 1	TIMECARD:605469 ITEM:3 WONT START, DIAGNOSE ELECTRICAL SYS, TEMP REPAIR TO MASTER SWITCH-ORDER NEW SWITCH. REPLACE R/TURN LIGHT BULB	FDALRYMPLE Jul 31, 2017
UAF18-0002364 001 2	TIMECARD:605741 ITEM:2 REPLACE MASTER SWITCH, CHECK ALL HEATERS, REPLACE TRICKLE CHARGER	FDALRYMPLE Aug 1, 2017
UAF18-0007234 001 1	TIMECARD:611863 ITEM:5 INSPECT FOUND COOLANT SLIGHTLY LOW. TOPPED OFF. VERIFY HEATER BLOWER INOP. BEGIN DIAGNOSIS	CPLOWMAN Sep 18, 2017
UAF18-0007234 001 2	TIMECARD:611864 ITEM:1 CONTINUE DIAGNOSIS, FOUND FUSE BLOWN. TEST BLOWER SYSTEM. BLOWER DRAWING 10-15 AMPS. REPLACE FUSE ROAD TEST HEATER OPERATING NORMALLY AT THIS TIME.	CPLOWMAN Sep 18, 2017
UAF18-0007234 001 3	TIMECARD:615717 ITEM:1 REMOVE THERMOSTAT	FDALRYMPLE Oct 16, 2017
UAF18-0007234 001 4	TIMECARD:615830 ITEM:1 INSTALL NEW THERMOSTATS	FDALRYMPLE Oct 17, 2017
UAF18-0008662 001 1	TIMECARD:613924 ITEM:1 CHECK COOLING SYSTEM, ORDER REPAIR PARTS	FDALRYMPLE Oct 3, 2017
UAF18-0009018 001 1	TIMECARD:615830 ITEM:2 PM 152178 MILES 14561 HOURS	FDALRYMPLE Oct 17, 2017
UAF18-0009018 001 2	TIMECARD:617074 ITEM:2 REPAIR HYDRAULIC LEAKS	FDALRYMPLE Oct 24, 2017
UAF18-0009654 001 1	TIMECARD:615717 ITEM:2 REPAIR PASSENGER SIDE DEFROST FAN, REPLACE HOPPER LIGHT WITH LED	FDALRYMPLE Oct 16, 2017
UAF18-0015083 001 1	TIMECARD:625700 ITEM:5 CHECK PACKER OPERATION, ADJUST MICRO SWITCH FOR CORRECT AMOUNT OF TRAVEL	FDALRYMPLE Jan 4, 2018

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF18-0016969 001 1	TIMECARD:628211 ITEM:3 REPLACE LEAKING POWER STEERING HOSE	FDALRYMPLE Jan 25, 2018
UAF19-0001734 001 1	TIMECARD:651265 ITEM:1 REPAIR TAILGATE LATCH, REPAIR GROUNDED MARKER LIGHT WIRE	FDALRYMPLE Jul 17, 2018
UAF19-0001734 001 2	TIMECARD:651623 ITEM:2 REPAIR GREASE LINE AND HINGE PIN ON TOP RIGHT SIDE OF HOPPER	FDALRYMPLE Jul 19, 2018
UAF19-0001734 001 3	TIMECARD:653491 ITEM:2 REPAIR BROKEN WIRE IN HARNESS IN HOPPER DOOR	FDALRYMPLE Aug 2, 2018
UAF19-0006643 001 1	TIMECARD:658601 ITEM:2 VERIFY HEATER MOTOR INOPERATIVE. DIAGNOSE FOUND HEATER FUSE BLOWN. REPLACE FUSE HEATER OPERATING AT THIS TIME.	CPLOWMAN Sep 11, 2018
UAF19-0007664 001 1	TIMECARD:659026 ITEM:5 INSPECT VERIFY HYDRAULIC LEAK FROM LINE TO BULK HEAD FITTING AREA ON RIGHT REAR OF BOX FEEDING REAR DOOR. CLEAN UP OIL ON GROUND FROM LOCATING TEST.	CPLOWMAN Sep 14, 2018
UAF19-0007664 001 2	TIMECARD:659216 ITEM:2 REMOVE RIGHT STEEL HYDRAULIC LINES FOR REAR DOOR. INSTALL TEMPORARY LINES UNTIL REPLACEMENT LINES CAN BE ORDERED AND REPLACED.	CPLOWMAN Sep 17, 2018
UAF19-0007664 001 3	TIMECARD:659719 ITEM:2 RESEARCH CORRECT LINES TO REPAIR TEMP FIX	FDALRYMPLE Sep 20, 2018
UAF19-0007664 001 4	TIMECARD:676531 ITEM:1 CHECK FOR HYDRAULIC LEAK	FDALRYMPLE Feb 8, 2019
UAF19-0009849 001 1	TIMECARD:661292 ITEM:1 REAR BRAKES	FDALRYMPLE Oct 2, 2018
UAF19-0009849 001 2	TIMECARD:661353 ITEM:1 REPLACE REAR AXLE BRAKES	FDALRYMPLE Oct 2, 2018
UAF19-0009849 001 3	TIMECARD:661486 ITEM:2 CHECK BRAKES FOR OVERHEAT CONDITION, ADJUST ALL BRAKES	FDALRYMPLE Oct 3, 2018
UAF19-0009849 001 4	TIMECARD:662462 ITEM:3 COMPLETE REAR BRAKE INSTALLATION	FDALRYMPLE Oct 10, 2018

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF19-0010022 001 1	TIMECARD:662462 ITEM:2 COMPLETE PM 160351 MILES 15346 HOURS	FDALRYMPLE Oct 10, 2018
UAF19-0010362 001 1	TIMECARD:662462 ITEM:1 INSTALL NEW BATTERIES	FDALRYMPLE Oct 10, 2018
UAF19-0013023 001 1	TIMECARD:666581 ITEM:3 REPLACE DRIVERS WIPER BLADE, ORDER SECOND BLADE FOR PASSENGER SIDE	FDALRYMPLE Nov 12, 2018
UAF19-0013023 001 2	TIMECARD:666867 ITEM:1 REPLACE PASSENGER SIDE WIPER BLADE	FDALRYMPLE Nov 14, 2018
UAF19-0016016 001 1	TIMECARD:670852 ITEM:2 REPAIR PACKER	FDALRYMPLE Dec 17, 2018
UAF19-0018016 001 1	TIMECARD:676906 ITEM:1 REMOVE LEAKING HYDRAULIC LINES, ORDER REPLACEMENT HOSES	FDALRYMPLE Feb 11, 2019
UAF19-0018016 001 2	TIMECARD:677035 ITEM:3 INSTALL NEW HYDRAULIC HOSES FOR TOP DOOR	FDALRYMPLE Feb 12, 2019
UAF19-0018967 001 1	TIMECARD:674672 ITEM:1 SERVICE CALL, PREP TRUCK FOR TRIP TO SHOP FOR REPAIR	FDALRYMPLE Jan 24, 2019
UAF19-0018967 001 2	TIMECARD:675248 ITEM:3 INSTALL STEERING ASSIST CYLINDER	FDALRYMPLE Jan 29, 2019
UAF19-0019575 001 1	TIMECARD:676037 ITEM:4 DIAGNOSE HEATER, ORDER PARTS	FDALRYMPLE Feb 4, 2019
UAF19-0019575 001 2	TIMECARD:677144 ITEM:1 REPLACE HEATER BLOWER RESISTER AND BLOWER MOTOR SPEED SWITCH	FDALRYMPLE Feb 13, 2019
UAF19-0020644 001 1	TIMECARD:679432 ITEM:2 START PM 163706 MILES 15696 HOURS	FDALRYMPLE Mar 5, 2019
UAF19-0020644 001 2	TIMECARD:679590 ITEM:3 FINISH PM	FDALRYMPLE Mar 6, 2019

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF19-0027713 001 1	TIMECARD:684955 ITEM:1 DIAGNOSE INOP INDICATOR LIGHTS ON PANEL	FDALRYMPLE Apr 16, 2019
UAF19-0030485 001 1	TIMECARD:693649 ITEM:1 CHECK FRONT BRAKES	FDALRYMPLE Jun 27, 2019
UAF19-0031827 001 1	TIMECARD:693650 ITEM:2 PM	FDALRYMPLE Jun 27, 2019
UAF19-0031951 001 1	TIMECARD:696344 ITEM:1 REPLACE STUDS ON RIGHT FRONT HUB	FDALRYMPLE Jul 19, 2019
UAF19-0031951 001 2	TIMECARD:696348 ITEM:2 REPLACE WHEELS STUDS, INSTALL NEW WHEELS AND TIRES	FDALRYMPLE Jul 19, 2019
UAF20-0001674 001 1	TIMECARD:696341 ITEM:2 REMOVE FRONT WHEELS AND TIRES FOR REPLACEMENT	FDALRYMPLE Jul 19, 2019
UAF20-0003973 001 1	TIMECARD:702147 ITEM:1 DIAGNOSE INOP PACKER	FDALRYMPLE Sep 10, 2019
UAF20-0003973 001 2	TIMECARD:702306 ITEM:2 DIAGNOSE INOP PACKER, TAKE TO DEALER FOR REPAIR	FDALRYMPLE Sep 12, 2019
UAF20-0006606 001 1	TIMECARD:702920 ITEM:2 REPLACE L/HEADLIGHT, REPLACE L/REAR TURN LIGHT BULB	FDALRYMPLE Sep 18, 2019
UAF20-0006606 001 2	TIMECARD:704475 ITEM:1 PM 168127 MILES 16074 HOURS	FDALRYMPLE Oct 1, 2019
UAF20-0006606 001 3	TIMECARD:704796 ITEM:4 REPLACE R/MUDFLAP BRACKET	FDALRYMPLE Oct 4, 2019
UAF20-0009567 001 1	TIMECARD:707572 ITEM:4 CHECK BACK UP CAMERA	FDALRYMPLE Oct 29, 2019
UAF20-0014179 001 1	TIMECARD:711841 ITEM:2 REPLACE BLOWN POWER STEERING HOSE	FDALRYMPLE Dec 5, 2019

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF20-0014179 001 2	TIMECARD:712196 ITEM:2 DIAGNOSE HYDRAULIC LEAK, RESEARCH AND ORDER NEW PART, CLEAN CONTROL VALVE FOR DISASSEMBLY	FDALRYMPLE Dec 9, 2019
UAF20-0014179 001 3	TIMECARD:712708 ITEM:1 REPLACE CONTROL VALVE PUMP INLET HOUSING	FDALRYMPLE Dec 12, 2019
UAF20-0014179 001 4	TIMECARD:713677 ITEM:5 STRAIGHTEN TOP CROSS MEMBER ON HOPPER	FDALRYMPLE Dec 20, 2019
UAF20-0014179 001 5	TIMECARD:715007 ITEM:1 DIAGNOSE INOP L/LOW BEAM HEADLIGHT	FDALRYMPLE Jan 6, 2020
UAF20-0014179 001 6	TIMECARD:715325 ITEM:2 REPAIR WIRING TO L/HEADLIGHT, CLEAN CABIN FILTER, TOP OFF ANTIFREEZE	FDALRYMPLE Jan 7, 2020
UAF20-0014179 001 7	TIMECARD:717386 ITEM:1 CHECK FOR HYDRAULIC LEAK, REMOVE R/REAR OUTER TIRE FOR REPAIR	FDALRYMPLE Jan 22, 2020
UAF20-0014179 001 8	TIMECARD:717712 ITEM:3 INSTALL R/REAR OUTER TIRE	FDALRYMPLE Jan 23, 2020
UAF20-0014179 001 9	TIMECARD:719556 ITEM:2 REPLACE HEADLIGHT RELAYS	FDALRYMPLE Feb 5, 2020
UAF20-0014179 001 10	TIMECARD:721088 ITEM:2 REMOVE REAR PINION SEAL FOR SAMPLE	FDALRYMPLE Feb 18, 2020
UAF20-0014179 001 11	TIMECARD:721352 ITEM:1 REPLACE THRU SHAFT OUTPUT SEAL AND REAR DIFF PINION SEAL	FDALRYMPLE Feb 20, 2020
UAF20-0014179 001 12	TIMECARD:721502 ITEM:1 COMPLETE DUMP BOX CONVERSION	FDALRYMPLE Feb 21, 2020
UAF20-0014179 001 13	TIMECARD:723138 ITEM:3 PURGE AIR TANKS, ADD AIR SYSTEM ANTI FREEZE/CONDITIONER TO SYSTEM	FDALRYMPLE Mar 5, 2020
UAF20-0014179 001 14	TIMECARD:724934 ITEM:2 REMOVE R/REAR WHEEL, CLEAN PARTS FOR SEAL REPLACEMENT	FDALRYMPLE Mar 23, 2020

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF20-0014179 001 15	TIMECARD:725195 ITEM:2 INSTALL NEW WHEEL SEAL, REASSEMBLE REAR AXLE, REPLACE R/REAR BRAKE CANISTER	FDALRYMPLE Mar 24, 2020
UAF20-0014179 001 16	TIMECARD:727263 ITEM:1 REMOVE BROKEN WHEEL STUDS IN L/FRONT HUB	FDALRYMPLE Apr 8, 2020
UAF20-0014179 001 17	TIMECARD:727486 ITEM:2 INSTALL NEW WHEEL STUDS IN L/FRONT HUB	FDALRYMPLE Apr 9, 2020
UAF20-0014179 001 18	TIMECARD:730142 ITEM:2 RECHECK LEFT FRONT LUG NUT TORQUE TO 500FTLB. REPLACE RIGHT FRONT TURN SIGNAL BULB	CPLOWMAN Apr 30, 2020
UAF20-0014179 001 19	TIMECARD:746218 ITEM:4 BEGIN DIAGNOSIS OF INTERMITTENT FAILURE TO EJECT. LOCATE WIRE DIAGRAM. LOCATE ARM/TAIL GATE LOCK OUT RELAY BOX. LOCATE GATE OPEN SWITCH AND TEST OPERATION. BEGIN LOOKING FOR POSSIBLE INTERMITTENT SHORT OR OPEN CIRCUIT IN WIRING.	CPLOWMAN Oct 15, 2020
UAF20-0014179 001 20	TIMECARD:746252 ITEM:3 DIAGNOSE INTERMITTENT FAILURE TO EJECT. FOUND GATE LATCH SWITCH CONNECTOR IN BODY WITH MULTIPLE LOOSE TERMINALS CAUSING INTERMITTENT CONNECTION ISSUE. RESECURE TERMINALS IN CONNECTOR HOUSING VERIFYING PROPER CONNECTION. REASSEMBLE RELAY BOX, SECURE ALL WIRING. ORDER REPLACEMENT REVERSE WORK	CPLOWMAN Oct 15, 2020
UAF20-0014179 002 1	TIMECARD:722011 ITEM:1 CLEANED UP DRIVE LINE PARTS	DGPODVIN Feb 25, 2020
UAF20-0014179 002 2	TIMECARD:722794 ITEM:2 THAW TRUCK OUT , RIGHT BOX LIFT RAM WAS FULL OF WATER AND FROZEN AND LEFT SIDE PIN WAS RUSTED IN. ORDERED NEW PTO GASKET .	DGPODVIN Mar 3, 2020
UAF20-0014179 002 3	TIMECARD:722799 ITEM:1 STEAM CLEAN UNDER SIDE OF TRUCK. LOTS OF HOSES AND WIRES WILL HAVE TO BE REMOVED TO CHANGE PTO GASKET. SO I PUT IT BACK TOGETHER SO JAMIE COULD DO TRASH.	DGPODVIN Mar 3, 2020
UAF21-0004074 001 1	THIS WORK ORDER WAS GENERATED UNINTENTIONALLY DURING THE SETUP OF THE FIRE APPARATUS AND HEAVY EQUIPMENT PMI SYSTEM AND WAS CANCELED BY ERHIX ON 8/24/20.	ERHIX Aug 24, 2020
UAF21-0004087 001 1	THIS WORK ORDER WAS GENERATED UNINTENTIONALLY DURING THE SETUP OF THE FIRE APPARATUS AND HEAVY EQUIPMENT PMI SYSTEM AND WAS CANCELED BY ERHIX ON 8/24/20.	ERHIX Aug 24, 2020
UAF21-0005075 001 1	FILTERS WERE PURCHASED BUT WORK NEVER COMPLETED, I AM CLOSING THIS AS WE HAVE A NEW PM	DEDSON Feb 5, 2021
UAF21-0010355 001 1	TIMECARD:756506 ITEM:6 PULL IN TO SHOP TO THAW OVERNIGHT. BEGIN LOOKING OVER.	CPLOWMAN Feb 10, 2021

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF21-0010355 001 2	TIMECARD:756614 ITEM:3 175893MI 16836HR BEGIN PMI-OIL. INSPECT TOP OFF COOLANT AND POWER STEERING FLUIDS. WILL HAVE TO BRING BACK IN TO COMPLETE PMI AT LATER DATE.	CPLOWMAN Feb 11, 2021
UAF21-0010355 001 3	TIMECARD:757924 ITEM:5 REPLACE AIR DRIER DESICCANT. CHECK FOR LEAKS. NONE FOUND.	CPLOWMAN Feb 25, 2021
UAF21-0011279 001 1	TIMECARD:756614 ITEM:4 INSPECT VERIFY POWER STEERING LEAKING. CLEAN STEERING GEAR BOX, TEST OPERATION. FOUND UPPER ADAPTER FITTING LEAKING. REMOVE AND RESEAL. TEST OPERATION DOES NOT APPEAR TO BE LEAKING AT THIS TIME. INSPECT FOR POSSIBLE CAUSE OF COOLANT LEAK. UNABLE TO DETERMINE AT THIS TIME. WILL ADDRESS WHEN	CPLOWMAN Feb 11, 2021
UAF21-0011279 001 2	TIMECARD:757924 ITEM:3 REPLACE LIGHTS NEAR CAMERA. REPLACE PASSENGER DEFROST FAN WITH TAKE OFF PART. INSPECT FOR POWER STEERING LEAK PRESSURE WASH OIL RESIDUE FROM GEAR BOX AREA.	CPLOWMAN Feb 25, 2021
UAF21-0013584 001 1	TIMECARD:760671 ITEM:4 VERIFY AUTO PACK, REAR CAMERA INOPERATIVE. BEGIN DIAGNOSING AUTO PACK SYSTEM.	CPLOWMAN Apr 1, 2021
UAF21-0013584 001 2	TIMECARD:760853 ITEM:3 VERIFY REAR CAMERA NOT DISPLAYING PICTURE. FOUND POSSIBLE DAMAGED WIRE NEAR DRIVERS DOOR. BEGIN REPAIRING WIRE HARNESS. BEGIN TO DIAGNOSE INOPERATIVE AUTO PACK SYSTEM.	CPLOWMAN Apr 2, 2021
UAF21-0013584 001 3	TIMECARD:760872 ITEM:4 REPAIR CAMERA WIRE HARNESS. DURING REPAIR FOUND ADDITIONAL DAMAGED CAMERA WIRE. REMOVE DRIVERS KICK PANEL. FOUND HARNESS CUT IN MULTIPLE LOCATIONS. SECURED HARNESS OUT OF WAY. WILL REQUIRE REPLACEMENT WIRE HARNESS TO BE ORDERED.	CPLOWMAN Apr 2, 2021
UAF21-0013584 001 4	TIMECARD:761261 ITEM:1 BREAKS WERE FROZEN UP SO HAD TO GET IT THE SHOP TO THAW OUT IT WORKED FINE THE NEXT MORNING	TRBEASLEY Apr 7, 2021
UAF21-0013584 001 5	TIMECARD:761678 ITEM:3 FINISH UP WITH POWER STEERING AND BACK UP CAMERA ISSUES	TRBEASLEY Apr 13, 2021
UAF21-0013584 001 6	TIMECARD:761680 ITEM:2 START POWER STEERING FIX AND ELECTRIC FIX BASK UP CAMERA FIX	TRBEASLEY Apr 13, 2021
UAF21-0013584 001 7	TIMECARD:761800 ITEM:1 TRY AND LOCATE POPPING SOUND COMING FROM FRONT END AFTER DRIVING AND LOOKING COULD POSSIBLY BE THE FRONT KING PIN ON THE PASSENGER SIDE WILL NEED TO SET A APPT. UP FOR A VENDOR.	TRBEASLEY Apr 14, 2021
UAF21-0013584 001 8	TIMECARD:761810 ITEM:3 ASSISTED TERRY IN FINDING CLUNK/BANG NOISE UNDER FRONT END	JSCANNON Apr 14, 2021
UAF21-0013584 001 9	TURNING INTO AN ON-GOING WORK REQUEST, I AM CLOSING THIS, WE WILL TURN IN NEW EWORFS FOR ADDITIONAL WORK.	DEDSON Apr 19, 2021

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF21-0015437 001 1	THIS ISSUE SEEMS TO HAVE STOPPED, IF THE COMPLAINT HAPPENS AGAIN WE WILL ADDRESS THEN.	DEDSON May 7, 2021
UAF21-0017060 001 1	ASSIGNED TO CHRIS FOR 6/3/21	DEDSON Jun 2, 2021
UAF21-0017060 001 2	TIMECARD:765697 ITEM:3 177475MI 17003HR BEGIN PMI-OIL. PRESSURE WASH UNDER REAR OF TRUCK FOR INSPECTION. INSPECT FOUND LEFT REAR DRIVE BRAKES OUT OF ADJUSTMENT. MANUALLY ADJUST WITHIN LIMITS. REQUESTED SEPARATE W/O FOR BRAKE REPAIRS.	CPLOWMAN Jun 4, 2021
UAF21-0017060 001 3	TIMECARD:765752 ITEM:2 COMPLETE PMI. LUBE DRIVE LINES AND U-JOINTS. COOLANT, P/S, DIFFERENTIALS LEVELS OK. TOP OFF FRONT HUBS, TRANSMISSION. SET TIRE PRESSURES. LEFT REAR INNER TIRE NEAR EMPTY, WILL MONITOR FOR LEAK. REPLACE DAMAGED HIGH BEAM HEADLIGHTS WITH LED TO MATCH LOW BEAMS. ROAD TEST OK AT THIS TIME. DONE	CPLOWMAN Jun 4, 2021
UAF21-0017914 001 1	TIMECARD:765697 ITEM:4 DURING INSPECTION FOUND LEFT REAR DRIVE BRAKES OUT OF ADJUSTMENT. MANUALLY ADJUSTED BRAKE SO NOW WITHIN LIMITS. ORDERING ASA'S AND 2 CHAMBERS.	CPLOWMAN Jun 4, 2021
UAF21-0017914 001 2	SCHEDULED TO COME BACK IN THE SHOP FRIDAY 11TH	DEDSON Jun 4, 2021
UAF21-0017914 001 3	TIMECARD:765752 ITEM:3 CONTACT VENDORS TO GET PARTS ORDERED.	CPLOWMAN Jun 4, 2021
UAF21-0017914 001 4	TIMECARD:765982 ITEM:3 REPLACE REAR AXLE SLACK ADJUSTERS, LEFT BRAKE CHAMBER. WHILE ADJUSTING FOUND PLAY IN RIGHT CAM SHAFT AND DAMAGED SPLINE ON SHAFT. WILL REQUIRE ADDITIONAL TIME TO COMPLETELY DISASSEMBLE AND INSPECT BRAKES AND HARDWARE FOR WEAR AND OR DAMAGE.	CPLOWMAN Jun 9, 2021
UAF21-0017914 001 5	TIMECARD:770794 ITEM:4 LIFT AND SUPPORT REAR AXLES. REMOVE TIRES, DRUM. UNABLE TO REMOVE HUB DUE TO NOT HAVING CORRECT HUB SOCKET. ORDER TOOL.	CPLOWMAN Aug 3, 2021
UAF21-0017914 001 6	TIMECARD:770853 ITEM:2 REMOVE HUB, S-CAM. MEASURE AND RESEARCH PARTS. ORDER PARTS. WAS INFORMED PARTS ARE SEVERAL DAYS OUT. REINSTALL S-CAM, HUB AND TORQUE TO SPEC, DRUM, INNER WHEEL. RECONNECT ASA AND PRELIMINARY ADJUSTMENT.	CPLOWMAN Aug 3, 2021
UAF21-0017914 001 7	TIMECARD:770858 ITEM:3 HELP WITH PUTTING AXLE BACK IN	JSCANNON Aug 3, 2021
UAF21-0017914 001 8	TIMECARD:770915 ITEM:3 COMPLETE REASSEMBLY UNTIL PARTS ARRIVE. REINSTALL WHEELS, FILL RR HUB WITH OIL.ADJUST BRAKES. ROAD TEST RELEASE VEHICLE AT THIS TIME.	CPLOWMAN Aug 4, 2021
UAF22-0003325 001 1	TIMECARD:775951 ITEM:4 BEGIN INSPECTION, ORDER PARTS	CPLOWMAN Oct 7, 2021

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF22-0003325 001 2	TIMECARD:776022 ITEM:3 179261MI, 17162HR PERFORM PMI-OIL, PRIMARY AIR FILTER. TOP OFF COOLANT	CPLOWMAN Oct 7, 2021
UAF22-0004151 001 1	TIMECARD:775951 ITEM:5 BEGIN REPLACEMENT OF DRIVERS DOOR MIRROR WORK LIGHT.	CPLOWMAN Oct 7, 2021
UAF22-0004151 001 2	TIMECARD:776022 ITEM:2 REPLACE DRIVERS MIRROR WORK LIGHT, INSPECT FOR HYDRAULIC LEAK. VALVE BLOCK IS COVERED IN OIL RESIDUE. EXCESSIVE TRASH BUILD UP AHEAD OF PACKER NEEDS CLEANED OUT. BEGIN RESEARCHING REPLACEMENT TIRES.	CPLOWMAN Oct 7, 2021
UAF22-0006420 001 1	TIMECARD:778587 ITEM:4 DELIVER AND PICK UP FROM VENDOR FOR REAR TIRE REPLACEMENT	CPLOWMAN Nov 10, 2021
UAF22-0006420 001 2	TIMECARD:779529 ITEM:3 DELIVER TO PURCELL TIRE FOR LEFT REAR INNER TIRE FLAT. PICK UP FOLLOWING REPAIR. UNABLE TO LOCATE LEAK, REPLACED VALVE STEM.	CPLOWMAN Nov 22, 2021
UAF22-0006821 001 1	TIMECARD:779217 ITEM:3 DIAGNOSE INOPERATIVE PACK FUNCTION. INSPECT AND TEST GATE LATCH SWITCH, GATE MERCURY SWITCH, INTERLOCK RELAYS UNDER LEFT FRONT OF HOPPER. ALL APPEAR OK. EXCHANGE PACK AND AUTO THROTTLE RELAYS IN CAB. TEST OPERATION. PACKING AT THIS TIME. HAD BEEN IN SHOP FOR APPROX 1-2 HRS BY THE TIME PACKER STARTED	CPLOWMAN Nov 17, 2021
UAF22-0006904 001 1	TIMECARD:779528 ITEM:4 REPORT OF AIR LEAK. ARRIVE AT TRUCK LOCATION. VERIFY NO AIR PRESSURE. TILT CAB FOR ACCESS. FOUND BRAIDED HOSE FROM COMPRESSOR WORN THRU FROM FRAME. RETURN TO SHOP GATHER SUPPLIES. RETURN TO TRUCK APPLY TEMPORARY PATCH. BRING TRUCK BACK TO SHOP. REMOVE HOSE FOR SAMPLE. REPLACE HOSE, TEST	CPLOWMAN Nov 22, 2021
UAF22-0007434 001 1	THIS IS DONE JUST NEEDED TO PLUG IN THE SECOND PLUG IN SO ALL HEATERS ARE ON WHEN IT GETS COLD.	TRBEASLEY Dec 1, 2021
UAF22-0008220 001 1	TIMECARD:781919 ITEM:3 INSPECT, DIAGNOSE. FOUND SMOKE TO BE VAPOR FROM CRANK CASE BREATHER TUBE. ORDER BREATHER FILTER. ATTEMPT TO TIGHTEN HYDRAULIC BLOCK SUPPLY. APPEARS TIGHT. WILL REQUIRE DE-GREASING/ CLEANING BLOCK TO DETERMINE CAUSE OF FLUID LEAK. TOP OFF HYDRAULIC FLUID.	CPLOWMAN Dec 20, 2021
UAF22-0008220 001 2	REPLACED CRANK CASE BREATHER	CPLOWMAN Mar 2, 2022
UAF22-0009075 001 1	TIMECARD:783893 ITEM:4 VERIFY COOLANT LOW AND OIL LEVEL HIGH. PULL OIL SAMPLE AND SEND OUT FOR ANALYSIS. DRAIN OIL LEVEL DOWN TO PROPER LEVEL.	CPLOWMAN Jan 18, 2022
UAF22-0009075 001 2	REFER TO UAF22-0009742 FOR CONTINUED ISSUES AND WORK. ALL RELATED TO COOLANT GOING INTO ENGINE OIL.	CPLOWMAN Feb 10, 2022
UAF22-0009075 001 3	TIMECARD:787654 ITEM:2 PUT 4GALS OF COOLANT IN TRASH TRUCK, CHECKED OIL AND FOUND IT 1.5GAL OVER FULL AND PUMPED IT OUT TO FULL LEVEL.	DGPODVIN Feb 28, 2022

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF22-0009075 001 4	DONE	DGPODVIN Mar 21, 2022
UAF22-0009075 001 5	ERROR CODE: 6699 PHASE HAS OPEN OR FINALIZED PURCHASE CARDS [UAF22-0009075] - [001] UNABLE TO CLOSE	SDUNHAM10 May 20, 2022
UAF22-0009075 001 6	TIMECARD:803944 ITEM:6 PICK UP TRUCK FROM N/C. INSPECT FOUND TRANSMISSION TEMP GAUGE INOP, OIL DIPSTICK LOOSE, COOLING FAN APPEARS TO BE LOCKED ON ALL THE TIME. NOTIFIED N/C SERVICE MANAGER. SENDING TECH OUT TO INSPECT TUES. AM	CPLOWMAN Aug 10, 2022
UAF22-0009075 001 7	TIMECARD:804039 ITEM:4 JUMP START FOR OPERATOR TO RUN TRASH AND DROP TRUCK BACK AT N/C MACHINERY FOR FOLLOWUP REPAIRS	CPLOWMAN Aug 11, 2022
UAF22-0009075 001 8	TIMECARD:804209 ITEM:4 PICK UP FROM NC MACHINERY, INSPECT ALL APPEARS OK AT THIS TIME.	CPLOWMAN Aug 15, 2022
UAF22-0009742 001 1	180719 MILES, 17332HRS.	CPLOWMAN Jan 24, 2022
UAF22-0009742 001 2	TIMECARD:784604 ITEM:4 INSPECT VERIFY LOW OIL PRESSURE ON GAUGE APPROX 20PSI. PULL SAMPLE WHILE HOT TO HOLD ONTO. ORDER EFFICIENCY CAT FILTER. HAD ANOTHER TECH CHANGE OIL AND FILTER PULLING SAMPLE FROM BOTTOM OF OIL PAN CHECKING FOR CONTAMINATION. NONE DETECTED. AWAITING PRIOR OIL SAMPLE RESULTS TO DETERMINE POSSIBLE	CPLOWMAN Jan 26, 2022
UAF22-0009742 001 3	OIL SAMPLE TAKEN 17349 HRS. 3+/- GALLONS COOLANT ADDED. SENT OUT OIL SAMPLE FROM PRIOR TO LAST OIL CHANGE MID JAN.	CPLOWMAN Feb 2, 2022
UAF22-0009742 001 4	TIMECARD:785151 ITEM:1 TAKE OIL SAMPLE	DGPODVIN Feb 2, 2022
UAF22-0009742 001 5	TIMECARD:785198 ITEM:7 PULL OIL SAMPLE SEND OUT FOR ANALYSIS. TOP OFF COOLANT- APPROX 2.5-3.5 GALLON	CPLOWMAN Feb 3, 2022
UAF22-0009742 001 6	TIMECARD:786123 ITEM:1 KEEPING A CLOSE LOOK AT THE OIL DUE TO ISSUE WITH THE COOLANT GETTING IN THE OIL	TRBEASLEY Feb 11, 2022
UAF22-0009742 001 7	TIMECARD:787667 ITEM:2 CHANGE OIL, FILTER AND CRANK	DGPODVIN Feb 28, 2022
UAF22-0009742 001 8	TIMECARD:787670 ITEM:2 CHECK OIL PRESSURE DETERMINED SENSOR IS GOOD	DGPODVIN Feb 28, 2022

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF22-0009742 001 9	TIMECARD:788349 ITEM:4 OIL 2 GAL OVER FULL AGAIN AND COOLANT LOW, WORKING WITH NC TO GET PRICE ON INFRAME AND OR LONG BLOCK ENGINE AND TIME LINE	DGPODVIN Mar 7, 2022
UAF22-0009742 001 10	TIMECARD:788852 ITEM:3 GOT ESTIMATE FROM NC FOR A RE-MAN MOTOR INSTALLED AND FORWARDED IT TO BEAR AND THE OTHER PEOPLE	DGPODVIN Mar 14, 2022
UAF22-0009742 001 11	TIMECARD:792280 ITEM:3 TOP OFF COOLANT 14 QTS.	CPLOWMAN Apr 13, 2022
UAF22-0009742 001 12	TIMECARD:792504 ITEM:5 CHANGE OIL DUE TO VERY LOW OIL PRESSURE DID NOT CHANGE THE OIL FILTER	TRBEASLEY Apr 18, 2022
UAF22-0009742 001 13	TIMECARD:792765 ITEM:4 DRAIN CONTAMINATED OIL AND REPLACE OIL FILTER. REFILL. OIL PRESSURE AT APPROX 40 PSI. REPORTED LOW PRESSURE OF 15-20 PSI BY END OF ROUTE.	CPLOWMAN Apr 19, 2022
UAF22-0009742 001 14	BARREL OF OIL STK # 16560 (15W40) CHARGED TO WORK ORDER DUE TO EXCESSIVE NUMBER OF OIL CHANGES REQUIRED TO ATTEMPT TO MAINTAIN OIL PRESSURE FOR OPERATION.	CPLOWMAN Apr 20, 2022
UAF22-0009742 001 15	TIMECARD:793018 ITEM:6 181929MI 17459HR CHANGE OIL AND FILTER FOR LOW OIL PRESSURE CONCERN	CPLOWMAN Apr 21, 2022
UAF22-0010485 001 1	TIMECARD:786123 ITEM:2 ASSIST WITH PATCH ON THE FLAT TIRE	TRBEASLEY Feb 11, 2022
UAF22-0010485 001 2	TIMECARD:788853 ITEM:4 ORDERED TIRE PATCHES AND OIL FILTER	DGPODVIN Mar 14, 2022
UAF22-0010485 001 3	TIMECARD:788854 ITEM:3 FIXED TIRE AND CHECKED FLUIDS	DGPODVIN Mar 14, 2022
UAF22-0010485 001 4	DONE	DGPODVIN Mar 21, 2022
UAF22-0011782 001 1	TIMECARD:789062 ITEM:1 START ON FIXING LIFT ARM	TRBEASLEY Mar 14, 2022
UAF22-0011782 001 2	TIMECARD:789064 ITEM:4 FINISH UP LIFT ARM FIX	TRBEASLEY Mar 14, 2022

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF22-0011782 001 3	TIMECARD:789079 ITEM:3 TAKE RAM PIN OUT, CLEAN UP BUSHING HOLE AND PIN, LOOK AROUND SHOP AND PLUMBING SHOP FOR BUSHING MATERIAL, NO LUCK, WENT TO POWER PLANT SHOP AND FOUND SOME STEEL AND MADE A NEW BUSHING WITH THERE LATHE	DGPODVIN Mar 14, 2022
UAF22-0011782 001 4	DONE	DGPODVIN Mar 21, 2022
UAF22-0011823 001 1	TIMECARD:790054 ITEM:4 181493MI, 17416HR PERFORM PMI-OIL. TOP OFF COOLANT (7QTS) NO SIGNS OF EXCESSIVE COOLANT CONTAMINATION IN OIL. REMOVED PIECES OF WHAT APPEAR TO BE CARBON FROM OIL PAN.	CPLOWMAN Mar 23, 2022
UAF22-0011823 001 2	TIMECARD:790330 ITEM:4 ORDERED OIL FILTER FOR CHRIS, HE'S DOING THE PM TONIGHT.	DGPODVIN Mar 28, 2022
UAF22-0012922 001 1	TIMECARD:790331 ITEM:3 FILLED RIGHT SIDE FRONT HUB WITH 80-90 DONE	DGPODVIN Mar 28, 2022
UAF22-0015883 001 1	THE TRUCK IS AT N/C CAT HAVING A NEW MOTOR PLACED IN IT.	DEDSON Jun 28, 2022
UAF23-0002057 001 1	BATTERIES TESTED AND REPLACED BY NC MACHINERY WHILE TRUCK WAS AT THEIR SHOP FOR ENGINE REPAIRS.	CPLOWMAN Aug 15, 2022
UAF23-0003033 001 1	IT'S BEEN A YEAR, I'M SURE IT'S BEEN REPAIRED ON ANOTHER WORK REQUEST OR IT'S FINE.	DEDSON Aug 3, 2023
UAF23-0004288 001 1	PER TECH THIS WAS LOOKED AT AND FIXED UNDER DIFFERENT W/O	ACKASKIE Apr 3, 2023
UAF23-0004288 001 2	WE HAVE BEEN INSTRUCTED TO START CHANGING THE STATUS ON WORK ORDER PHASES THAT HAVE BEEN PUT INTO "COMPLETED" STATUS BACK TO "ASSIGNED TO SHOP" WHEN THERE ARE NO NOTES/DESCRIPTION OR CHARGES ON IT.	JGJESSUP Apr 14, 2023
UAF23-0005061 001 1	PER TECH, THIS WILL BE DONE IN THE SUMMER	ACKASKIE Apr 4, 2023
UAF23-0005061 001 2	TIMECARD:824167 ITEM:1 CHANGED HOSES ON FORKS	DGPODVIN Apr 22, 2023
UAF23-0005989 001 1	TIMECARD:821579 ITEM:1 BRING TRUCK INTO SHOP AND THAW OUT OVER NIGHT	DGPODVIN Mar 19, 2023

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF23-0005989 001 2	TIMECARD:821580 ITEM:2 WORK ON GREASE LINES	DGPODVIN Mar 19, 2023
UAF23-0005989 001 3	TIMECARD:821584 ITEM:3 BRING TRUCK IN, WELD DRIVERS SIDE MIRROR	DGPODVIN Mar 19, 2023
UAF23-0008514 001 1	TIMECARD:815878 ITEM:2 GET IN THE SHOP AND FIGURE OUT WHAT IS GOING ON ALSO GET THE OLD E0296 UP AND GOING JUST IN CASE E1448 DOES NOT WORK OUT (3.00 HOURS)	TRBEASLEY Dec 27, 2022
UAF23-0008514 001 2	TIMECARD:815971 ITEM:7 CONNECT DIAGNOSTIC TOOL. READ CODES, PERFORM INJECTOR BUZZ TEST. CYL 4 INOP. RESEARCH TECHNICAL DATA. LOCATE WIRE DIAGRAM. TEST INJECTOR HARNESS AND INJECTOR OHM TEST. CYL 4 EXCESSIVELY HIGH. CONTACT NC. INFORMED THEM CAB WAS UP. WAITING FOR RESPONSE FOR FIELD TECH TO DIAG AND REPAIR.	CPLOWMAN Dec 28, 2022
UAF23-0008514 001 3	NC TECH DIAGNOSED, RE-SEATED INJECTOR 4 ELECTRICAL CONNECTORS AND COIL. NOW OK	CPLOWMAN Jan 3, 2023
UAF23-0008617 001 1	TIMECARD:815418 ITEM:5 VERIFY AIR SYSTEM NOT BUILDING AIR. SUPPLY AIR TO PRIMARY TANK TO MOVE TRUCK TO SHOP. ATTEMPT TO LIFT CAB FOR ACCESS. MOVED PARTIALLY AND SEIZED. ALLOW TRUCK TO THAW OVERNIGHT	CPLOWMAN Dec 19, 2022
UAF23-0008617 001 2	TIMECARD:815527 ITEM:2 ATTEMPT TO RAISE AND LOWER CAB. CAB LIFT CYLINDERS SEIZED. DISCONNECT FROM CAB AND LOWER INTO CAB LOCKS FOR USE.	CPLOWMAN Dec 21, 2022
UAF23-0008617 001 3	TIMECARD:815751 ITEM:5 REPLACE AIR DRIER, DIAGNOSE CAB LIFT SYSTEM FAILURE. REMOVE RIGHT LIFT CYLINDER. TEST ROD APPEARS TO BE SEIZED. ORDERED REPLACEMENT PARTS.	CPLOWMAN Dec 22, 2022
UAF23-0008617 001 4	TIMECARD:815752 ITEM:4 REPLACE CAB LIFT CYLINDERS, REPLACE GOVERNOR.	CPLOWMAN Dec 22, 2022
UAF23-0009184 001 1	TIMECARD:821584 ITEM:1 WASH UNDERSIDE OF TRUCK AND LOOKED FOR LEAK	DGPODVIN Mar 19, 2023
UAF23-0009575 001 1	TIMECARD:821551 ITEM:3 BROUGHT TRUCK INTO SHOP, FIXED HEATER, CHANGED HEATER RESISTER	DGPODVIN Mar 19, 2023
UAF23-0009576 001 1	TIMECARD:821551 ITEM:1 BROUGHT TRUCK INTO SHOP AND ADJUSTED BRAKES	DGPODVIN Mar 19, 2023
UAF23-0009577 001 1	TIMECARD:818187 ITEM:5 ASSIST WITH LEAKING HUB SEAL, BRING TRUCK IN SHOP PREP FOR REPAIRS	CPLOWMAN Jan 25, 2023

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF23-0009577 001 2	TIMECARD:818416 ITEM:1 HELP WITH PUTTING BREAK PADS BACK ON	TRBEASLEY Jan 27, 2023
UAF23-0009577 001 3	TIMECARD:820716 ITEM:3 HAD TO REPLACE WHEEL SEAL DONE	TRBEASLEY Mar 3, 2023
UAF23-0009577 001 4	TIMECARD:821547 ITEM:5 BROUGHT TRUCK AND RAN DIAGNOSTICS.	DGPODVIN Mar 19, 2023
UAF23-0009577 001 5	TIMECARD:821551 ITEM:4 TAKE FRONT RIGTH WHEEL APART AND ORDER PARTS	DGPODVIN Mar 19, 2023
UAF23-0009577 001 6	TIMECARD:821552 ITEM:3 REMOVED LEFT FRONT WHEEL AND BRAKES, FOUND LEFT WHEEL SEAL ALSO LEAKING	DGPODVIN Mar 19, 2023
UAF23-0009577 001 7	TIMECARD:821553 ITEM:4 GOT WITH WAREHOUSE AND MADE APPOINTMENT AT RWC FOR FEB. 2ND AND 3RD.	DGPODVIN Mar 19, 2023
UAF23-0009577 001 8	TIMECARD:821553 ITEM:5 DEGREASE AND WASH PARTS	DGPODVIN Mar 19, 2023
UAF23-0009577 001 9	TIMECARD:821553 ITEM:9 DEGREASE AND WASH PARTS	DGPODVIN Mar 19, 2023
UAF23-0009577 001 10	TIMECARD:821553 ITEM:10 MAKE APPOINTMENT FOR KINGPINS ON FEB 2ND 3RD AT RWC	DGPODVIN Mar 19, 2023
UAF23-0009577 001 11	TIMECARD:821554 ITEM:2 WORKED ON PUTTING NEW WHEEL SEAL AND INNER AND OUTER BEARINGS	DGPODVIN Mar 19, 2023
UAF23-0009577 001 12	TIMECARD:821565 ITEM:4 TOP OFF 89/90 IN FRONT WHEEL, SEAL IS LEAKING AGAIN	DGPODVIN Mar 19, 2023
UAF23-0009577 001 13	TIMECARD:821581 ITEM:2 START ON WHEEL SEAL HAD TO ORDER SEAL TOOL	DGPODVIN Mar 19, 2023
UAF23-0009577 001 14	TIMECARD:821582 ITEM:2 WHEEL SEAL	DGPODVIN Mar 19, 2023

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF23-0009578 001 1	TIMECARD:824331 ITEM:2 REPLACED 4 OF THE FRONT HYDRO LINES ON THE ARMS THEN PRESSURE WASH MOST OF THE OIL TO SEE IF THE LEAK IS FIXED	TRBEASLEY Apr 25, 2023
UAF23-0009580 001 1	TIMECARD:817264 ITEM:5 VERIFIED BLINKER DOESNT WORK NEEDS NEW HOUSING STARTED LOOKING FOR A NEW HOUSING	DEBURTON Jan 13, 2023
UAF23-0009580 001 2	TIMECARD:818152 ITEM:6 R AND R BLINKER ON PASSENGER SIDE FOUND MARKER LIGHT OUT AND ORDERED PARTS	DEBURTON Jan 24, 2023
UAF23-0009580 001 3	TIMECARD:818661 ITEM:2 REPLACED MARKER LIGHT ON CAB	DEBURTON Feb 1, 2023
UAF23-0009959 001 1	SCHEDULED FOR REPAIR AT RWC FEB 6TH	ACKASKIE Feb 2, 2023
UAF23-0009959 001 2	TIMECARD:819317 ITEM:1 PICK UP TRUCK FROM RWC	TRBEASLEY Feb 10, 2023
UAF23-0009959 001 3	TIMECARD:820319 ITEM:2 PICK UP FROM VENDOR	TRBEASLEY Feb 27, 2023
UAF23-0009959 001 4	TIMECARD:821565 ITEM:3 PUT TRUCK IN SHOP, LOOKED OVER KINGPINS, THEY SEAM VERY TIGHT	DGPODVIN Mar 19, 2023
UAF23-0009965 001 1	TIMECARD:818152 ITEM:5 CHASED WIRING TO AUTO GREASER FOUND SEVERAL BROKEN SPOTS IN WIRING BETWEEN GREASER AND CAB REPAIRED BREAKS AUTO GREASER WORKS JUST NEED TO REPAIR BROKEN LINES NOW	DEBURTON Jan 24, 2023
UAF23-0009965 001 2	TIMECARD:818661 ITEM:4 STARTED REPLACING BROKEN GREASE LINES ON DRIVERS SIDE ARM	DEBURTON Feb 1, 2023
UAF23-0009965 001 3	TIMECARD:818943 ITEM:1 WORK ON GREASE LINE AT THIS POINT THERE ARE ABOUT EIGHT LINE CLOGGED UP ON THE DRIVER SIDE	TRBEASLEY Feb 3, 2023
UAF23-0009965 001 4	TIMECARD:820709 ITEM:1 IM NOT SURE WHERE TO START ITS GOING TO NEED A LOT OF NEW GREASE LINES SOME THREE TUBE AND TWO TUBE	TRBEASLEY Mar 3, 2023
UAF23-0009965 001 5	TIMECARD:821553 ITEM:3 WORKED ON AUTO GREASER	DGPODVIN Mar 19, 2023

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF23-0009965 001 6	TIMECARD:821553 ITEM:8 WORKED ON AUTO GREASER	DGPODVIN Mar 19, 2023
UAF23-0009965 001 7	TIMECARD:821559 ITEM:5 WORKED ON AUTO GREASER TUBBING	DGPODVIN Mar 19, 2023
UAF23-0009965 001 8	TIMECARD:821561 ITEM:2 WORKED ON AUTO GREASER LINES, THEY ARE PLUGGED WITH DRIED UP GREASE	DGPODVIN Mar 19, 2023
UAF23-0009965 001 9	TIMECARD:821582 ITEM:3 WORKED ON GREASER	DGPODVIN Mar 19, 2023
UAF23-0009965 001 10	VEHICLE BEING SURPLUSSED NO FURTHER REPAIRS TO BE PERFORMED.	CPLOWMAN Jun 25, 2024
UAF23-0009991 001 1	TIMECARD:821584 ITEM:2 START ON PTO DRIVELINE	DGPODVIN Mar 19, 2023
UAF23-0009991 001 2	TIMECARD:821585 ITEM:3 PULLED DRIVELINE AND SEND TO YOUNGSGEAR. PUT PTO SHAFT BACK ON AND RUN TRUCK	DGPODVIN Mar 19, 2023
UAF23-0009991 001 3	TIMECARD:821629 ITEM:2 REPLACE BAD PTO U JOINTS DONE	TRBEASLEY Mar 20, 2023
UAF23-0009991 001 4	TIMECARD:821634 ITEM:3 PRESSURE WAS AND FINISH UP WITH PTO	TRBEASLEY Mar 20, 2023
UAF23-0010108 001 1	TIMECARD:818362 ITEM:8 RECEIVE REPORT OF ELECTRICAL ISSUE AND TRUCK NOT STARTING AT LAND FILL. RESPOND, WHILE EN-ROUTE WAS NOTIFIED THAT OPERATOR WAS ABLE TO GET ENGINE STARTED. CONTINUE AND FOLLOW BACK TO SHOP TO ENSURE NO ISSUES ON ROAD SIDE.	CPLOWMAN Jan 27, 2023
UAF23-0010108 001 2	TIMECARD:818661 ITEM:3 REPLACED RELAY IN DASH SOLVED THE INTERMITENT DYING AND THE HEATER FAN SPEED SELECTOR NOT WORKING	DEBURTON Feb 1, 2023
UAF23-0010108 001 3	TIMECARD:821556 ITEM:4 WORKED ON ELECTRICAL SHORT AND FOUND RELAY MELTED UNDER DASH	DGPODVIN Mar 19, 2023
UAF23-0010108 001 4	TIMECARD:821557 ITEM:3 ORDERED RELAY FOR IGNITION	DGPODVIN Mar 19, 2023

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF23-0010108 001 5	TIMECARD:821559 ITEM:4 HELPED CHANGE RELAY	DGPODVIN Mar 19, 2023
UAF23-0012086 001 1	TIMECARD:821588 ITEM:2 HELPED TERRY PM	DGPODVIN Mar 19, 2023
UAF23-0012086 001 2	CHECKPOINTS IN, NOTES APPEAR INCOMPLETE, NO SIGN OF TERRY'S, BUT PUT IN TO COMPLETE STATUS OVER A MONTH AGO BY ALICIA STAHL ON 3/20/23 2:32 PM. CLOSING WO	AANDRUS Apr 24, 2023
UAF23-0015987 001 1	VEHICLE BEING SURPLUSSED NO FURTHER REPAIRS TO BE PERFORMED.	CPLOWMAN Jun 25, 2024
UAF23-0018123 001 1	TIMECARD:832053 ITEM:1 REPLACED THE DRIVER SIDE MARKER /TURN SIGNAL	TRBEASLEY Jul 26, 2023
UAF23-0018123 001 2	TIMECARD:836407 ITEM:2 STILL NEED TO FIX THE GREASE LINE ON THE FORKS BUT THE OTHER STUFF IS DONE	TRBEASLEY Sep 12, 2023
UAF24-0001329 001 1	TIMECARD:832488 ITEM:7 INSPECT FOUND HIGH SIDE PRESSURE PORT DAMAGED UNABLE TO CONNECT TO. CONNECT TO LOW SIDE SYSTEM HAS NO CHARGE. PERFORM VACUUM LEAK TEST. FAILED. ADVISED SCHEDULER/SUPERVISOR ADDITIONAL DIAGNOSIS TIME AND REPAIRS REQUIRED. RESCHEDULING IN SHOP AT LATER DATE FOR REPAIRS	CPLOWMAN Aug 2, 2023
UAF24-0001329 001 2	TIMECARD:833049 ITEM:4 CONNECT PERFORM PRELIMINARY LEAK TEST. FOUND SEALS AT A/C COMPRESSOR LEAKING. REQUESTING P/A FOR SEALS AND HIGH PRESSURE HOSE TO EVAPORATOR.	CPLOWMAN Aug 8, 2023
UAF24-0001329 001 3	VEHICLE BEING SURPLUSSED NO FURTHER REPAIRS TO BE PERFORMED.	CPLOWMAN Jun 25, 2024
UAF24-0005309 001 1	TIMECARD:838688 ITEM:2 VERIFIED RUNNING LIGHTS ARE NOT WORKING TOOK SOME LIGHTS OUT TO INSPECT FOR POSSIBLE WIRE ISSUE CAUSE I CHECKED ALL FUSES THAT ARE POSSIBLY TROUBLE MAKER. NO LUCK IN FINDING THE ISSUE WILL HAVE TO BRING BACK IN SHOP TO TRY AND FIGURE OUT WHAT THE PROBLEM IS	TRBEASLEY Oct 11, 2023
UAF24-0005309 001 2	TIMECARD:839471 ITEM:6 ASSIST WITH DIAGNOSIS OF INOPERATIVE REAR MARKER LIGHTS. FOUND DAMAGED AND CORRODED WIRE CKT 62 TRUCK SIDE OF CONNECTOR BETWEEN FRAME RAILS.	CPLOWMAN Oct 20, 2023
UAF24-0005309 001 3	TIMECARD:839833 ITEM:4 CUT BAD SECTION OF WIRE OUT THAT WAS BAD AND PUT NEW WIRE IN TESTED AL, AND NOW THE LIGHTS WORK ALSO REMOVE THE OLD PACKER LIGHT AND INSTALL NEW ONE SO THE INSIDE OF PACKER CAN SOME WHAT BE SEEN INSIDE OF IT DONE	TRBEASLEY Oct 24, 2023
UAF24-0007350 001 1	TIMECARD:842403 ITEM:4 WIRED UP A HEAVIER DUTY WINTERIZATION CORD FOR GARBARGE TRUCK.	MZANAZZO Nov 22, 2023

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF24-0007350 001 2	TIMECARD:842660 ITEM:2 WINTERIZATION PLUG REDO,WINDSHIELD WIPER KNOB PART IS ON ORDER,TAIL GATE SENSOR STICKING SO OILED IT UP GOOD	TRBEASLEY Nov 28, 2023
UAF24-0007350 001 3	TIMECARD:842664 ITEM:6 PULLED IN SHOP AND GET SOME SNOW CLEARED JUST FYI I HAVE THIS DAY WITCH SHOULD BE ON THE PREVIOUS DAY	TRBEASLEY Nov 28, 2023
UAF24-0007350 001 4	TIMECARD:844480 ITEM:1 REPLACE BOTH WIPER KNOBS AS THEY WERE LEAKING AIR. DONE	TRBEASLEY Dec 19, 2023
UAF24-0007350 001 5	TIMECARD:844493 ITEM:2 THE PLUG END HAD MELTED AGAIN SO I HAD TO REPLACE THE WHOLE JUNCTION BOX	TRBEASLEY Dec 19, 2023
UAF24-0009452 001 1	VEHICLE BEING SURPLUSSED NO FURTHER REPAIRS TO BE PERFORMED.	CPLOWMAN Jun 25, 2024
UAF24-0009561 001 1	TIMECARD:845814 ITEM:5 VERIFY AIR LEAK FROM RIGHT REAR BRAKE CHAMBER. REPLACE CHAMBER WITH STOCKED UNIT. SET PRELIMINARY ASA ADJUSTMENT, VERIFY OPERATION AND ADJUSTMENT. ORDER REPLACEMENT CHAMBER.	CPLOWMAN Jan 16, 2024
UAF24-0009561 001 2	PARTS REQUESTED 16 JAN	CPLOWMAN Jan 17, 2024
UAF24-0012533 001 1	SUPPOSEDLY THIS IS GOING TO SURPLUS SO NO NEED TO DO THE PM	TRBEASLEY Jun 24, 2024
UAF24-0012759 001 1	TIMECARD:850499 ITEM:7 BRING IN SHOP, INSPECT FOUND FRONT RECEPTACLE TERMINALS CONTAMINATED FROM MELTED CORD ENDS. CLEAN TERMINALS, PERFORM LOAD TEST, BLOCK HEATER 8-9 AMP, OIL IMMERSION HEATER 2-2.5 AMP, OIL PAD HEATER 4.5 AMP. DISCONNECT OIL PAD HEATER MEASURE TOTAL LOAD AT 11 AMPS. FABRICATE NEW EXTENSION CORD WITH	CPLOWMAN Mar 11, 2024
UAF24-0017094 001 1	VEHICLE IS BEING SURPLUSSED. WE ARE NOT DOING THE PM	SLBOONEGRANT Jun 24, 2024
UAF24-0017548 001 1	TIMECARD:857344 ITEM:3 TOP OFF COOLANT	CPLOWMAN May 31, 2024
UAF24-0017565 001 1	TIMECARD:857764 ITEM:2 THERE IS A PIECE OF DESK TOP WEDGED UNDER THE PACKER HEAD AND BINDING UP THE PACKING PART WILL HAVE TO BE DONE WITH SOME MUSCLE PLUS THE TRUCK IS FULL OF TRASH	TRBEASLEY Jun 5, 2024
UAF24-0017565 001 2	TIMECARD:859019 ITEM:1 YEA IT IS WHAT IT IS. GOT THE PACKER HEAD MOVED ABOUT A FOOT AND A HALF STILL WILL NOT PACK	TRBEASLEY Jun 20, 2024

UAF Facilities Services PM Asset Notes Log

For Asset:
E1448

WO/Ph/Seq	Notes	
UAF24-0017565 001 3	TIMECARD:859049 ITEM:4 ASSIST WITH MANUALLY PUSHING PACKER BACK TO CLEAR WEDGED DEBRIS.	CPLOWMAN Jun 20, 2024
UAF24-0017565 001 4	TIMECARD:859051 ITEM:5 CLEAR DEBRIS FROM UNDER PACKER HEAD. TEST OPERATION. STILL WILL NOT PACK. DIAG FOUND NO ELECTRICAL SIGNAL TO AIR VALVE. SWAP ROOF OPEN SIGNAL TO PACK VALVE TO GET TRUCK EMPTIED OUT.	CPLOWMAN Jun 20, 2024
UAF24-0017565 001 5	TIMECARD:859278 ITEM:1 ASSISTED CHRIS AND TERRY ON FIXING THE PACKER ON TRASH TRUCK	JDSTAMEY Jun 24, 2024
UAF24-0017565 001 6	ASSISTED TERRY AND CHRIS WITH FIXING THE TRASH TRUCK.	WTARBIZU Jun 24, 2024
UAF24-0017565 001 7	TIMECARD:859309 ITEM:2 FOUND NO ELECTRICAL SIGNAL TO AIR VALVE. SWAP ROOF OPEN SIGNAL TO PACK VALVE TO GET TRUCK EMPTIED OUT DONE	TRBEASLEY Jun 24, 2024
UAF25-0006766 001 1	TIMECARD:870468 ITEM:10 REDO THE FRONT WINTER PLUG IN OIL PAD 2.5 AMPS PAD 4.0 AMPS MARKINGS A.F. BLR ? 8.9 AMPS	TRBEASLEY Oct 15, 2024
UAF25-0006766 001 2	TIMECARD:871390 ITEM:4 REDO THE WINTERIZATION PLUG AS IT HAD A PRONG BROKE OFF DUE FROM HEAT, OIL PAN IS AT ABOUT 2.5 AMPS,I THINK THE TRANNY PAD IS AT ABOUT 4.0 AMPS AND THE BLOCK HEATER IS AT ABOUT 8.9 AMPS A TOTAL OF ABOUT 14.7 AMPS	TRBEASLEY Oct 25, 2024
UAF25-0006766 001 3	TIMECARD:875639 ITEM:3 TOP OFF ALL FLUIDS MAINLY 11 GALLONS OF HYDRO OIL	TRBEASLEY Dec 10, 2024
UAF25-0014389 001 1	VEHICLE SENT TO SURPLUS.	KNUSS Apr 22, 2025
UAF25-0019133 001 1	TIMECARD:892192 ITEM:3 PULL IN AND GET FILTERS ORDERED FOR TRASH TRUCK HAD TO PULL NUMBERS FROM TRUCK	JDSTAMEY May 22, 2025
UAF25-0019133 001 2	TIMECARD:892271 ITEM:3 DID OIL CHANGE CLEANED AIR FILTERS CHANGED FUEL FILTERS AND DID A FULL INSPECTION AND THERES ALOT HOLES IN THE BODY , LATCH ABOVE CAB PASSENGER SIDE BROKEN, FRONT SHOCKS ARE BAD, OIL PAN IS LEAKING, PR1 HAS BAD WHEEL SEAL AND BRAKES NEED REPLACED, OIL LEAK OFF OF R1 AXLE, STEERING GEAR BOX IS LEAKING,	JDSTAMEY May 22, 2025
UAF26-0003555 001 1	VEHICLE IS BEING SENT TO SURPLUS	SLBOONEGRANT Sep 8, 2025