

UAF Facilities Services PM Asset Notes Log

For Asset:
E0296

WO/Ph/Seq	Notes	
UAF17-0006065 001 1	TIMECARD:563094 ITEM:2 TEMP REPAIR AT TRANSFER STATION	FDALRYMPLE Sep 9, 2016
UAF17-0006065 001 2	TIMECARD:563151 ITEM:2 REMOVE BROKEN BOLTS IN AIR COMPRESSOR BRACKET, REPLACE ALL DRIVE BELTS, CHECK COOLING SYSTEM, ENGINE OVERHEATING.	FDALRYMPLE Sep 9, 2016
UAF17-0013246 001 1	TIMECARD:576089 ITEM:5 HEAT WITH MASTER HEATER, GET STARTED, BRING IN SHOP	FDALRYMPLE Dec 14, 2016
UAF17-0013246 001 2	TIMECARD:576231 ITEM:4 CHARGE, TEST BATTERIES, ORDER NEW, REPLACE STARTER SOLENOID, CLEAN BATTERY BOX	FDALRYMPLE Dec 15, 2016
UAF17-0013246 001 3	TIMECARD:578926 ITEM:4 HEAT WITH MASTER HEATER. START EQUIPMENT. DELIVER TO REICHARDT PER REQUEST.	CPLOWMAN Jan 11, 2017
UAF17-0013246 001 4	TIMECARD:580961 ITEM:4 ATTEMPT TO START AT BACK OF REICHARDT BUILDING. UNABLE TO START DUE TO COLD AT THIS TIME. WILL RETRY TOMORROW.	CPLOWMAN Jan 25, 2017
UAF17-0017884 001 1	TIMECARD:583371 ITEM:4 ADD FUEL, GET STARTED, BRING TO SHOP	FDALRYMPLE Feb 10, 2017
UAF17-0018427 001 1	TIMECARD:595571 ITEM:3 PM 118957 MILES 351 HOURS	FDALRYMPLE May 17, 2017
UAF17-0026778 001 1	TIMECARD:595815 ITEM:1 INSPECT, RESEARCH AND ORDER WATER PUMP	FDALRYMPLE May 19, 2017
UAF17-0026778 001 2	TIMECARD:598544 ITEM:2 REMOVE WATERPUMP-WRONG PART RECEIVED, ORDER CORRECT PART	FDALRYMPLE Jun 9, 2017
UAF17-0026778 001 3	TIMECARD:598758 ITEM:4 REPLACE WATER PUMP	FDALRYMPLE Jun 12, 2017
UAF17-0026778 001 4	TIMECARD:598882 ITEM:2 COMPLETE WATER PUMP INSTALL	FDALRYMPLE Jun 13, 2017
UAF18-0031544 001 1	TIMECARD:648234 ITEM:3 PM-NO OIL OR FILTER CHANGE. 19 HOURS SINCE LAST SERVICE 370 HOURS 119057 MILES	FDALRYMPLE Jun 26, 2018

Nov 6, 2025 12:20 PM

UAF Facilities Services PM Asset Notes Log

For Asset:
E0296

WO/Ph/Seq	Notes	
UAF19-0031858 001 1	WORK DONE ON UNKNOWN WORK REQUEST	DEDSON Jul 12, 2019
UAF20-0010423 001 1	TIMECARD:712325 ITEM:3 JUMP START, CHECK BATTERIES, BOTH TEST BAD, REMOVE FOR CORE EXCHANGE	FDALRYMPLE Dec 10, 2019
UAF20-0010423 001 2	TIMECARD:712708 ITEM:3 INSTALL NEW BATTERIES	FDALRYMPLE Dec 12, 2019
UAF20-0010423 001 3	TIMECARD:718523 ITEM:1 HEAT VEHICLE, GET STARTED	FDALRYMPLE Jan 28, 2020
UAF20-0010423 001 4	TIMECARD:724644 ITEM:2 CHECK TAILGATE OPERATION, ADD HYDRAULIC FLUID TO SYSTEM	FDALRYMPLE Mar 19, 2020
UAF21-0017453 001 1	TIMECARD:765134 ITEM:3 PICK UP TRASH TRUCK PRESSURE WASH TO SEE WHERE THE HYDRO LEAK IS ACTUALLY COMING FROM	TRBEASLEY May 25, 2021
UAF21-0017453 001 2	TIMECARD:765908 ITEM:3 INSTALL CLAMP ORDERED BY CASEY. WHILE TORQUING, HOSE STARTED LEAKING MORE. ADVISED CASEY AND MOVED OUTSIDE WITH CATCH BUCKET. ADVISED HIM TO MONITOR BUCKET FLUID LEVEL TO PREVENT OVERFLOW AND FLUID SPILL.	CPLOWMAN Jun 8, 2021
UAF21-0017453 001 3	TIMECARD:769233 ITEM:7 CLEAN REAR DIFFERENTIAL BEGIN DRIVE SHAFT REMOVAL FOR PINION SEAL REPLACEMENT.	CPLOWMAN Jul 14, 2021
UAF21-0017453 001 4	TIMECARD:769329 ITEM:2 BEGIN REMOVAL OF FRONT DRIVE AXLE PINION SEAL. UNABLE TO HOLD FLANGE. FABRICATE FLANGE HOLDING TOOL. ATTEMPT TO REMOVE PINION NUT. UNABLE TO REMOVE AT THE MOMENT. REMOVE LEAKING HYDRAULIC TANK TO PUMP SUPPLY LINE. SEND OUT FOR SAMPLE.	CPLOWMAN Jul 15, 2021
UAF21-0017453 001 5	TIMECARD:769601 ITEM:3 REPLACE HYDRAULIC TANK TO PUMP SUPPLY LINE. REFILL TEST SYSTEM OPERATION. ATTEMPT TO REMOVE FRONT PINION FLANGE FOR SEAL REPLACEMENT. UNABLE TO AT THIS TIME. CONTACT VENDORS SET APPT. WITH PAPE KW FOR 7-21. TOP OFF DIFFERENTIAL FLUID. PARK OUT SIDE.	CPLOWMAN Jul 20, 2021
UAF21-0017453 001 6	TIMECARD:770275 ITEM:2 DELIVER TO PAPE FOR AXLE LEAK REPAIRS	CPLOWMAN Jul 27, 2021
UAF21-0017453 001 7	TIMECARD:770585 ITEM:5 CONTACT VENDOR ON STATUS. TECH WAS WORKING ON IT. SHOULD HEAR BACK ON STATUS ON 7/30/21.	CPLOWMAN Jul 30, 2021
UAF21-0017453 001 8	TIMECARD:772258 ITEM:5 PICK UP FROM PAPE AFTER AXLE PINION SEAL REPLACEMENT. TEST HYDRAULICS. INSPECT NO VISIBLE LEAKS AT THIS TIME.	CPLOWMAN Aug 23, 2021

UAF Facilities Services PM Asset Notes Log

For Asset:
E0296

WO/Ph/Seq	Notes	
UAF21-0017453 002 1	TIMECARD:765148 ITEM:3 BROUGHT VEHICLE DOWN TO SHOP INSPECTED FOR LEAK FOUND MINOR LEAK COMING FROM FLANGE ON BOTTOM OF HYDRO TANK. MAIN LEAK IS COMING FROM WHERE THE RUBBER HOSE COMING FROM THE HYDRO TANK CRIMPS ONTO A METAL FITTING. I ORDERED A DIXON DL-32 CLAMP FROM AK	CSTAGNO May 25, 2021
UAF21-0017453 002 2	TIMECARD:765253 ITEM:6 CHECKED FLUID IN FIRST DIFFERENTIAL. IT WAS LOW, ADDED NEARLY 4 GALLONS OF GEAR OIL. BROUGHT IT BACK TO ARCTIC HEALTH LOADING DOCK WITH DRIP TRAY FOR HYDRO LEAK.	CSTAGNO May 27, 2021
UAF21-0017453 002 3	REMAINING WORK BEING DONE BY SHOP 7	DEDSON Jul 9, 2021
UAF21-0017981 001 1	TIMECARD:765840 ITEM:5 INSPECT PRESSURE WASH TAILGATE. BEGIN REPAIRING HOLES IN LOWER FORWARD LEFT SIDE OF GATE.	CPLOWMAN Jun 7, 2021
UAF21-0017981 001 2	TIMECARD:765908 ITEM:2 REPAIR HOLE IN TAIL GATE.	CPLOWMAN Jun 8, 2021
UAF22-0003171 001 1	AS OF 6-30-22 THIS STILL NEEDS TO BE DONE BUT CAN BE USED LIKE IT IS. WILL NEED TO PRESSURE WASH TO BE EXACT LOCATION OF LEAK.	TRBEASLEY Jun 30, 2022
UAF22-0003171 001 2	WORK IS BEING COMPLETED UNDER UAF23-0010025	ACKASKIE Mar 29, 2023
UAF23-0010025 001 1	TIMECARD:820332 ITEM:2 BRING IN SHOP TO THAW OVER THE WEEKEND	TRBEASLEY Feb 27, 2023
UAF23-0010025 001 2	TIMECARD:821571 ITEM:6 GET TRUCK RUNNING	DGPODVIN Mar 19, 2023
UAF23-0010025 001 3	TIMECARD:821572 ITEM:3 BLOCK HEATER, PLUG IN AND TEST, HEATER IS WORKING, FOUND THE TRUCK WAS 4 GAL LOW ON COOLANT. LOOKED FOR ENGINE OIL LEAKS IT LOOKED FINE. THE SMELL IS A SMALL EXHAUST LEAK UNDER CAB	DGPODVIN Mar 19, 2023
UAF25-0019361 001 1	TIMECARD:893261 ITEM:1 WENT TO GET THIS AND ITS FULL OF TRASH SO WAITING TILL IT IS EMPTY TO START THE PREP WORK	TRBEASLEY Jun 4, 2025
UAF25-0019361 001 2	TIMECARD:908545 ITEM:1 PULL IN SHOP AND REMOVE DECALS WITH PRESSURE WASH THEN TAKE TO SURPLUS DONE	TRBEASLEY Nov 6, 2025
UAF25-0019361 003 1	TIMECARD:907952 ITEM:2 DROVE 962 WITH FORKS TO LANDFILL TO HOLD UP BACK OF 296 WHILE MECHANICS DISMANTLED HYDRAULIC RAMS TO ENABLE THE BACK TO DROP SO IT COULD BE DRIVEN OUT OF LANDFILL AND TAKEN TO SURPLUS	NDDUNHAM Oct 31, 2025

UAF Facilities Services PM Asset Notes Log

For Asset:
E0296

WO/Ph/Seq	Notes	
UAF25-0019361 003 2	TIMECARD:908301 ITEM:2 BROKE DOWN AT LAND FIELD WAIT FOR REPAIRS TO BE DONE EMPTY TRUCK	JBYRD Nov 4, 2025
UAF26-0007272 001 1	TIMECARD:907868 ITEM:5 RECEIVED REPORT OF GATE STUCK UP. RESPOND TO LANDFILL, LOCATE TRUCK. ATTEMPT TO CYCLE GATE, FAILED. CHECK FOR POSSIBLE VALVE FAILURE, NO FLUID RELEASE. DETERMINE RIGHT LIFT CYLINDER FAILED INTERNALLY CAUSING LOCK UP. CALLED FOR OPERATOR TO RESPOND TO LANDFILL WITH LOADER AND FORKS. RETURN	CPLOWMAN Oct 31, 2025
UAF26-0007272 001 2	TIMECARD:908524 ITEM:2 RESPOND TO LANDFILL, LOCATE TRUCK. ATTEMPT TO CYCLE GATE, FAILED. CHECK FOR POSSIBLE VALVE FAILURE, NO FLUID RELEASE. DETERMINE RIGHT LIFT CYLINDER FAILED INTERNALLY CAUSING LOCK UP. CALLED FOR OPERATOR TO RESPOND TO LANDFILL WITH LOADER AND FORKS. RETURN TO SHOP GATHER TOOLS, RETURN TO SITE. REMOVE RIGHT	TRBEASLEY Nov 6, 2025