

CUSTOMER #:
 UNIT# 35-14039
 ATTN:

INVOICE



OTTAWA, ONTARIO

PAGE 1

1571 LIVERPOOL COURT, OTTAWA ONTARIO K1B 4L1
 TEL.: (613) 745-0024 1-888-232-9494 FAX: (613) 745-8690
 WEB SITE: www.surgenortruck.com

HOME: CONT:
 BUS: 613 ELL: 613-
 COLOUR MAKE/MODEL

SERVICE ADVISOR:

WHITE	15	MACK GU713	1M2AX04C6FM022022	BR88672	163935/163957	TK672
-------	----	------------	-------------------	---------	---------------	-------

DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01OCT14 DD			12:00 05APR24	11603085		CHG	10APR24

R.O. OPENED	READY	OPTIONS:	DLR:N975	ENG:MP7-365HP	TRN:ALLISON_6SPD
14:00 07MAR24	08:19 10APR24	1)GINCOR FLOW			

LINE OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
-------------	------	------	-------	------	-----	-------

A LOCATION: E / CONTACT:
 COO COO RFSO# -S01 / LABOUR RATE

PARTS: 999CNAFH 0.00 0.00 0.00 0.00 0.00 0.00 0.00
 LABOR: 0.00 OTHER: 0.00 TOTAL LINE A: 0.00

B ENGINE CONTROL MODULE (ECM) / CHECK ENGINE FAULT - DIAGNOSTICS
 Turbo related codes, Turbo was just done Jan2023
 280 ENGINE CONTROL MODULE (ECM) / CHECK ENGINE
 FAULT - DIAGNOSTICS

394CNAFH
 541CNAFH 0.
 369CNAFH 0.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B:
 163957 394-VERIFY COMPLAINT/SCAN FOR CODES P20C113 ,P113712
 ,P226C00 ACTIVE /PERFORM DIAGNOSTICS FOUND TURBO STICKING ,DEFECTIVE
 ENGINE OIL THERMOSTAT AND EGR DIFFERENTIAL PRESSURE SENSOR/PLUS FOUND
 DEFECTIVE DEF TANK HEATED LINE SET/ALSO NOTICED PRIMARY FUEL FILTER
 FULL/PROVIDE ESTIMATE FOR REPAIR 394 369 ROAD TEST AFTER ALL REPAIRS
 COMPLETED. ENGINE LIGHT CAME ON DURING THE ROAD TEST. SCANNED FAULT
 CODE. FOUND ACTIVE CODE FOR OUTLET NOX SENSOR FAIL INTERNALLY. MAKE A
 QUOTE. 369

C MV CASE # 18086626/ ENGINE HOURS: 6689h
 031 MV CASE # / ENGINE HOURS

PARTS: 999CNAFH 0.00 0.00 0.00 0.00 0.00 0.00 0.00
 LABOR: 0.00 OTHER: 0.00 TOTAL LINE C: 0.00

D** TURBOCHARGER - REPAIR / REPLACE / RE-SEAL
 255 REPLACE TURBOCHARGER

369CNAFH
 541CNAFH 0.80

**REPAIRS AND SERVICE
 TO ALL
 MAKES AND MODELS**

CONVENIENT SERVICE HOURS:
 MON.-THURS: 7:00 a.m. - 2:30 a.m.
 FRIDAY: 7:00 a.m. - 6:00 p.m.
 SATURDAY: 7:00 a.m. - 4:00 p.m.

24 Hrs. EMERGENCY SERVICE
 GST/HST 890203508

An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

I agree that until all repairs are fully paid for (account considered unpaid until cheques are honoured at the bank), my custody of the motor vehicle set out in this document remains with you and you may resume possession by yourself or your bailiff at any time and realise the amount of your mechanic's lien together with the cost of resuming possession as if the vehicle had never left your custody or control.

Je comprends et j'accepte les termes et conditions stipulés ci-haut en anglais.

CUSTOMER SIGNATURE
 SIGNATURE DU CLIENT
 PRINT
 IMPRIMER

DESCRIPTION	TOTALS
LABOUR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAXES	
PLEASE PAY THIS AMOUNT	

LABOUR RATES VARY FROM \$100.00 TO A MAXIMUM OF \$199.95 PER HOUR FOR SERVICE, REQUIRING SPECIALIZED SKILLS AND DIAGNOSTIC EQUIPMENT. WE STRIVE TO PROVIDE OUR CUSTOMERS GOOD VALUE IN THE SERVICE WE PROVIDE

CUSTOMER #:
UNIT# 35-14039
OTTAWA



INVOICE

ATTN: D
PC
OTTAWA, ON K1P 0B9

PAGE 2

1571 LIVERPOOL COURT, OTTAWA ONTARIO K1B 4L1
TEL.: (613) 745-0024 1-888-232-9494 FAX: (613) 745-8690
WEB SITE: www.surgenortruck.com

HOME: CONT:613 4
BUS: 613 24 CELL:613-30 7

SERVICE ADVISOR: IEY

COLOUR	YEAR	MAKE/MODEL	VIN	LICENSE	KILOMETERS IN/ OUT	TAG
WHITE	15	MACK GU713	1M2AX04C6FM022022	BR88672	163935/163957	TK672

DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01OCT14 DD			12:00 05APR24	11603085		CHG	10APR24

R.O. OPENED	READY	OPTIONS:	DLR:N975	ENG:MP7-365HP	TRN:ALLISON_6SPD
14:00 07MAR24	08:19 10APR24	1)GINCOR FLOW			

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

- 1 85151093 TURBO KIT
- 1 FRT FREIGHT CHARGE
- FRT FOR PART #85151093
- 1 21060426 V-CLAMP
- 1 20978469 RING
- 1 21095721 GASKET
- 1 20592787 HOSE CLAMP
- 1 20592783 V-CLAMP

PARTS: LABOR: 36 OTHER: 0.00
369 REMOVED TURBO ASSEMBLY. WAIT FOR PARTS. 369 369 INSTALLED NEW TURBO ASSEMBLY. CLEARED FAULT CODE. PERFORMED FUNCTION LEARNED RESET. 369

E** REPLACE ENGINE OIL THERMOSTAT
2222 REMOVED OIL SOLENOID, BOTH BOLTS BROKE IN HOUSING -REQUIRES REPLACEMENT
369COILH 4.00
541COILH

36 CHO257000B DELO 400 XLE, 10W-30, CK-

9996 REPLACE ENGINE OIL FILTER HOUSING
369CNAFH 0.00
541CNAFH 0.00

- 1 23722221 OIL FILTER HOUSING
- 1 23291627 GASKET
- 1 21432772 GASKET
- 1 85001101 MACK MAIN/KIT
- 1 EV201 ENVIRONMENTAL FEE
- 1 21434720 CONNECTION PIPE
- 1 KFT313 BRAKE CLEANER
- 1 KFT824 ENGINE SHAMPOO
- 1 21760693 PIPE

REPAIRS AND SERVICE TO ALL MAKES AND MODELS

CONVENIENT SERVICE HOURS:
MON.-THURS: 7:00 a.m. - 2:30 a.m.
FRIDAY: 7:00 a.m. - 6:00 p.m.
SATURDAY: 7:00 a.m. - 4:00 p.m.

24 Hrs. EMERGENCY SERVICE
GST/HST 890203508

An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. I agree that until all repairs are fully paid for (account considered unpaid until cheques are honoured at the bank), my custody of the motor vehicle set out in this document remains with you and you may resume possession by yourself or your bailiff at any time and realise the amount of your mechanic's lien together with the cost of resuming possession as if the vehicle had never left your custody or control.

Je comprends et j'accepte les termes et conditions stipulés ci-haut en anglais.

CUSTOMER SIGNATURE
SIGNATURE DU CLIENT
PRINT
IMPRIMER

DESCRIPTION	TOTALS
LABOUR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAXES	
PLEASE PAY THIS AMOUNT	

LABOUR RATES VARY FROM \$100.00 TO A MAXIMUM OF \$199.95 PER HOUR FOR SERVICE, REQUIRING SPECIALIZED SKILLS AND DIAGNOSTIC EQUIPMENT. WE STRIVE TO PROVIDE OUR CUSTOMERS GOOD VALUE IN THE SERVICE WE PROVIDE

CUSTOMER #:
UNIT# 35-14039



INVOICE

ATTN:
PO BOX
OTTAWA,
HOME:
BUS: 61

CONT: 613-
CELL: 613-307

PAGE 3



1571 LIVERPOOL COURT, OTTAWA ONTARIO K1B 4L1
TEL.: (613) 745-0024 1-888-232-9494 FAX: (613) 745-8690
WFR SITE: www.surgenortruck.com

SERVICE ADVISOR:


COLOUR	YEAR	MAKE/MODEL	VIN	LICENSE	KILOMETERS IN/ OUT	TAG
WHITE	15	MACK GU713	1M2AX04C6FM022022	BR88672	163935/163957	TK672

DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01OCT14 DD			12:00 05APR24	11603085		CHG	10APR24

R.O. OPENED	READY	OPTIONS:
14:00 07MAR24	08:19 10APR24	DLR:N975 ENG:MP7-365HP TRN:ALLISON_6SPD 1)GINCOR FLOW

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

- 1 21432772 GASKET
- 3 984746 FLANGE SCREW
- 5 975197 FLANGE SCREW
- 2 24070065 CLAMP
- 2 20841816 GASKET
- 1 975670 O-RING
- 1 21434720 CONNECTION PIPE
- 4 1547253 SEALING RING
- 4 993664 O-RING
- 1 23963489 PIPE
- 1 23963483 PIPE
- 2 979097 GASKET
- 2 11994 GASKET
- 2 960629 PLUG
- 1 1677370 SEALING RING
- 1 20526428 SEALING RING
- 3 1547252 SEALING RING
- 1 21940615 SEALING RING
- 1 FRT FREIGHT CHARGE
- 21432772-JD
- 1 85124530 HOSE KIT
- 1 KFT313 BRAKE CLEANER
- 2 07480 2CRS;ROLOC
- 2 36526 2"X36G;RLC
- 4 995489 FLANGE SCREW
- 4 20706085 LOCK NUT
- 4 BD-32580 FENDER WASHER 3/8X1-1/2 O
- 4 BD-D39029 GR.8HXCAPSCREW5/16-18X1 Z
- 4 BD-39726 LOCK WASHER 5/16-ZY
- 4 BD-39602 GR. 8 HEX NUT 5/16-18 - Z
- 8 BD-36702 HARDENED FLAT WASHER- 5/1
- 1 20740148 YOKE
- 1 20567779 PLUG
- 1 23999622 PLUG

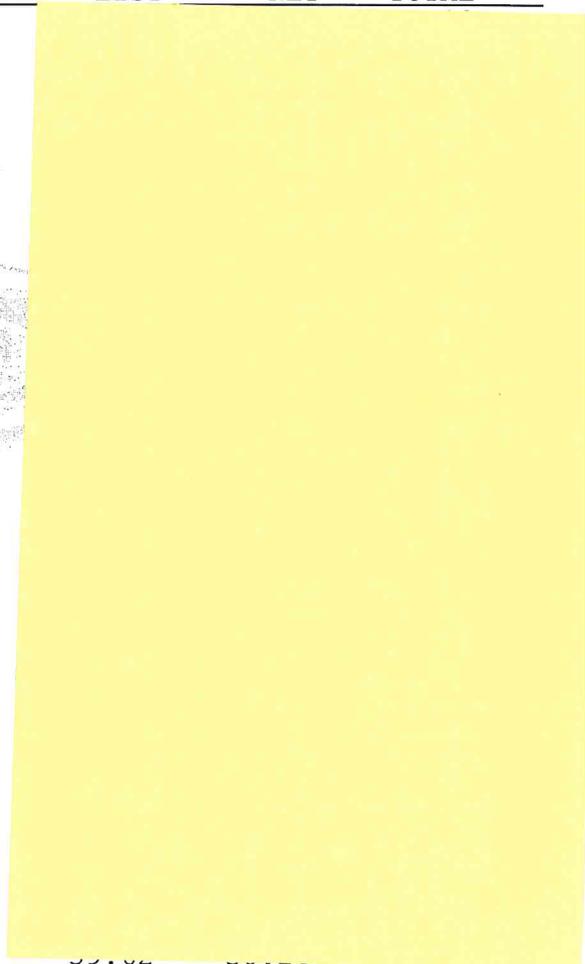

**REPAIRS AND SERVICE
TO ALL
MAKES AND MODELS**

CONVENIENT SERVICE HOURS:
MON.-THURS: 7:00 a.m. - 2:30 a.m.
FRIDAY: 7:00 a.m. - 6:00 p.m.
SATURDAY: 7:00 a.m. - 4:00 p.m.

24 Hrs. EMERGENCY SERVICE
GST/HST 890203508

An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. I agree that until all repairs are fully paid for (account considered unpaid until cheques are honoured at the bank), my custody of the motor vehicle set out in this document remains with you and you may resume possession by yourself or your bailiff at any time and realise the amount of your mechanic's lien together with the cost of resuming possession as if the vehicle had never left your custody or control.

Je comprends et j'accepte les termes et conditions stipulés ci-haut en anglais.

CUSTOMER SIGNATURE
SIGNATURE DU CLIENT
PRINT
IMPRIMER

DESCRIPTION	TOTALS
LABOUR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAXES	
PLEASE PAY THIS AMOUNT	

LABOUR RATES VARY FROM \$100.00 TO A MAXIMUM OF \$199.95 PER HOUR FOR SERVICE, REQUIRING SPECIALIZED SKILLS AND DIAGNOSTIC EQUIPMENT, WE STRIVE TO PROVIDE OUR CUSTOMERS GOOD VALUE IN THE SERVICE WE PROVIDE

CUSTOMER #:
 UNIT# 35-14039
 CITY
 ATTN:
 PO BOX
 OTTAWA, ON K1E
 HOME:
 BUS: 613-580-
 CONT:613-580-
 CELL:613-

INVOICE

PAGE 4



1571 LIVERPOOL COURT, OTTAWA ONTARIO K1B 4L1
 TEL.: (613) 745-0024 1-888-232-9494 FAX: (613) 745-8690
 WEB SITE: www.surgenortruck.com

COLOUR	YEAR	MAKE/MODEL	VIN	LICENSE	KILOMETERS IN/OUT	TAG	
WHITE	15	MACK GU713	1M2AX04C6FM022022	BR88672	163935/163957	TK672	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01OCT14 DD			12:00 05APR24	11603085		CHG	10APR24
R.O. OPENED	READY	OPTIONS: DLR:N975 ENG:MP7-365HP TRN:ALLISON_6SPD 1)GINCOR PLOW					
14:00 07MAR24	08:19 10APR24						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
1	21940615		SEALING RING				
1	984733		FLANGE SCREW				
1	975197		FLANGE SCREW				
1	FRT		FREIGHT CHARGE				
	9622/7779/0148-JD						
1	KFT313		BRAKE CLEANER				
1	KFT824		ENGINE SHAMPOO				
3	PSN74055F		50/50 EL COOLANT				
3	EV801		ENVIROMENTAL FEE				
1	60111159		HEX. SOCKET SCREW				

PARTS: 1 } LABOR: }3 OTHER: }

369 TRY TO REMOVED ENGINE THERMOSTAT OIL SOLENOID. BOTH BOLTS
 BROKEN IN ENGINE OIL FILTER HOUSING. MAKE A QUOTE FOR REPLACE ENGINE
 OIL FILTER HOUSING. 369 369 REPLACED
 ENGINE OIL FILTER. INSTALLED NEW OIL FILTER. FILLED ENGINE WITH NEW
 OIL. CLEARED FAULT CODE. FOUND ENGINE OIL LEAKING FROM A PLUG IN OIL
 GALLERY ON BLOCK. ORDERED PARTS. 369 369 REMOVED TURBO AND EGR COOLER
 TO ACCESS LEAKING PLUG. REPLACED PLUG ON ENGINE BLOCK FOR OIL GALLERY.
 REINSTALLED EGR COOLER AND TURBO. CLEARED FAULT CODE.
 ROAD TEST. 369

F** EGR DIFFERENTIAL PRESSURE SENSOR - REPLACE
 2938 EGR DIFFERENTIAL PRESSURE SENSOR - REPLACE /
 RE & RE
 369CNAFH 0.60
 1 22181342 PRESSURE SENSOR
 2 984736 FLANGE SCREW

PARTS: 255.21 LABOR: OTHER: 0.00
 369 REPLACED EGR DIFF PRESSURE SENSOR. 369

G** REPLACE SECONDARY FUEL FILTER
 103 REPLACE SECONDARY FUEL FILTER
 369CNAFH 0.20

**REPAIRS AND SERVICE
 TO ALL
 MAKES AND MODELS**

CONVENIENT SERVICE HOURS:
 MON.-THURS: 7:00 a.m. - 2:30 a.m.
 FRIDAY: 7:00 a.m. - 6:00 p.m.
 SATURDAY: 7:00 a.m. - 4:00 p.m.

24 Hrs. EMERGENCY SERVICE
 GST/HST 890203508

An express mechanic's lien is hereby acknowledged on above
 vehicle to secure the amount of repairs thereto.
 I agree that untill all repairs are fully paid for (account
 considered unpaid untill cheques are honoured at the bank),
 my custody of the motor vehicle set out in this document
 remains with you and you may resume possession by yourself
 or your bailiff at any time and realise the amount of your
 mechanic's lien together with the cost of resuming possession
 as if the vehicle had never left your custody or control.

Je comprends et j'accepte les termes et conditions stipulés
 ci-haut en anglais.

CUSTOMER SIGNATURE
 SIGNATURE DU CLIENT
 PRINT
 IMPRIMER

DESCRIPTION	TOTALS
LABOUR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAXES	
PLEASE PAY THIS AMOUNT	

LABOUR RATES VARY FROM \$100.00 TO A MAXIMUM OF \$199.95 PER HOUR FOR
 SERVICE, REQUIRING SPECIALIZED SKILLS AND DIAGNOSTIC EQUIPMENT, WE
 STRIVE TO PROVIDE OUR CUSTOMERS GOOD VALUE IN THE SERVICE WE PROVIDE

CUSTOMER #:
 UNIT# 35-14039
 CITY O
 ATTN:
 PO BOX
 OTTAWA, ON I
 HOME:
 BUS: 613-58



INVOICE



1571 LIVERPOOL COURT, OTTAWA ONTARIO K1B 4L1
 TEL.: (613) 745-0024 1-888-232-9494 FAX: (613) 745-8690
 WFR SITE: www.surgenortruck.com

PAGE 5

CONT:61

SERVICE ADVISOR:

COLOUR	PLATE	MAKE/MODEL	VIN	LICENSE	KILOMETERS IN/ OUT	TAG
WHITE	15	MACK GU713	1M2AX04C6FM022022	BR88672	163935/163957	TK672

DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01OCT14 DD			12:00 05APR24	11603085		CHG	10APR24

R.O. OPENED	READY	OPTIONS:	DLR:N975	ENG:MP7-365HP	TRN:ALLISON_6SPD
14:00 07MAR24	08:19 10APR24	1)GINCOR FLOW			

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

- 1 21737481 FUEL FILTER INSERT
- 1 EV100 ENVIROMENTAL FEE
- 2 FUEL DIES/FUEL

PARTS: 3 LABOR: OTHER: T
 369 REPLACED FUEL/ WATER SEPARATOR FILTER. 369

H** REPLACE DEF TANK HEATED LINE SET

- 2583 DEF LINE - REPLACE
- 369CNAFH)
- 541CNAFH 0.10

- 1 21483646 HOSE
- 2 BD-BT4SC0 BARB TY CABLE TIE, 15.1L
- 30 BD-BT4SC0 BARB TY CABLE TIE, 15.1L

PARTS: LABOR: 2 OTHER: 0.00 T
 369 REPLACED DEF LINE FROM TANK TO PUMP. 369

I** CONTINUE FAULT TRACING CHECK ENGINE LIGHT ON

- 280 ENGINE CONTROL MODULE (ECM) / CHECK ENGINE
- FAULT - DIAGNOSTICS
- 369CNAFH 1.60
- 541CNAFH 0.20
- 1.80
- 1 25090755 FITTING
- 1 4485-14854100 AB TUBING, 1/4 OD, BLACK
- 1 21407621 INJECTOR
- 1 21243502 PRESSURE REGULATOR
- 1 21266886 FILTER
- 1 8397699 FITTING
- 1 8397711 FITTING
- 258-2 AFTERTREATMENT HYDROCARBON INJECTION MODULE
- (AHI) - REPLACE
- 369CNAFH
- 541CNAFH

**REPAIRS AND SERVICE
 TO ALL
 MAKES AND MODELS**

CONVENIENT SERVICE HOURS:
 MON.-THURS: 7:00 a.m. - 2:30 a.m.
 FRIDAY: 7:00 a.m. - 6:00 p.m.
 SATURDAY: 7:00 a.m. - 4:00 p.m.

24 Hrs. EMERGENCY SERVICE
 GST/HST 890203508

An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

I agree that until all repairs are fully paid for (account considered unpaid until cheques are honoured at the bank), my custody of the motor vehicle set out in this document remains with you and you may resume possession by yourself or your bailiff at any time and realise the amount of your mechanic's lien together with the cost of resuming possession as if the vehicle had never left your custody or control.

Je comprends et j'accepte les termes et conditions stipulés ci-haut en anglais.

CUSTOMER SIGNATURE
 SIGNATURE DU CLIENT
 PRINT
 IMPRIMER

DESCRIPTION	TOTALS
LABOUR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAXES	
PLEASE PAY THIS AMOUNT	

LABOUR RATES VARY FROM \$100.00 TO A MAXIMUM OF \$199.95 PER HOUR FOR SERVICE, REQUIRING SPECIALIZED SKILLS AND DIAGNOSTIC EQUIPMENT. WE STRIVE TO PROVIDE OUR CUSTOMERS GOOD VALUE IN THE SERVICE WE PROVIDE

CUSTOMER COPY

CUSTOMER #:
UNIT# 35-14039

INVOICE



ATTN:
PO BOX
O, ON



PAGE 6

1571 LIVERPOOL COURT, OTTAWA ONTARIO K1B 4L1
TEL.: (613) 745-0024 1-888-232-9494 FAX: (613) 745-8690
WEB SITE: www.surgenortruck.com

HOME: CONT:613
BUS: 613-580- CELL:613- SERVICE ADVISOR:

COLOUR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEMETERS IN/OUT	TAG	
WHITE	15	MACK GU713	1M2AX04C6FM022022	BR88672	163935/163957	TK672	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01OCT14 DD			12:00 05APR24	11603085		CHG	10APR24
R.O. OPENED	READY	OPTIONS: DLR:N975 ENG:MP7-365HP TRN:ALLISON_6SPD					
14:00 07MAR24	08:19 10APR24	1)GINCOR PLOW					
LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL

1 23185531 MODULE
CORE CHARGE REMOVED
258-4 AHI AIR PRESSURE REGULATOR - REPLACE
369CNAFH 0.80
2 20852762 SEALING RING
154 REPLACE 7TH INJECTOR - NEW STYLE
369CNAFH
2543 PERFORM REGEN
369CNAFH 0
PARTS: 39 LABOR: 5 OTHER: 0.00

369 SCANNED FAULT CODE. FOUND ACTIVE CODE P20DE00,P20D000.
PERFORMED DIAGNOSE FOR AHI MODULE F/C. MEASURED AIR PRESSURE AT AHI
MODULE. READ 68PSI, DEFECT AHI AIR PRESSURE REGULATOR, PERFORMED AHI
MODULE TEST. FAIL TEST, LOW FUEL PRESSURE. MEASURED AFTER TREATMENT
FUEL PRESSURE WITH MANUAL FUEL GAUGE, READ 68 PSI SAME AS ENGINE FUEL
PRESSURE. DISCONNECTED AIR/ FUEL LINE FROM AHI MODULE TO 7TH INJECTOR.
BLOW AIR INTO, LINE NOT PLUG. FLOW TEST 7TH INJECTOR. 7TH INJECTOR
PLUGGED SOLID. MAKE A QUOTE FOR REPLACE AHI MODULE, AIR PRESSURE
REGULATOR AND 7TH INJECTOR. 369
369 REPLACED AHI MODULE. REPLACED AHI AIR PRESSURE REGULATOR.
REPLACED 7TH INJECTOR.
CLEARED FAULT CODE. RESET ADAPTIVE FUNCTION. PERFORMED REGEN. REGEN
COMPLETED PROPERLY. 369

J** NOX SENSOR 1/2 - REPLACE
258-14 NOX SENSOR 1/2 - REPLACE
369CNAFH)
1 22303391 SENSOR
12 BD-BT4SC0 BARB TY CABLE TIE, 15.1L
PARTS: .2 LABOR: 4 OTHER: 0.00
163957 369 REPLACED OUTLET NOX SENSOR. CLEARED FAULT C
F/C. 369

REPAIRS AND SERVICE TO ALL MAKES AND MODELS

CONVENIENT SERVICE HOURS:
MON.-THURS: 7:00 a.m. - 2:30 a.m.
FRIDAY: 7:00 a.m. - 6:00 p.m.
SATURDAY: 7:00 a.m. - 4:00 p.m.

24 Hrs. EMERGENCY SERVICE
GST/HST 890203508

An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.
I agree that untill all repairs are fully paid for (account considered unpaid untill cheques are honoured at the bank) my custody of the motor vehicle set out in this document remains with you and you may resume possession by yourself or your bailiff at any time and realise the amount of you mechanic's lien together with the cost of resuming possession as if the vehicle had never left your custody or control.

Je comprends et j'accepte les termes et conditions stipulés ci-haut en anglais.

CUSTOMER SIGNATURE
SIGNATURE DU CLIENT
PRINT
IMPRIMER

MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAXES	
PLEASE PAY THIS AMOUNT	

LABOUR RATES VARY FROM \$100.00 TO A MAXIMUM OF \$199.95 PER HOUR FOR SERVICE. REQUIRING SPECIALIZED SKILLS AND DIAGNOSTIC EQUIPMENT. WE STRIVE TO PROVIDE OUR CUSTOMERS GOOD VALUE IN THE SERVICE WE PROVIDE

CUSTOMER #: ---
 UNIT# 35-14039
 OF A
 ATTN:
 PO BOX S
 C

INVOICE



PAGE 7

1571 LIVERPOOL COURT, OTTAWA ONTARIO K1B 4L1
 TEL.: (613) 745-0024 1-888-232-9494 FAX: (613) 745-8690
 WEB SITE: www.surgenortruck.com

HOME: CONT: 613-580-2124
 BUS: 613- CELL: 613-301

SERVICE ADVISOR:

COLOUR	YEAR	MAKE/MODEL	VIN	LICENSE	KILOMETERS IN/ OUT	TAG
WHITE	15	MACK GU713	1M2AX04C6FM022022	BR88672	163935/163957	TK672

DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01OCT14 DD			12:00 05APR24	11603085		CHG	10APR24


R.O. OPENED	READY	OPTIONS:
14:00 07MAR24	08:19 10APR24	DLR:N975 ENG:MP7-365HP TRN:ALLISON_6SPD 1)GINCOR PLOW

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

CUSTOMER PAY MISC SHOP CHARGE FOR REPAIR ORDER
 369-

NOTICE IF WHEELS HAVE BEEN REMOVED IT IS THE CUSTOMER'S RESPONSIBILITY TO HAVE THEM RE-TORQUED AFTER 100 KMS

NOW ACCEPTING E-TRANSFER!
 ADDRESS: STC.ETRANSFER@SURGENOR.COM
 PLEASE INCLUDE INVOICE # IN COMMENT

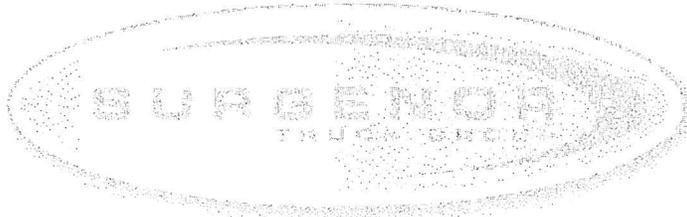

REPAIRS AND SERVICE TO ALL MAKES AND MODELS

CONVENIENT SERVICE HOURS:
 MON.-THURS: 7:00 a.m. - 2:30 a.m.
 FRIDAY: 7:00 a.m. - 6:00 p.m.
 SATURDAY: 7:00 a.m. - 4:00 p.m.

24 Hrs. EMERGENCY SERVICE
 GST/HST 890203508

An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. I agree that until all repairs are fully paid for (account considered unpaid until cheques are honoured at the bank), my custody of the motor vehicle set out in this document remains with you and you may resume possession by yourself or your bailiff at any time and realise the amount of your mechanic's lien together with the cost of resuming possession as if the vehicle had never left your custody or control.

Je comprends et j'accepte les termes et conditions stipulés ci-haut en anglais.

CUSTOMER SIGNATURE
 SIGNATURE DU CLIENT
 PRINT
 IMPRIMER

DESCRIPTION	TOTALS
LABOUR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	0.00
SALES TAXES	
PLEASE PAY THIS AMOUNT	

LABOUR RATES VARY FROM \$100.00 TO A MAXIMUM OF \$199.95 PER HOUR FOR SERVICE, REQUIRING SPECIALIZED SKILLS AND DIAGNOSTIC EQUIPMENT, WE STRIVE TO PROVIDE OUR CUSTOMERS GOOD VALUE IN THE SERVICE WE PROVIDE