

**1st Stop Auto Care Centers**

(859) 223-4688

firststopauto@aol.com

600 Delzan Pl, Lexington, KY, USA,

40503

Sean Chapman

(859) 608-1716

1476 Corona Dr, Lexington, USA, 40514

Inspection Report

Against Estimate#: 84832

Created: Nov 21, 2025

Invoiced: Nov 21, 2025

Service Advisor: Greg Peel

2017 FORD F150 King**Ranch**VIN: 1FTFW1EG6H~~K~~**C27651**

Mileage in: 148464 mi

License Plate: EE3726

Pre-Buy Inspection

Category	Items	Conditions	Status
We Suggest Monitoring			
Exterior	Windows and Mirrors		WE SUGGEST MONITORING
Mirror arm retract/extend function works. Power mirror directional adjustment is limited. Left mirror moves left (and only as far as center position) but not right, up and down direction is ok. Right mirror moves up but not down, left and right direction is ok. Mirrors can be pushed in the inoperable direction a little by hand. Power windows and locks work.			
Checked & OK			
Driveability	Steering		CHECKED & OK
Driveability	Cruise Control		CHECKED & OK
Driveability	Transmission Operation		CHECKED & OK
Driveability	Engine Operation		CHECKED & OK
Brakes	Front Brake Pad Lining		CHECKED & OK
About 7mm			
Brakes	Front Brake Rotor Condition		CHECKED & OK
Brakes	Rear Brake Pad Lining		CHECKED & OK
About 7mm			
Brakes	Rear Brake Rotor/Drum Condition		CHECKED & OK
Brakes	Brake Lines and Hoses Condition		CHECKED & OK
Brakes	Calipers and Wheel Cylinders		CHECKED & OK
Brakes	Parking Brake Operation		CHECKED & OK
Brakes	Brake Fluid Condition		CHECKED & OK

**1st Stop Auto Care Centers**

(859) 223-4688

firststopauto@aol.com

600 Delzan Pl, Lexington, KY, USA,
40503**Inspection Report**

Against Estimate#: 84832


Created: Nov 21, 2025

Invoiced: Nov 21, 2025


Service Advisor: Greg Peel

Brakes	ABS System Check	CHECKED & OK
Underhood	Brake Fluid	CHECKED & OK
	Color is good	
Underhood	Transmission Fluid	CHECKED & OK
Underhood	Engine Coolant	CHECKED & OK
	Added a little coolant to max line.	
Underhood	Power Steering Fluid	CHECKED & OK
Underhood	Washer Fluid	CHECKED & OK
Underhood	Major Leaks	CHECKED & OK
	Vehicle is dry underneath.	

Attachments- 2

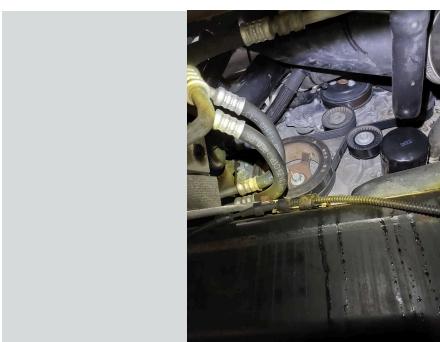

taken-on: Nov 21, 2025 2:15pm

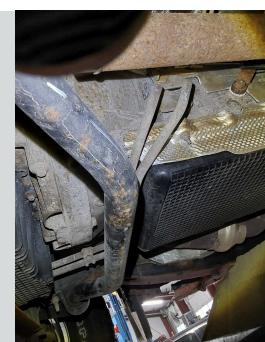[View on Web](#)

taken-on: Nov 21, 2025 2:16pm

[View on Web](#)

Underhood	Air Filters	CHECKED & OK
Underhood	Cabin Filters	CHECKED & OK
Underhood	Battery / Terminals	CHECKED & OK
Underhood	Fans	CHECKED & OK
Underhood	Hoses	CHECKED & OK
Underhood	Air Intake Tubes/Hoses	CHECKED & OK
Underhood	Engine Oil	CHECKED & OK
Underhood	Starter Operation	CHECKED & OK

**1st Stop Auto Care Centers**

(859) 223-4688

firststopauto@aol.com

600 Delzan Pl, Lexington, KY, USA,
40503**Inspection Report**

Against Estimate#: 84832

Created: Nov 21, 2025

Invoiced: Nov 21, 2025

Service Advisor: Greg Peel

Underhood	Drive Belts	CHECKED & OK
Exterior	Body Panels	CHECKED & OK
Exterior	Steering System	CHECKED & OK
Exterior	Exhaust System	CHECKED & OK
Exterior	Fuel Lines	CHECKED & OK
Exterior	Struts / Shocks	CHECKED & OK
Exterior	Sway Bar	CHECKED & OK
Exterior	Wheel Bearings	CHECKED & OK
Exterior	Tie-Rod Ends	CHECKED & OK
Exterior	Ball Joints	CHECKED & OK
Exterior	Exterior Lights	CHECKED & OK
Exterior	Wipers	CHECKED & OK
Exterior	Windshield	CHECKED & OK
Exterior	Tire condition	CHECKED & OK
Tires are all 14/32 tread, date from		
Exterior	Tire Pressure	CHECKED & OK
Interior	Horn	CHECKED & OK
Interior	Airbag	CHECKED & OK
Interior	Seatbelt	CHECKED & OK
Interior	Heating System	CHECKED & OK
Interior	Air Conditioning	CHECKED & OK
Interior	Interior Lights	CHECKED & OK
Interior	Warning Lights	CHECKED & OK
Interior	Rear Defrost	CHECKED & OK

**1st Stop Auto Care Centers**

(859) 223-4688

firststopauto@aol.com

600 Delzan Pl, Lexington, KY, USA,
40503**Inspection Report**

Against Estimate#: 84832

Created: Nov 21, 2025

Invoiced: Nov 21, 2025

Service Advisor: Greg Peel

Interior	Sun Roof	CHECKED & OK
Interior	Power Windows	CHECKED & OK
Interior	Spare Tire Tools	CHECKED & OK
Interior	Power Locks	CHECKED & OK